


**AMPROBE®**

HARD AT WORK SINCE 1948.

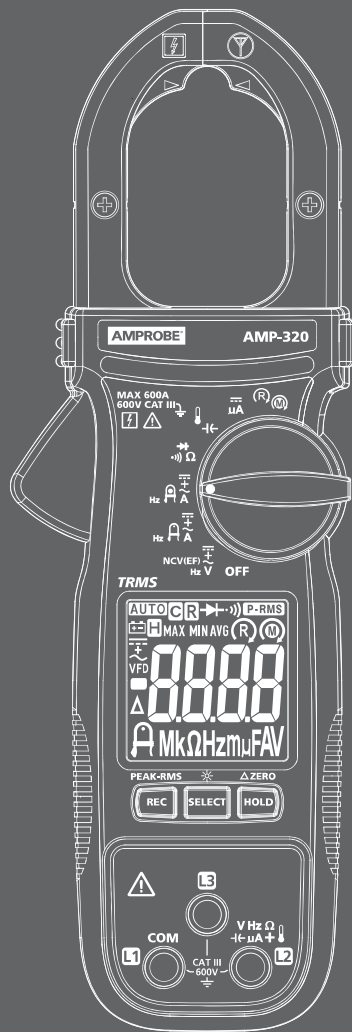

**AMP-210**  
**AMP-210-EUR**  
600A AC TRMS  
Clamp Multimeter

**AMP-220**  
**AMP-220-EUR**  
600A AC/DC TRMS  
Clamp Multimeter

**AMP-310**  
**AMP-310-EUR**  
600A AC TRMS  
Clamp Multimeter

**AMP-320**  
**AMP-320-EUR**  
600A AC/DC TRMS  
Clamp Multimeter

**User Manual**  
• Bedienungshandbuch



**AMP-210 / AMP-210-EUR**  
600A AC TRMS Clamp Multimeter

**AMP-220 / AMP-220-EUR**  
600A AC/DC TRMS Clamp Multimeter

**AMP-310 / AMP-310-EUR**  
600A AC TRMS Clamp Multimeter

**AMP-320 / AMP-320-EUR**  
600A AC/DC TRMS Clamp Multimeter

English

**User Manual**


7/2014, 6003318 A  
©2014 Amprobe Test Tools.  
All rights reserved. Printed in Taiwan

## **AMP-210 / AMP-210-EUR Series TRMS Clamp Multimeters**


### **CONTENTS**

|                                                          |    |
|----------------------------------------------------------|----|
| <b>SYMBOL</b> .....                                      | 3  |
| <b>SAFETY INFORMATION</b> .....                          | 4  |
| <b>UNPACKING AND INSPECTION</b> .....                    | 5  |
| <b>MEASUREMENTS</b> .....                                | 6  |
| Measuring AC and DC Voltage .....                        | 7  |
| Voltage detection (NCV) .....                            | 8  |
| Measuring AC and DC Current .....                        | 9  |
| Precise Low-Current Measurement .....                    | 10 |
| Microamps $\mu$ A Measurement .....                      | 11 |
| Measuring Resistance, Continuity and Diode .....         | 12 |
| Measuring Capacitance and Temperature .....              | 13 |
| Measuring $\text{M}$ & $\text{R}$ 3-Phase Rotation ..... | 14 |
| Auto Power Off .....                                     | 15 |
| <b>SPECIFICATIONS</b> .....                              | 16 |
| <b>ELECTRICAL SPECIFICATIONS</b> .....                   | 17 |
| <b>MAINTENANCE AND REPAIR</b> .....                      | 21 |
| <b>BATTERY REPLACEMENT</b> .....                         | 21 |

**AMP-210 / AMP-210-EUR Series TRMS Clamp Multimeters**

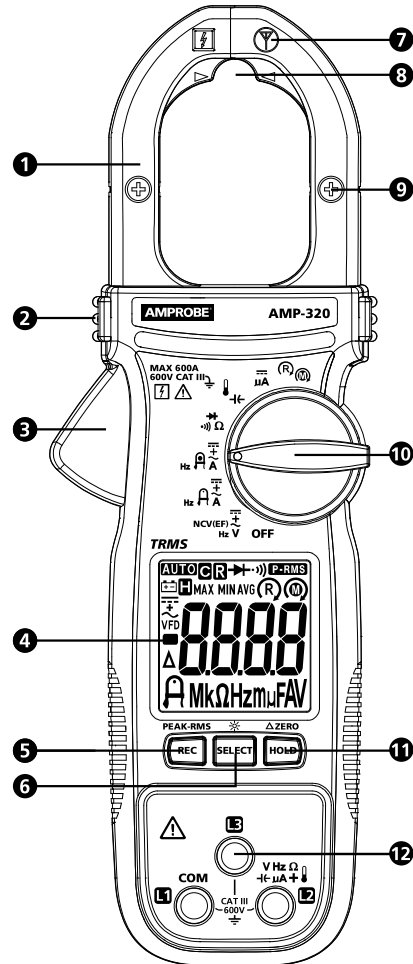

- |                                             |                                                       |
|---------------------------------------------|-------------------------------------------------------|
| ① Jaw                                       | ⑧ Precise Low Current Measuring Location              |
| ② Tactile Barrier                           | ⑨ Indicator of the Jaw Center for Current Measurement |
| ③ Jaw Release                               | ⑩ Rotary Switch                                       |
| ④ Display                                   | ⑪ Data Hold/ZERO button                               |
| ⑤ REC/PEAK-RMS Button                       | ⑫ Input Terminals                                     |
| ⑥ SELECT/Backlight Button                   |                                                       |
| ⑦ Antenna for Non-Contact Voltage Detection |                                                       |

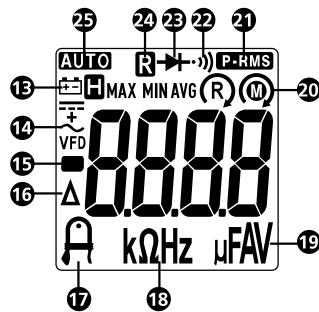

- 13 Low battery indicator
- Data hold
- 14 Alternative Current (AC)
- Direct Current (DC)
- AC + DC
- VFD Variable Frequency Dive
- 15 Negative reading
- 16 Relative zero is active
- 17 Precise low current measurement mode
- 18 **kΩ**: KiloOhms  
**Hz**: Hertz
- 19 **μF**: Microfarads  
**μA**: Microamps  
**A**: Amps  
**V**: Volts
- 20 Motor rotation indicator  
 Phase rotation indicator
- 21 **P-RMS** PEAK-RMS mode (in-rush current) is active
- 22 Continuity buzzer is active
- 23 Diode test mode is active
- 24 **R** Recording mode is active  
**MAX**: MAX mode is active  
**MIN**: MIN mode is active  
**AVG**: AVG mode is active
- 25 **AUTO** Auto-ranging

#### SYMBOLS

|                |                                                                                                                                                                                                        |
|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                | Application and removal from hazardous live conductors permitted                                                                                                                                       |
|                | Caution! Risk of electric shock.                                                                                                                                                                       |
|                | Caution! Refer to the explanation in this manual.                                                                                                                                                      |
|                | The equipment is protected by double insulation or reinforced insulation.                                                                                                                              |
|                | Earth (Ground).                                                                                                                                                                                        |
| <b>CAT III</b> | Overvoltage Category III is for equipment intended to form part of a building wiring installation. Such equipment includes socket outlets, fuse panels, and some mains installation control equipment. |
|                | Alternating Current (AC).                                                                                                                                                                              |

|                                                                                   |                                                                                        |
|-----------------------------------------------------------------------------------|----------------------------------------------------------------------------------------|
|  | Direct Current (DC).                                                                   |
|  | Battery.                                                                               |
|  | Underwriters Laboratories. [Note: Canadian and US.]                                    |
|  | Complies with European Directives.                                                     |
|  | Conforms to relevant Australian standards.                                             |
|  | Do not dispose this product as unsorted municipal waste. Contact a qualified recycler. |

### SAFETY INFORMATION

The Meter complies with:

- UL/IEC/EN 61010-1, CAN/CSA C22.2 No. 61010-1, Pollution Degree 2, Measurement category III 600 V
- IEC/EN 61010-2-033
- IEC/EN 61010-2-032
- IEC/EN 61010-031 (test leads)
- EMC IEC/EN 61326-1

**Measurement Category III (CAT III)** is for equipment intended to form part of a building wiring installation. Such equipment includes socket outlets, fuse panels, and some mains installation control equipment.

#### CENELEC Directives

The instruments conform to CENELEC Low-voltage directive 2006/95/EC and Electromagnetic compatibility directive 2004/108/EC.

#### **Warning: Read Before Using**

**To avoid possible electric shock or personal injury:**

- Use the Meter only as specified in this manual or the protection provided by the Meter might be impaired.
- Avoid working alone so assistance can be rendered.
- Never measure AC current while the test leads are inserted into the input jacks.
- Do not use the Meter in wet or dirty environments.
- Do not use the Meter if it appears damaged. Inspect the Meter before use. Look for cracks or missing plastic. Pay particular attention to the insulation around the connectors.
- Inspect the test leads before use. Do not use them if insulation is damaged or metal is exposed.
- Check the test leads for continuity. Replace damaged test leads before using the Meter.
- Have the Meter serviced only by qualified service personnel.
- Use extreme caution when working around bare conductors or bus bars. Contact with the conductor could result in electric shock.
- Do not hold the Meter anywhere beyond the tactile barrier.
- When measuring current, center the conductor in the clamp.

- Do not apply more than the rated voltage, as marked on the Meter, between the terminals or between any terminal and earth ground.
- Remove test leads from the Meter before opening the Meter case or battery cover.
- Never operate the Meter with the battery cover removed or the case open.
- Never remove the battery cover or open the case of the Meter without first removing the test leads or the jaws from a live conductor.
- Use caution when working with voltages above 30 V ac rms, 42 V ac peak, or 60 V dc. These voltages pose a shock hazard.
- Do not attempt to measure any voltage that might exceed the maximum range of the Meter.
- Use the proper terminals, function, and range for your measurements.
- Do not operate the Meter around explosive gas, vapor, or dust.
- When using probes, keep fingers behind the finger guards.
- When making electrical connections, connect the common test lead before connecting the live test lead; when disconnecting, disconnect the live test lead before disconnecting the common test lead.
- Disconnect circuit power and discharge all high-voltage capacitors before testing resistance, continuity, or diodes.
- Use only 1.5V AAA batteries, properly installed in the Meter case, to power the Meter.
- To avoid false readings that can lead to electrical shock and injury, replace the battery as soon as the low battery indicator () appears. Check Meter operation on a known source before and after use.
- When servicing, use only specified replacement parts.
- Adhere to local and national safety codes. Individual protective equipment must be used to prevent shock and arc blast injury where hazardous live conductors are exposed.
- Do not use the Meter if the wear indicator in the jaw opening is not visible.
- Only use the test lead provided with the Meter or UL Listed Probe Assembly rated CAT III 600V or better.


## UNPACKING AND INSPECTION

---

Your shipping carton should include:

- 1 Clamp meter
- 1 Test leads
- 1 Alligator clip set (AMP-310 and AMP-320 only)
- 1 Banana plug K-type thermocouple (AMP-310 and AMP-320 only)
- 1 1.5 V AAA batteries (installed)
- 1 User manual
- 1 Carrying case

If any of these items are damaged or missing, return the complete package to the place of purchase for an exchange.

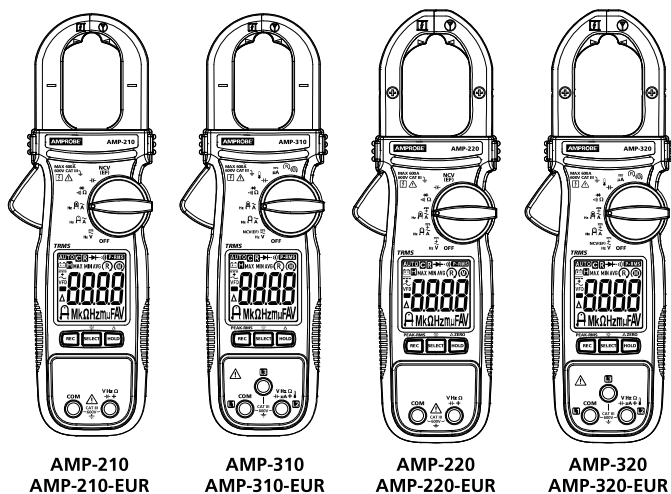

## MEASUREMENTS

### **⚠ ⚠ Warning**

To avoid possible electric shock or personal injury:

- When measuring current, center the conductor in the clamp.
- When making current measurements, disconnect the test leads from the Meter.
- Keep fingers behind Tactile Barrier.
- Use the proper function and range for measurements.
- Disconnect circuit power and discharge all high-voltage capacitors before testing resistance and diode.
- When using probes, keep fingers behind the finger guards.
- Connecting test leads:
  - Connect the common (COM) test lead to the circuit before connecting the live lead;
  - After measurement, remove live lead before removing the common (COM) test lead from the circuit.


| Button     | Description                                                                                                                                                                                                                                               |
|------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| SELECT / ☼ | <p>Press SELECT button to select the alternative measurement function on the rotary switch.</p> <p>Press SELECT button &gt; one second to turn ON or to turn OFF LCD backlight. LCD backlight automatically turns off after approximately 32 seconds.</p> |

|                      |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
|----------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| HOLD / $\Delta$ ZERO | <p>Press HOLD to freeze the display reading ( <math>\text{H}</math> is displayed) and releases the reading when pressed a second time.</p> <p><b><math>\Delta</math> <math>\Delta</math> Warning</b></p> <p>To avoid possible electric shock or personal injury, when Display HOLD is activated, be aware that the display will not change when you apply a different voltage.</p> <p>Press <math>\Delta</math> ZERO (HOLD) &gt; one second to clear last reading from the display ( <math>\Delta</math> is displayed) and establish a baseline for applicable selected functions.</p> <p>DC-Zero mode for dc and ac+dc currents. Press <math>\Delta</math> ZERO (HOLD) &gt; one second to activate DC-Zero (display shows "dc_0" for one second). When nulled value is larger than <math>\pm 5</math> DC A, an acoustic warning (3 short beeps) will occur.</p> |
| REC / PEAK-RMS       | <p>Press REC button to activate maximum, minimum and average reading memory mode ( <math>\text{R}</math> MAX MIN AVG is displayed). The meter beeps when MAX and MIN reading is updated during measurement. Press REC button again to read the MAX, MIN and AVG reading in sequence. Press REC button &gt; one second to exit MAX/MIN/AVG reading memory mode.</p> <p>Press REC / PEAK-RMS button &gt; one second to enter PEAK-RMS mode ( <math>\text{P-RMS}</math> is displayed) to capture inrush current or voltage RMS values (80 ms). Press a second time &gt; one second to exit.</p> <p>Note: Auto Power Off is automatically disabled under MAX/MIN/AVG and PEAKRMS modes.</p>                                                                                                                                                                          |

### Measuring AC and DC Voltage

To measure ac or dc voltage:

1. Turn the rotary function switch to  $\text{V}$  or  $\text{V}$
2. Press SELECT button to choose measurement function: AC V, DC V, DC+AC V, Hz or EF(Non contact voltage detection). The display reflects the chosen function mode. For Model AMP-210 and AMP-220, NCV(EF) function is designed in an independent rotary switch position. See the Non-Contact Voltage Detection chapter for details.
3. Connect the black test lead to the **COM** terminal and the red test lead to the V terminal. Before connecting the probes to the measurement points, add any clips to the probes that are necessary.
4. Measure the voltage by touching the probes to the desired test points of the circuit.
5. View the reading on the display.
6. When measuring AC voltage, press SELECT button to view the frequency reading on the display.

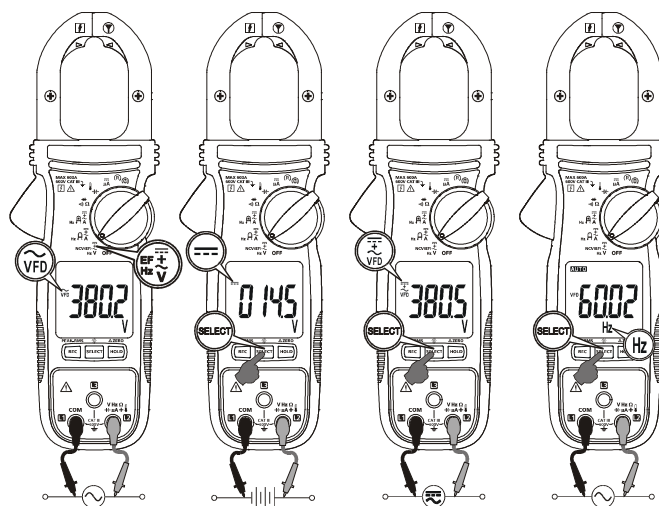


**Note:**

- AC V (and hence DC+AC V and Hz) function is equipped with digital low-pass filter, and is capable of dealing with VFD (Variable Frequency Drives) signals. It also improves AC V reading stability in noisy electrical environments.

**Voltage Detection (NCV)**

**Non-Contact Voltage Detection:**

1. For AMP-210 and AMP-220 turn the rotary switch to NCV(EF). EF is displayed. For AMP-310 and AMP-320, turn the rotary function switch to  $\overline{\sim}$  or  $\overline{\sim}+$ . press SELECT button to toggle to NCV(EF) mode ( EF is displayed).
2. The voltage detection antenna  $\text{Ⓢ}$  is located along the top-right end of the stationary clamp jaw for detecting electric field surrounds energized conductors
3. Detected electric field signal strength is indicated by a series of bar-graph segments on the display and beeper. The stronger the electric field detected, the more bar-graph segments are displayed and more intense beep sounds.

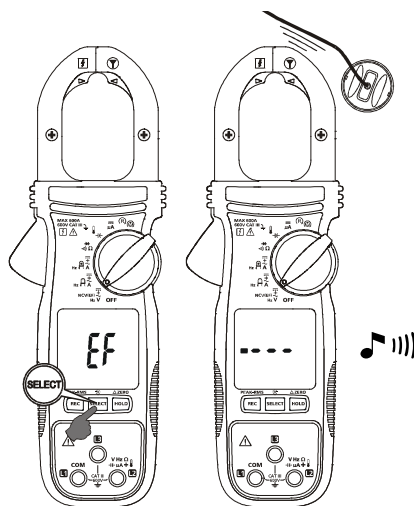

### Measuring AC and DC Current


#### **⚠ ⚠ Warning**

To avoid electrical shock and injury:

- Remove Test Leads before making current measurements.
- Do not hold the Meter anywhere beyond the tactile barrier.
- Do not use the Meter to measure currents above the maximum rated frequency (400Hz). Circulating currents may cause the magnetic circuits of the Jaws reach hazardous excessive temperatures.

To measure AC or DC current:

1. Turn the rotary function switch to  $\text{A} \sim$  or  $\text{A} \overline{\sim}$ .
2. Press SELECT button to choose measurement function (AC A, DC A, DC+AC A, or Hz). The display reflects the chosen function mode.
3. Open the clamp by pressing the jaw release and insert the conductor to be measured into the clamp. Ensure the jaws are firmly closed.
4. Close the clamp and center the conductor using the jaw alignment marks.
5. View the current reading on the display.
6. When measuring AC or AC + DC current, press SELECT button to view the frequency reading on the display.

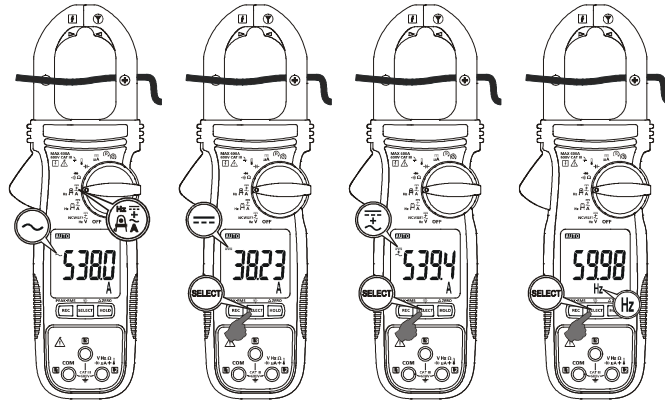

#### **⚠ Caution**

During current measurement keep the jaws away from other current-carrying devices such as transformers, motors or energized wires, as they may negatively influence accuracy of the measurement.

#### **Precise Low-Current Measurement**


##### **⚠ ⚠ Warning**

To avoid electrical shock and injury:

- Remove Test Leads before making current measurements.
- Do not hold the Meter anywhere beyond the tactile barrier.
- Do not use the Meter to measure currents above the maximum rated frequency (400Hz). Circulating currents may cause the magnetic circuits of the Jaws reach hazardous excessive temperatures.

To measure AC or DC low-current for small conductors:

1. Turn the rotary function switch to  $A\sim$  or  $A\sim+$ .
2. Press SELECT button to choose measurement function (AC A, DC A, DC+AC A, or Hz). The display reflects the chosen function mode.
3. Open the clamp by pressing the jaw release and insert the conductor to be measured into the clamp. Ensure the jaws are firmly closed.
4. Align the conductor at the specified jaw tip area for low-current measurement
5. View the current reading on the display.
6. When measuring AC or AC + DC current, press SELECT button to view the frequency reading on the display.

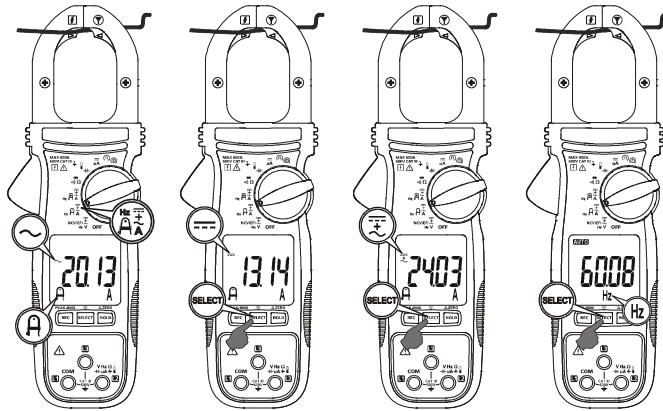


#### ⚠ Caution

During current measurement keep the jaws away from other current-carrying devices such as transformers, motors or energized wires, as they may negatively influence accuracy of the measurement.

#### Microamps $\mu A$ Measurement

The  $\mu A$  DC (  $\overline{\mu A}$  ) function on the Meter is primarily for HVAC flame sensor testing. To test a heating system flame sensor:

1. Turn the heating unit off and locate the wire between the gas-burner controller and the flame sensor.
2. Disconnect one of the flame sensor wires.
3. Turn the rotary switch on the Meter to  $\overline{\mu A}$ .
4. Connect the black test lead to the COM terminal and the red test lead to the  $\mu A$  terminal.
5. Using alligator clips, connect a meter in series by attaching one alligator clip to the disconnected flame sensor probe and the second one to the disconnected control-module terminal.
6. Turn heating unit on and check the reading on the Meter.
7. Refer to the heating unit documentation for what the correct reading should be.

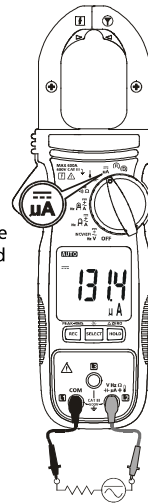

## Measuring Resistance, Continuity and Diode

### **⚠ ⚠ Warning**


- To avoid false readings that can lead to electrical shock and injury, de-energize the circuit before taking the measurement.
- To avoid electrical shock when testing resistance/continuity/diode in a circuit, make sure the power to the circuit is turned off and all capacitors are discharged. Use DC voltage function to check the capacitors are discharged.

1. Connect the black test lead to the COM terminal and the red test lead to the  $\Omega$  terminal.
2. Turn the rotary switch to  $\rightarrow \Omega$ .
3. Press SELECT button for desired measurement function.
4. Connect the probes across the circuit or component to be tested.

**Resistance measurement:** The resistance reading appears on the display. If the circuit is open or resistance exceeds the Meter's range, the display reads OL.

**Continuity measurement:** If the circuit is shorted, the Meter beeps and shows a reading  $\leq 10 \Omega$ . (Beeper ON  $\leq 10 \Omega$ , OFF  $> 250 \Omega$ ) If the circuit is open or resistance exceeds the Meter's range, the display reads OL.

**Testing diode:** When testing diode, normal forward voltage drop (forward biased) for a good silicon diode is between 0.400V to 0.900V. A reading higher than that indicates a leaky diode (defective). A zero reading indicates a shorted diode (defective). Display reads OL indicates an open diode (defective). Reverse the test leads connections (reverse biased) across the diode. The display reads OL if the diode is good. Any other readings indicate the diode is resistive or shorted (defective).

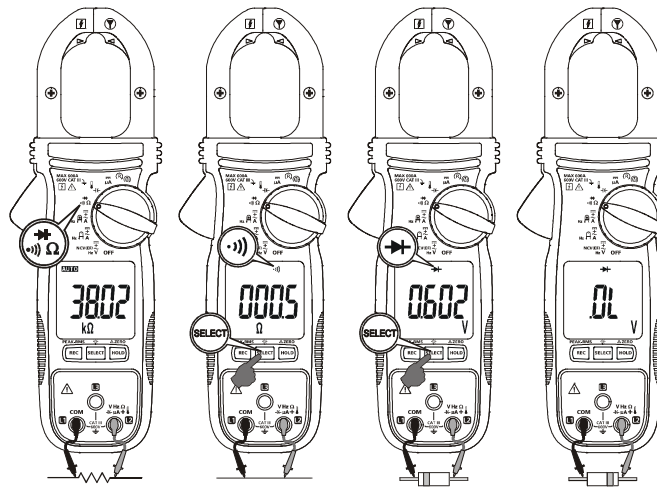

## Measuring Capacitance and Temperature

### **⚠ ⚠ Warning**

To avoid electrical shock and injury:

- When testing capacitor in a circuit, make sure the power to the circuit is turned off and all capacitors are discharged.
- When measuring temperature, DO NOT apply the temperature probe to any live conductive parts.

### Capacitance


1. Turn off circuit power, then disconnect and discharge the capacitor before measuring capacitance.
2. Connect the black test lead to the COM terminal and the red test lead to the  $\text{⏏}$  terminal
3. Turn the Meter's rotary switch to capacitance  $\text{⏏}$ .
4. Connect the probes across the capacitor to be tested. When measuring, be sure to note the correct polarity of the capacitor.

### Temperature

The Meter measures temperature in either Celsius (°C) or Fahrenheit (°F).

1. Connect the banana plug type-K temperature probe to the Meter's input terminal noting correct polarity of the probe.
2. Turn the rotary switch to  $\text{⌚}$ .
3. Press SELECT button to select °C or °F. The display reflects the chosen temperature mode (°C or °F).
4. Position the probe to take the measurement. The reading appears on the display.

**Note:** Type-K mini plug temperature probes can also be used with a plug adaptor with banana pins to type-K socket.

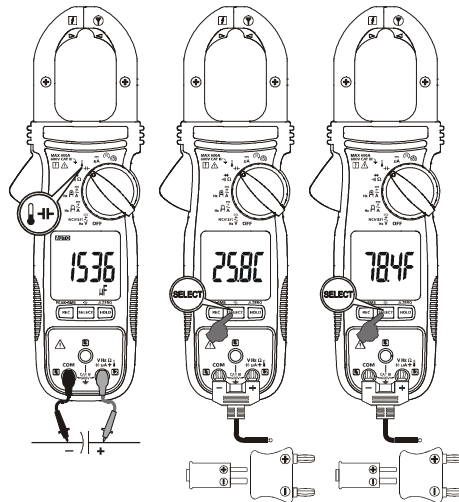

### Measuring $\text{M}$ & $\text{R}$ 3-Phase Rotation


Measurement is made through the Meter's terminals L1/L2/L3. Phase Rotation directions are indicated as symbolic (LCD segments) movements on the display. Default mode at  $\text{M}$ . Press SELECT button to toggle between  $\text{M}$  and  $\text{R}$  modes.

$\text{M}$  : Hi-sensitivity mode for checking phase rotation of Motors detects relatively low signal outputs generated spinning a motor shaft,.

$\text{R}$  : Normal-sensitivity mode for identifying phase sequence of 3-phase MAINS supply.

#### **⚠ Caution**

Correct rotation detection relies on solid signal connection to all three test lead terminals simultaneously. Any loose connection will lead to detection failure and false indication. To verify signal connection and the correct rotation indication, swap any of two signal connections to check for indication of reverse movement.

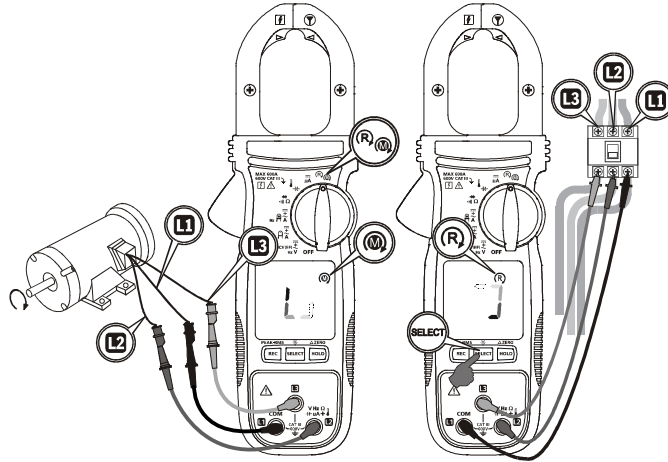

#### Hi-sensitivity mode $\text{M}$ for Motors:


Connect the test lead L1/L2/L3 to the motor connections by using probes and/or alligator clips. Be sure the power supply is removed from the motor. From the perspective of looking down the shaft of the motor, speedspin it clockwise to generate sufficient signal strength for rotary detection. If the meter indicates a clockwise movement, the motor leads connected to L1, L2 and L3 of the meter are L1, L2 and L3 (also known as R, S and T), respectively. If the meter indicates a counter-clockwise movement, swap any of two motor connections and retest.

#### Normal mode (R) for the MAINS circuit:

Connect the test lead L1/L2/L3 to the 3-phase mains circuit by using probes and/or alligator clips. If the meter indicates a clockwise movement, the phases connected to L1, L2 and L3 of the meter are L1, L2 and L3 (also known as R, S and T), respectively. If the meter indicates a counter-clockwise movement, swap any two connects between the meter and phases. Then retest. Connecting the above mentioned L1, L2 and L3 of a motor and that of the MAINS respectively should get a clockwise motor movement.

#### Using the Beeper feature on (M) & (R) mode:

Press and hold the REC button while turning the rotary switch to (M) (R) to enable the beeper, the display shows  $\text{Enbp}$ . When making rotary measurement, if the rotary indication segments indicate a clockwise movement, the beeper sounds a single long beep per segment cycle. If the rotary indication segments indicate a counter clockwise movement, the beeper sounds 3 short beeps per segment cycle.

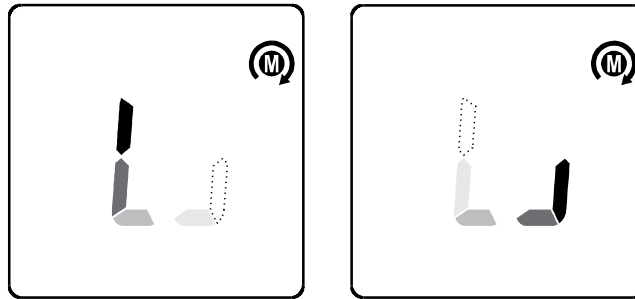

#### Auto Power Off

The meter turns off if there is no button pushed, rotary function switch operation for 32 minutes and/or no specified activities below, where applicable:

- 1.) Significant measuring readings of above 8.5% of ranges
- 2.) Non-OL readings for Resistance, Continuity or Diode function
- 3.) Non-zero readings for Hz function
- 4.) Significant movement indication as in Phase Rotation functions

The meter will not enter auto power off mode when under normal measurements. To turn the meter back on, press the SELECT button and release, or turn the rotary switch off and on to restart the meter.

## SPECIFICATIONS

|                                         |                                                                                                                                                                                                                                                                                                                                              |
|-----------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Display</b>                          | 3-5/6 digits 6000 counts                                                                                                                                                                                                                                                                                                                     |
| <b>Sensing</b>                          | True RMS                                                                                                                                                                                                                                                                                                                                     |
| <b>Polarity</b>                         | Automatic                                                                                                                                                                                                                                                                                                                                    |
| <b>Update rate</b>                      | 5 per second nominal                                                                                                                                                                                                                                                                                                                         |
| <b>Operating temperature</b>            | 32 °F to 104 °F (0 °C to 40 °C)                                                                                                                                                                                                                                                                                                              |
| <b>Relative humidity</b>                | Maximum relative humidity 80% for temperature up to 31°C, decreasing linearly to 50% relative humidity at 40 °C                                                                                                                                                                                                                              |
| <b>Storage temperature</b>              | -4 °F to 140 °F (-20 °C to 60 °C), < 80% R.H. (with battery removed)                                                                                                                                                                                                                                                                         |
| <b>Pollution degree</b>                 | 2                                                                                                                                                                                                                                                                                                                                            |
| <b>Operating altitude</b>               | ≤ 2000 m                                                                                                                                                                                                                                                                                                                                     |
| <b>Temperature coefficient</b>          | nominal 0.15 x (specified accuracy)/ °C @(0°C to 18°C or 28°C to 40°C), or otherwise specified                                                                                                                                                                                                                                               |
| <b>Transient Protection</b>             | 6.0 kV (1.2/50 µs surge)                                                                                                                                                                                                                                                                                                                     |
| <b>Overload protections</b>             | Current & Hz functions via jaws: 600 A ac/dc rms at < 400Hz<br>Voltage & 3-Phase Rotation functions via terminals: 660 V dc / 920 V ac rms<br>Other functions via terminals: 600 V ac/dc rms                                                                                                                                                 |
| <b>E.M.C.</b>                           | Meets EN61326-1:2006<br>DC A and DC+AC A Functions, in an RF field of 1V/m: Total Accuracy = Specified Accuracy + 20 digits at around 405MHz<br>DC µA and Ohm Functions, in an RF field of 1V/m: Total Accuracy = Specified Accuracy + 25 digits<br>Other Functions, in an RF field of 3V/m: Total Accuracy = Specified Accuracy + 20 digits |
| <b>Agency approval</b>                  |                                                                                                                                                                                                                                                           |
| <b>Power supply</b>                     | Two 1.5V AAA Size battery                                                                                                                                                                                                                                                                                                                    |
| <b>Power consumption</b>                | Typical 13mA for Current functions; 4.3mA for others                                                                                                                                                                                                                                                                                         |
| <b>Low battery indication</b>           | Approx. 2.85 V for Capacitance & Hz; approx. 2.5 V for other functions                                                                                                                                                                                                                                                                       |
| <b>Auto power off</b>                   | Idle for 32 minutes                                                                                                                                                                                                                                                                                                                          |
| <b>Auto power off power consumption</b> | 5µA typical                                                                                                                                                                                                                                                                                                                                  |

|                                                     |                                                                                                                                            |
|-----------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Dimension<br/>(L x W x H)</b>                    | 8.82 x 3.03 x 1.46 in (224 x 77 x 37 mm)<br>for AMP-220 and AMP-320<br>8.62 x 3.03 x 1.46 in (219 x 77 x 37 mm)<br>for AMP-210 and AMP-310 |
| <b>Weight</b>                                       | 254 g (0.56 lb) for AMP-220 and AMP-320 with batteries<br>installed<br>208 g (0.46 lb) for AMP-210 and AMP-310 with batteries<br>installed |
| <b>Jaw opening<br/>&amp; conductor<br/>diameter</b> | 1.37 in (35 mm) max for AMP-220 and AMP-320<br>1.18 in (30 mm) for AMP-210 and AMP-310                                                     |

#### ELECTRICAL SPECIFICATIONS

Accuracy is  $\pm$  (% reading digits + number of digits) or otherwise specified at  $23^{\circ}\text{C} \pm 5^{\circ}\text{C}$ .

Maximum Crest Factor < 2.5:1 at full scale & < 5:1 at half scale or otherwise specified, and with frequency spectrum not exceeding the specified frequency bandwidth for non-sinusoidal waveforms.

#### DC Voltage

| Range  | Accuracy                       |
|--------|--------------------------------|
| 600.0V | $\pm (1.0 \% + 5 \text{ LSD})$ |

Input Impedance: 10 M $\Omega$ , 100 pF nominal

#### AC Voltage (with Digital Low-Pass Filter)

| Range  | Accuracy                       |
|--------|--------------------------------|
| 600.0V | $\pm (1.0 \% + 5 \text{ LSD})$ |

Frequency: 50 Hz to 60 Hz

Input Impedance: 10 M $\Omega$ , 100 pF nominal

#### DC+AC Voltage (with Digital Low-Pass Filter) (AMP-220 and AMP-320 only)

| Range  | Accuracy                       |
|--------|--------------------------------|
| 600.0V | $\pm (1.2 \% + 7 \text{ LSD})$ |

Frequency: DC, 50 Hz to 60 Hz

Input Impedance: 10 M $\Omega$ , 100 pF nominal

#### PEAK-rms (AC V & AC A for AMP-220, AMP-310 and AMP-320 only)

Response: 80 ms to > 90 %

#### Continuity

Audible Threshold: ON at  $\leq 10 \Omega$  ; OFF at  $> 250 \Omega$

Response time: 32ms approx.

**Resistance**

| Range                                                | Accuracy                       |
|------------------------------------------------------|--------------------------------|
| 600.0 $\Omega$ , 6.000 k $\Omega$ , 60.00 k $\Omega$ | $\pm (1.0 \% + 5 \text{ LSD})$ |

Open Circuit Voltage: 1.0VDC typical

**Capacitance**

| Range                                    | Accuracy <sup>1)</sup>         |
|------------------------------------------|--------------------------------|
| 200.0 $\mu\text{F}$ , 2500 $\mu\text{F}$ | $\pm (2.0 \% + 4 \text{ LSD})$ |

1) Accuracy with film capacitor or better

**Diode**

| Range   | Accuracy                       |
|---------|--------------------------------|
| 2.000 V | $\pm (1.5 \% + 5 \text{ LSD})$ |

Test Current: 0.3mA typically

Open Circuit Voltage: < 3.5VDC typically

**DC  $\mu\text{A}$  (AMP-310 and AMP-320 only)**

| Range                                    | Accuracy                       | Burden Voltage        |
|------------------------------------------|--------------------------------|-----------------------|
| 200.0 $\mu\text{A}$ , 2000 $\mu\text{A}$ | $\pm (1.0 \% + 5 \text{ LSD})$ | 3.5 mV/ $\mu\text{A}$ |

**Temperature (AMP-310 and AMP-320 only)**

| Range                                                | Accuracy                                   |
|------------------------------------------------------|--------------------------------------------|
| -40.0 $^{\circ}\text{C}$ to -10.0 $^{\circ}\text{C}$ | $\pm (1\% + 1.5 \text{ }^{\circ}\text{C})$ |
| > -10 $^{\circ}\text{C}$ to 99.9 $^{\circ}\text{C}$  | $\pm (1\% + 0.8 \text{ }^{\circ}\text{C})$ |
| 100 $^{\circ}\text{C}$ to 400 $^{\circ}\text{C}$     | $\pm (1\% + 1 \text{ }^{\circ}\text{C})$   |
| -40.0 $^{\circ}\text{F}$ to 14.0 $^{\circ}\text{F}$  | $\pm (1\% + 3.0 \text{ }^{\circ}\text{F})$ |
| > 14.0 $^{\circ}\text{F}$ to 99.9 $^{\circ}\text{F}$ | $\pm (1\% + 1.5 \text{ }^{\circ}\text{F})$ |
| 100 $^{\circ}\text{F}$ to 752 $^{\circ}\text{F}$     | $\pm (1\% + 2 \text{ }^{\circ}\text{F})$   |

K-type thermocouple accuracy tolerances not included

**Precise Low Current AC**

| Range   | Accuracy <sup>1) 2) 3) 4)</sup> |
|---------|---------------------------------|
| 60.00 A | $\pm (1.5 \% + 5 \text{ LSD})$  |

Frequency: 50 Hz to 60 Hz

1) Induced error from adjacent current-carrying conductor: < 0.01 A/A

2) Specified with relative zero  $\Delta$  mode applied to offset the non-zero residual readings, if any.

3) Add 10 LSD to the specified accuracy @ < 4 A

4) AMP-210 and AMP-310, not specified @ < 0.2 A

**Precise Low Current DC (AMP-220 and AMP-320 only)**

| Range   | Accuracy <sup>1) 2) 3)</sup> |
|---------|------------------------------|
| 60.00 A | ± (2.0 % + 5 LSD)            |

- 1) Induced error from adjacent current-carrying conductor: < 0.01 A/A  
 2) Specified with DC-zero mode applied to offset the non-zero residual readings, if any  
 3) Add 10 LSD to the specified accuracy @ < 4 A

**Precise Low Current DC+AC (AMP-220 and AMP-320 only)**

| Range   | Accuracy <sup>1) 2) 3)</sup> |
|---------|------------------------------|
| 60.00 A | ± (2.0 % + 5 LSD)            |

**Frequency:** DC, 50 Hz to 60 Hz

- 1) Induced error from adjacent current-carrying conductor: < 0.01 A/A  
 2) Specified with DC-zero mode applied to offset the non-zero residual readings, if any  
 3) Add 10 LSD to the specified accuracy @ < 4 A

**AC Current**

| Range                              | Accuracy <sup>1) 2) 3)</sup>         |
|------------------------------------|--------------------------------------|
| 60.00 A <sup>4) 5)</sup> , 600.0 A | ± (1.8 % + 5 LSD) @ 50 Hz to 100 Hz  |
| 60.00 A <sup>4) 5)</sup> , 600.0 A | ± (2.0 % + 5 LSD) @ 100 Hz to 400 Hz |

- 1) Induced error from adjacent current-carrying conductor: < 0.01 A/A  
 2) AMP-220 and AMP-320: maximum crest factor < 2:1 at full scale & < 4:1 at half scale  
 3) AMP-210 and AMP-310: specified accuracy is for measurements made at the jaw center. When the conductor is not positioned at the jaw center, add 2% to specified accuracy for position errors  
 4) AMP-220 and AMP-320: add 10 LSD to the specified accuracy @ < 9 A  
 5) AMP-210 and AMP-310: add 10 LSD to specified accuracy @ < 6 A, and not specified @ < 0.2 A

**DC Current (AMP-220 and AMP-320 only)**

| Range                           | Accuracy <sup>1) 2) 3)</sup> |
|---------------------------------|------------------------------|
| 60.00 A <sup>3)</sup> , 600.0 A | ± (2.0 % + 5 LSD)            |

- 1) Induced error from adjacent current-carrying conductor: < 0.01 A/A  
 2) Specified with DC-zero mode applied to offset the non-zero residual readings, if any  
 3) Add 10 LSD to the specified accuracy @ < 9 A

**DC+AC Current (AMP-220 and AMP-320 only)**

| Range                           | Accuracy <sup>1) 2)</sup>               |
|---------------------------------|-----------------------------------------|
| 60.00 A <sup>3)</sup> , 600.0 A | ± (2.2 % + 7 LSD) @ DC, 50 Hz to 100 Hz |
| 60.00 A <sup>3)</sup> , 600.0 A | ± (2.7 % + 7 LSD) @ 100 Hz to 400 Hz    |

1) Induced error from adjacent current-carrying conductor: < 0.01 A/A

2) Specified with DC-zero mode applied to offset the non-zero residual readings, if any

3) Add 10 LSD to the specified accuracy @ < 9 A

**Frequency Hz**

| Function                   | Sensitivity <sup>1)</sup> (Sine rms) | Range                |
|----------------------------|--------------------------------------|----------------------|
| 600 V                      | 50 V                                 | 5.00 Hz to 999.9 Hz  |
| 60 A (Precise low current) | 40 A                                 | 50.00 Hz to 400.0 Hz |
| 60 A, 600 A                | 40 A                                 | 50.00 Hz to 400.0 Hz |

Accuracy: ± (1.0 % + 5 LSD)

<sup>1)</sup> DC-bias, if any, not more than 50% of Sine rms

**Ⓜ & Ⓡ 3-Phase Rotation**

**Ⓜ measurement:**

**Voltage Range:** 65 V to 600 V (sine wave only)

**Frequency Range:** 35 Hz to 400 Hz

**Ⓡ measurement:**

**Voltage Range:** 0.4 V to 600 V (sine wave only)

**Frequency Range:** 3 Hz to 400 Hz

**Voltage Detection (NCV)**

| Typical Voltage                   | Bar-graph Indication |
|-----------------------------------|----------------------|
| 20 V (tolerance: 10 V to 36 V)    | -                    |
| 55 V (tolerance: 23 V to 83 V)    | - -                  |
| 110 V (tolerance: 59 V to 165 V)  | - - -                |
| 220 V (tolerance: 124 V to 330 V) | - - - -              |
| 440 V (tolerance: 250 V to 600 V) | - - - - -            |

**Indication:** bar-graph segments and audible beep tones proportional to the field strength

**Detection frequency:** 50/60 Hz

**Detection antenna:** inside the top side of the stationary jaw

## MAINTENANCE AND REPAIR

---

If the Meter fails to operate, check battery, test leads, etc., and replace as necessary.

Double check the following:

1. Replace the fuse or battery if the meter does not work.
2. Review the operating instructions for possible mistakes in operating procedure.

Except for the replacement of the battery, repair of the meter should be performed only by a Factory Authorized Service Center or by other qualified instrument service personnel.

The front panel and case can be cleaned with a mild solution of detergent and water. Apply sparingly with a soft cloth and allow to dry completely before using. Do not use aromatic hydrocarbons, gasoline or chlorinated solvents for cleaning.

## BATTERY REPLACEMENT

---

When battery voltage drops below the value required for proper operation, the battery symbol (  ) appears.

### **Warning**

**To avoid shock, injury, or damage to the Meter, disconnect test leads before opening case.**

**Replacing BATTERY follow below steps:**

1. Disconnect the test lead probe from measuring circuit.
2. Turn the Meter to OFF position.
3. Remove the screws from the battery cover and open the battery cover
4. Remove the batteries and replace with 1.5V AAA Size (IEC R03). Observe correct polarity when installing the batteries.
5. Put the battery cover back and re-fasten the screw. Battery: 2 x 1.5 V AAA (IEC R03)

