Operating Instructions



# METRAHIT T-COM PLUS

Cable Multimeter for Measurements in Symmetrical Copper Cable Networks

3-349-560-03 9/3.20



### Standard Equipment – Contact Persons

### **Standard Equipment**

- 1 Cable multimeter
- 1 Protective rubber cover
- 1 KS21-T cable set (1000 V CAT III) consisting of: one 2-conductor measurement cable (yellow/blue), 2 meters long, with test probes, 1 earth terminal cable (black), 2 meters long, with test probe
- 1 DAkkS calibration certificate with calibration report
- 2 Batteries, 1.5 V, type AA, installed
- 1 Condensed operating instructions \*
- \* Detailed operating instructions are available for download on the Internet

### Standard Equipment – Contact Persons

#### Accessories (sensors, plug inserts, adapters, consumable materials)

The accessories available for your instrument are checked for compliance with currently valid safety regulations at regular intervals, and are amended as required for new applications. Currently up-to-date accessories which are suitable for your measuring instrument are listed at the following web address along with photo, order number, description and, depending upon the scope of the respective accessory, data sheet and operating instructions:

See also chapter 11 on page 72.

#### Manufacturer

If required please contact:

#### **Product Support**

If required please contact:

GMC-I Messtechnik GmbH **Product Support Hotline** 

### Software Enabling for METRAwin 10

GMC-I Messtechnik GmbH Front Office

9



### Standard Equipment - Contact Persons

#### **Recalibration Service**

We **calibrate** and **recalibrate** all instruments supplied by GMC-I Messtechnik GmbH, as well as other manufacturers, at our service center, for example after one year within the framework of your test equipment monitoring program, as well as prior to use etc. and offer you test equipment management free of charge.

#### Repair and Replacement Parts Service Calibration Center\* and Rental Instrument Service

If required please contact:

GMC-I Service GmbH **Service Center** 

This address is only valid in Germany. Please contact our representatives or subsidiaries for service in other countries.

\* DAkkS Calibration Laboratory for Measured Electrical Quantities D-K-15080-01-01 accredited per DIN EN ISO/IEC 17025

Accredited quantities: direct voltage, direct current value, direct current resistance, alternating voltage, alternating current value, AC active power, AC apparent power, DC power, capacitance, frequency, temperature

#### **Competent Partner**

GMC-I Messtechnik GmbH is certified in accordance with DIN EN ISO 9001.

Our DAkkS calibration laboratory is accredited by the Deutsche Akkreditierungsstelle GmbH (National accreditation body for the Federal Republic of Germany) in accordance with DIN EN ISO/IEC 17025 under registration number D-K-15080-01-01.

We offer a complete range of expertise in the field of metrology: from **test reports** and **factory calibration certificates**, right on up to **DAkkS calibration certificates**.

Our spectrum of offerings is rounded out with free **test equipment management**.

As a full service calibration lab, we can calibrate instruments from other manufacturers as well.

### **Table of Contents**

Conte	ents Page	Conte	nts	Page
1	Safety Features and Precautions8	5	Measurements	26
1.1	Use for Intended Purpose10	5.1	Voltage Measurement	26
1.2	Meanings of Danger Symbols10	5.1.1	Direct and Pulsating Voltage Measurement, V DC and V (DC+AC) .	27
1.3	Meanings of Acoustic Warning Signals10	5.1.2	Alternating Voltage and Frequency Measurement V AC and Hz	
			with Selectable Low-Pass Filter	28
2	Operating Overview	5.2	Resistance Measurement, Ohm	30
	- Connections, Keys, Rotary Switch, Symbols	5.3	Temperature Measurement – Temp RTD	31
	connections, region retails of months of months and the	5.3.1	Measurement with Resistance Thermometers	31
3	Initial Start-Up	5.4	Continuity Test	33
<b>3</b> .1	Batteries	5.5	Diode Testing with 1 mA Constant Current	
3.1 3.2	Activation	5.6	Capacitance Measurement	35
3.2 3.3	Setting the Operating Parameters	5.6.1	Cable Length Measurement m	35
3.4	Switching the Instrument Off	5.7	Current Measurement	36
3.4	Switching the instrument on	5.7.1	Direct and Pulsating Current Measurement, Direct Connection,	
,	Combact Franchisms		A DC and A (DC+AC)	37
4	Control Functions	5.7.2	Alternating Current and Frequency Measurement,	
4.1	Selecting Measuring Functions and Measuring Ranges		Direct Connection, A AC and Hz	38
4.1.1	Automatic Range Selection	5.7.3	Direct and Pulsating Current Measurement	
4.1.2	Manual Measuring Range Selection		with Clip-On Current Sensor, A DC and A (DC+AC)	39
4.1.3	Quick Measurements	5.7.4	Alternating Current Measurement with Clip-On Current Sensor,	
4.2	Zero Offset / Relative Measurements		A AC and Hz	40
4.3	Display (LCD)			
4.3.1	Digital Display	6	Measurements in Symmetrical Copper Cable Networks	42
4.3.2	Analog Display	6.1	"R <sub>SL</sub> " Loop Impedance Measurement with 2 mA Constant Current	
4.4	Measured Value Storage: DATA (auto-hold / compare)	6.2	Detection of Interference Voltages	
4.4.1	Saving Minimum and Maximum Values – MIN/MAX Function22	6.3	Insulation Resistance Measurement:	
4.5	Measurement Data Recording23		in Telecommunications Networks – $M\Omega$ ISO Function	43
		6.3.1	Connecting the Measurement Cables	44
		6.3.2	Selection of Test Voltage or Galvanic Signature	
			Performing Insulation Resistance Measurements	
			-	

### **Table of Contents**

Contents Page		Conte	ents	Page	
6.3.4 6.4 6.4.1 6.5	Ending the Measurement and Discharging	<b>11</b> 11.1 11.2 11.3 11.4	Accessories (Standard Equipment See Page 2)  General  Technical Data for Measurement Cables (scope of delivery: KS21-T safety cable set)  Power Pack NA X-TRA	72 72 72	
7	Device and Measuring Parameters52		mtoriaco / 1000001100		
7.1 7.2 7.3 7.4 7.5 <b>8</b> 8.1 8.2	Paths to the Various Parameters	12	Index	74	
9	Technical Data60				
10 10.1 10.2 10.3 10.4 10.5 10.6 10.7	Maintenance and Calibration68Displays – Error Messages68Batteries68Fuses69Housing Maintenance70Return and Environmentally Sound Disposal70Recalibration71Manufacturer's Guarantee71				

### Safety Warnings

#### Safety Features and Precautions

You have selected an instrument which provides you with a high level of safety.

This instrument fulfills the requirements of the applicable EU guidelines and national regulations. This is confirmed by means of the CE mark. A corresponding declaration of conformity can be requested from GMC-I Messtechnik GmbH.

The TRMS digital multimeter has been manufactured and tested in accordance with the following safety regulations:

IEC 61010-1:2010 / DIN EN 61010-1:2011 /VDE 0411-1:2011. When used for its intended purpose (see page 10), safety of the operator, as well as that of the instrument, is assured. Their safety is however not guaranteed, if the instrument is used improperly or handled carelessly.

In order to maintain flawless technical safety conditions, and to assure safe use, it is imperative that you read the operating instructions thoroughly and carefully before placing your instrument into service, and that you follow all instructions contained therein.

#### Measuring Categories and their Significance per IEC 61 010-1

CAT	Definition
ı	Measurements in electrical circuits which are not directly connected to the mains: e.g. electrical systems in motor vehicles and aircraft, batteries etc.
II	Measurements in electrical circuits which are electrically connected to the low-voltage mains: via plug, e.g. in household, office and laboratory applications
Ш	Measurements in building installations: stationary consumers, distributor terminals, devices connected permanently to the distributor

The measuring category and the maximum rated voltage which are printed on the device apply to your measuring instrument, e.g. 600 V CAT II.

For the application of measuring cables see page 72.

#### Observe the following safety precautions:

- The multimeter may not be used in potentially explosive atmospheres.
- The multimeter may only be operated by persons who are capable of recognizing contact hazards and taking the appropriate safety precautions. Contact hazards according to the standards exist anywhere, where voltages of greater than 33 V RMS or 70 V DC may occur. Avoid working alone when taking measurements which involve contact hazards. Be certain that a second person is present.
- Maximum allowable voltage between the voltage measuring sockets or all connector sockets and ground is 600 V for measuring category II, and 300 V for measuring category III.

#### · Weak battery

If the "weak battery" icon appears in the battery level indicator, it's no longer permissible to perform safety-relevant measurements. Furthermore, compliance with the listed specifications is no longer assured in the case of a weak battery.

- Be prepared for the occurrence of unexpected voltages at devices under test (e.g. defective devices). For example, capacitors may be dangerously charged.
- Make certain that the measurement cables are in flawless condition, e.g. no damage to insulation, no interruptions in cables or plugs etc.
- No measurements may be made with this instrument in electrical circuits with corona discharge (high-voltage).
- Special care is required when measurements are made in HF electrical circuits. Dangerous pulsating voltages may be present
- Measurements under moist ambient conditions are not permitted.
- Be absolutely certain that the measuring ranges are not overloaded beyond their allowable capacities. Limit values are included in chapter 9; "Technical Data" in the table entitled "Measuring Functions and Measuring Ranges" in the "Overload Capacity" column.
- The multimeter may only be operated with installed batteries or rechargeable batteries. Dangerous currents and voltages are otherwise not indicated, and the instrument may be damaged.
- The instrument may not be operated if the fuse cover or the battery compartment lid has been removed, or if its housing is open.

 The input for the current measuring range is equipped with a fuse link.

Maximum permissible voltage for the measuring circuit (= rated voltage of the fuse) is 600 V AC/DC.

Use specified fuses only (see page 64)! The fuse must have a **breaking capacity** of at least 10 kA.

#### Opening of Equipment / Repair

The equipment may be opened only by authorized service personnel to ensure the safe and correct operation of the equipment and to keep the warranty valid.

Even original spare parts may be installed only by authorized service personnel.

In case the equipment was opened by unauthorized personnel, no warranty regarding personal safety, measurement accuracy, conformity with applicable safety measures or any consequential damage is granted by the manufacturer.

#### Repair and Parts Replacement

When the instrument is opened, voltage conducting parts may be exposed. The instrument must be disconnected from the measuring circuit before the performance of repairs or the replacement of parts. If repair of a live open instrument is required, it may only be carried out by trained personnel who are familiar with the dangers involved.

### Safety Warnings

#### **Defects and Extraordinary Strains**

If it may be assumed that the instrument can no longer be operated safely, it must be removed from service and secured against unintentional use.

Safe operation can no longer be relied upon:

- If the device demonstrates visible damage,
- If the instrument no longer functions, or if malfunctioning occurs.
- After long periods of storage under unfavorable conditions, e.g. humidity, dust or extreme temperature (see "Ambient Conditions" on page 64).

#### 1.1 Use for Intended Purpose

- The respective multimeter is a portable device which can be held in the hand during the performance of measurements.
- Only those types of measurements described in chapter 5 may be performed with the measuring instrument.
- The measuring instrument, including measurement cables and plug-on test probes, may only be utilized within the specified measuring category (see page 64 and the table on page 8 regarding significance).
- Overload limits may not be exceeded. See technical data on page 60 for overload values and overload limits.
- Measurements may only be performed under the specified ambient conditions. See page 64 regarding operating temperature range and relative humidity.
- The measuring instrument may only be used in accordance with the specified degree of protection (IP code) (see page 66).

#### 1.2 Meanings of Danger Symbols



Warning concerning a point of danger (attention: observe documentation!)



Warning concerning dangerous voltage at the measurement input: U > 15 V AC or U > 25 V DC

#### 1.3 Meanings of Acoustic Warning Signals

 $\square$ ) \\_\\_\\_ Voltage warning: > 620 V (intermittent acoustic signal)

 $\square$ ) Current warning: > 1.2 A (continuous acoustic signal)

### Operating Overview - Connections, Keys, Rotary Switch, Symbols



- 1 Display (LCD) (see page 13 for significance of symbols)
- 2 MAN / AUTO shift key for manual/automatic measuring range selection △ Increase parameter values / MΩ ISO: Test voltage 10 V/100 V/signature "Operating Mode" menu: Selection of individual menu entries against the direction of flow
- 3 ON / OFF I LIGHT key for switching device and display illumination on and off
- 4 **FUNC | ENTER** multifunction key

"Operating Mode" menu: Acknowledge entry (ENTER)

UISO ON / OFF Insulation resistance measurement

Key for switching insulation resistance measurement on and off

- 5 ▷ Increase measuring range or move decimal point to the right (MAN function)
- 6 **Rotary switch** for measuring functions (see page 14 for significance of symbols)
- 7 DAkkS calibration mark
- 8 Connector socket for ground / connected to ground
- 9 Connector socket for current measurement with automatic blocking
- 10 Connector socket for voltage, resistance, temperature, diode and capacitance measurement with automatic blocking

#### 11 **DATA / MIN / MAX**

Key for freezing, comparing, deleting the measured value, and for Min/Max function  $\nabla$  Decrease values / **M** $\Omega$  **ISO**: Test voltage 10 V/100 V/signature

"Operating Mode" menu: Select individual menu entries in flow direction

- 12 **MEASURE I SETUP** Key for switching between measuring and menu functions
- 13 **ZERO | ESC**

Key for zero balancing

"Operating Mode" menu: Exit menu level and return to a higher level, exit

parameters entry function without saving

POL / UISO CAP:


Insulation resistance measurem. / CAP: Capacitance measurement Press and hold key to reverse the polarity of the cable under test; prerequisite: rotary switch set to MΩ ISO (a-b)(a-E)(b-E)

- 14 < Decrease measuring range or move decimal point to the left (MAN function)
- 15 Power pack connector jack
- 16 Infrared interface



### Operating Overview - Connections, Keys, Rotary Switch, Symbols

#### Symbols used in the Digital Display

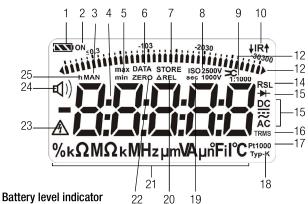

Battery full



Battery OK





Battery weak



Battery (almost) dead, U < 2.0 V

### Interface indicator

**↓IR**↑

Data transmission ↓ to / ↑ from the multimeter is active

IR

IR interface in standby mode (ready to receive starting commands)

- 1 Battery level indicator
- ON: continuous operation (automatic shutdown deactivated)
- 3 MAN: manual measuring range selection active
- 4 Digital display with decimal point and polarity display
- 5 max/min: Min/Max value storage
- 6 DATA: display memory, "freeze measured value"
- 7 STORE: memory mode active
- 8 ISO: insulation resistance measurement (if blinking active) / selected test voltage 10 V or 100 V
- 9 1: x current clip factor (transformation ratio)
- 10 IR: infrared interface display
- 11 Scale for analog display
- 12 Pointer for analog display (bar graph pointer) depending upon setting in SELJP menu for the A.J. SP parameter triangle appears: indicates overranging
- 13 R<sub>SI</sub>: loop impedance measurement selected
- 14 Diode measurement selected
- 15 Selected type of current
- 16 TRMS measurement
- 17 Pt100(0): selected platinum resistance thermometer with automatic recognition of Pt100/Pt1000
- 18 No function
- 19 sec (seconds): unit of time
- $\Delta$ REL: relative measurement with reference to offset
- 21 Unit of measure
- 22 ZERO: zero balancing active
- 23 Warning regarding dangerous voltage: U > 15 V AC or U > 25 V DC
- 24 (1) Continuity test with acoustic signal active
- 25 h (hours): unit of time

### Operating Overview - Connections, Keys, Rotary Switch, Symbols

### Symbols used for Rotary Switch positions

Switch	FUNC	Display	Measuring Function			
V~	0/4	V~ AC TRMS	Alternating voltage, AC TRMS, full bandwidth			
Hz (V)	1	Hz ~ AC	Voltage frequency, full bandwidth			
V~ 200 Hλ	2	V Fil ~ AC TRMS	Alternating voltage, AC TRMS, with low pass filter (200 Hz)			
Hz (V) 200 Ha	3	Hz FiI ~ AC	Voltage frequency, with low pass filter (200 Hz)			
V	0/2	V DC	Direct voltage			
V≅	1	V≂ DC AC TRMS	Pulsating voltage, TRMS ( $V_{ACDC} = \sqrt{V_{AC}^2 + V_{DC}^2}$ )			
R <sub>SL</sub>	0/3	RPE $\Omega$	Loop impedance measurement with acoustic signal where I is constant			
<u>r(</u> ))	1	<b>□</b> ()) Ω	Continuity test with acoustic signal			
<b>→</b>	2	→ V DC	Diode voltage where I is constant			
Ω	0/2	Ω	(DC) resistance			
Temp. RTD	1	°C Pt 100/1000	Temperature with Pt 100 / Pt 1000 resistance thermometer			
⊣⊢	0/2	nF	Capacitance			
m (km)	1	m (km)	Cable length (via capacitive linear electric constant)			
a-b, a-E, b-E 0/2 V Extraneous voltage test		Extraneous voltage test				
$M\Omega_{ISO}$ @10V/100V	1	ISO 100 V / kΩ / MΩ	Insulation resistance measurement:			
CAP	*	nF	Interference-immune capacitance measurement in selector switch positions (a-b)(a-E)(b-E)			
A	0/2	A DC	Direct current value			
A≅	1	A≅ DC AC TRMS	Pulsating current amperage, AC DC TRMS			
A~	0/2	A~ AC TRMS	Alternating current amperage, AC TRMS			
Hz (A)	1	Hz ~ AC	Current frequency			
<b>&gt;</b> A	0/2	A DC <b>&gt;</b> C	DC amperage with AC DC clip-on current sensor, 1 V:1/10/100/1000 A			
≫ A≅	1	A≅ DC AC TRMS ➤	Pulsating current amperage, TRMS, with AC DC clip-on current sensor, see above			
<b>&gt;</b> ○ A~	0/2	A~ AC TRMS <b>&gt;</b> C	Alternating current amperage, TRMS, with clip-on current sensor, see above			
Hz (>CA) 1 Hz ~ AC >C Current frequency with clip-on current sensor, see above			Current frequency with clip-on current sensor, see above			

<sup>\*</sup> POL / UISO *CAP*:1

### User Interface Symbols in the Following Chapters

▷ ... ▷ Scroll through main menu  $\triangledown \dots \triangledown$ Scroll through submenu  $\triangleleft \triangleright$ Select decimal point  $\nabla \Delta$ Increase/decrease value

ь ПЕ Submenu/parameter (7-segment font) hFo Main menu (7-segment font, boldface)

#### Symbols on the Device



Warning concerning a point of danger (attention: observe documentation!)



Ground

CAT II / III Measuring category II or III device, see also

"Measuring Categories and their Significance per IEC 61010-1" on page 8.



Continuous, doubled or reinforced insulation



Indicates EC conformity

▲ IR ▼ Position of the infrared interface, window on the top of the instrument



Position of the power pack adapter socket, see also chapter 3.1.



Fuse for current measuring ranges (see chapter 10.3)



The device may not be disposed of with the trash. Further information regarding the WEEE mark can be accessed on the Internet at

WEEE (see also chapter 10.5).

Calibration mark (blue seal):

XY123 Serial number D-K--German Accrediation Body GmbH - Calibration lab Registration number 2012-08 Date of calibraion (year - month)

See also "Recalibration" on page 71.

#### Initial Start-Up - Setup

### 3 Initial Start-Up

#### 3.1 Batteries

Be certain to refer to chapter 10.2 regarding correct battery installation!

Momentary battery voltage can be queried in the "Info" menu (see chapter 7.3).



#### Attention!

Disconnect the instrument from the measuring circuit before opening the battery compartment lid in order to replace the batteries.

#### Operation with Power Pack (not included, see chapter 11.3) \*

Installed batteries are disconnected electronically if the NA X-TRA power pack is used, and need not be removed from the instrument. If rechargeable batteries are used, they must be recharged externally.

If the external power supply is switched off, the device is switched to battery operation without interruption.

 for highly sensitive impedance measurements (R/C) we recommend battery operation

#### 3.2 Activation

#### Switching the Instrument On Manually

⇒ Press the ON / OFF I LIGHT key until the display appears. Power-up is acknowledged with a brief acoustic signal. As long as the key is held depressed, all of the segments at the liquid crystal display (LCD) are illuminated.

The LCD is depicted on page 13.

The instrument is ready for use as soon as the key is released.

#### **Display Illumination**

After the instrument has been switched on, background illumination can be activated by briefly pressing the **ON / OFF I LIGHT** key. Illumination is switched back off by once again pressing the same key, or automatically after approximately 1 minute.

#### Switching the Instrument On with a PC

The multimeter is switched on after transmission of a data block from the PC, assuming the ", r5Lb" parameter has been set to ", r an" (see chapter 7.4).

However, we recommend using the power saving mode: ", raFF".



#### Note

Electrical discharge and high frequency interference may cause incorrect displays to appear, and may disable the measuring sequence.

**Disconnect the device from the measuring circuit.** Switch the instrument off and back on again in order to reset. If the problem persists, briefly dislodge the battery from the connector contacts (see also chapter 10.2).

#### 3.3 Setting the Operating Parameters

#### **Setting Time and Date**

See "L, NE" and "dRLE" parameters in chapter 7.4.

#### Display Modes for the Analog Display

Selection can be made from two different display modes (see "A.d, 5P" parameter in chapter 7.4).

### Display Modes for the Digital Display

Selection can be made from two different display modes (see " $0.d \cdot 5P$ " parameter in chapter 7.4).



#### 3.4 Switching the Instrument Off

#### Switching the Instrument Off Manually

Press the **ON / OFF I LIGHT** key until **OFF** appears at the display. Shutdown is acknowledged with a brief acoustic signal.

#### Automatic Shutdown

The instrument is switched off automatically if the measured value remains unchanged for a long period of time (maximum measured value fluctuation of approximately 0.8% of the measuring range per minute or 1° C or 1° F per minute), and if none of the keys or the rotary switch have been activated before a selected period of time in minutes has elapsed (see "APaFF" parameter on page 53). Shutdown is acknowledged with a brief acoustic signal. Exceptions include:

Transmission and memory mode operation, continuous operation and whenever a dangerous voltage is applied to the input (U > 15 V AC or U > 25 V DC).

#### **Disabling Automatic Shutdown**


The instrument can be set to continuous operation.

Simultaneously press the

$$\underbrace{ \frac{\text{ON / OFF}}{\text{LIGHT}} }$$
 and  $\underbrace{ \frac{\text{FUNC}}{\text{ENTER}} }$  keys to this end.

The "Continuous On" function is indicated at by means of the on display to the right of the battery symbol.

The "Continuous On" setting can only be cancelled by changing the respective parameter, and not by switching the instrument off (see "FPoFF" on page 55).

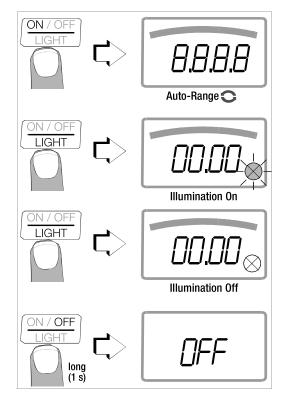

#### **Control Functions**

#### 4 Control Functions

#### 4.1 Selecting Measuring Functions and Measuring Ranges

#### 4.1.1 Automatic Range Selection

The multimeter is equipped with auto-ranging for all measuring functions, except for temperature measurement, and diode and continuity testing. Auto-ranging is active as soon as the instrument is switched on. The instrument automatically selects the measuring range which allows for highest possible resolution of the applied quantity. When the instrument is switched to frequency measurement, the previously selected voltage measuring range remains active.

#### **AUTO-Range Function**

The multimeter is switched automatically to the next higher range at  $\pm (3099 \text{ d} + 1 \text{ d} \rightarrow 03 \text{ lD d})$ , and to the next lower range at  $\pm (280 \text{ d} - 1 \text{ d} \rightarrow 2799 \text{ d})$ .

#### 4.1.2 Manual Measuring Range Selection

Auto-ranging can be deactivated and measuring ranges can be selected manually in accordance with the following table by pressing the MAN / AUTO button.

The desired measuring range can then be selected with the  $\lhd$  or  $\rhd$  key.

The instrument is automatically returned to range selection when the MAN / AUTO key is pressed, the rotary switch is activated or the instrument is switched off and back on again.

#### Overview: Auto-Ranging and Manual Range Selection

	Function	Display
MAN / AUTO	Manual mode active: utilized measuring range is fixed	MAN
⊲ or ⊳	Range switching sequence for: V: $300 \text{ mV}^* \leftrightarrow 3 \text{ V} \leftrightarrow 30 \text{ V} \leftrightarrow 300 \text{ V} \leftrightarrow 600 \text{ V}$ Hz: $300 \text{ Hz} \leftrightarrow 3 \text{ kHz} \leftrightarrow 30 \text{ kHz} \leftrightarrow 300 \text{ kHz} (\text{Hz(U)})$ $\Omega$ : $300 \Omega \leftrightarrow 3 \text{ k}\Omega \leftrightarrow 30 \text{ k}\Omega \leftrightarrow 300 \text{ k}\Omega \leftrightarrow 30 \text{ M}\Omega \leftrightarrow 30 \text{ M}\Omega$ A: $300 \mu\text{A} \leftrightarrow 3 \text{ mA} \leftrightarrow 30 \text{ mA} \leftrightarrow 300 \text{ mA} \leftrightarrow 1 \text{ A}$ $R$ : See chapter 5.7.3 und chapter 5.7.4  F-III: $R$ : $R$	MAN
MAN / AUTO	Return to automatic measuring range selection	_

<sup>\*</sup> Via manual measuring range selection only

The multimeter is held in the selected measuring range. If the range limit is exceeded, DL appears at the display. You should then switch to the next higher measuring range with the help of the  $\triangleright$  key.

**Measurement type M\Omega\_{ISO}:** If the measured value is less than 10% of the measuring range after manual measuring range selection,  $\boldsymbol{ur}$  (under range) appears at the display. You should then select the next smaller measuring range with the help of the  $\lhd$  key.

#### 4.1.3 Quick Measurements

Measurements performed using a suitable fixed measuring range are executed more quickly than those which utilize automatic range selection. Quick measurement is made possible with the following two functions:

 Manual measuring range selection, i.e. selection of the measuring range with the best resolution (see chapter 4.1.2)

or

 With the DATA function (see chapter 4.4). In this way, the appropriate measuring range is selected automatically after the first measurement and the second measurement is executed more quickly.

The selected measuring range remains active for the subsequent series of measurements with these two functions.

### 4.2 Zero Offset / Relative Measurements

Zero balancing or a reference value for relative measurements can be stored to memory depending upon deviation from the zero point:

Deviation from zero — with short-circuited measurement cables for V, $\Omega$ , A — with open input for capacitance unit of measure: F	Display
0 to 200 digits	ZERO ΔREL
> 200 to 1500 digits	ΔREL

The relevant reference or correction value is deducted individually for the respective measuring function as an offset from all future measurements and remains in memory until deleted, or until the multimeter is switched off.

Zero balancing and reference value adjustment can be used for auto-ranging, as well as for manual measuring range selection.

#### Zero Balancing

- Plug the measuring cables into the instrument and connect the free ends to each other, except for capacitance measurement in which case the ends of the cables are not connected to each other.
- Briefly press the ZER0 I ESC key. The instrument acknowledges zero balancing with an acoustic signal, and the "ZERO ΔREL" symbol appears at the LCD. The value measured at the moment the key is pressed serves as a reference value.
- Zero balancing can be cleared by once again pressing the ZERO I ESC key.



As a result of TRMS measurement, the multimeter displays a residual value of 1 to 10/35 digits with short-circuited measurement cables as the zero point for V AC / I AC or V(AC+DC) / I (AC+DC) measurements (non-linearity of the TRMS converter). This has no influence on specified accuracy above 1% of the measuring range (or 10% in the mV ranges).

#### Setting the Reference Value

Plug the measuring cables into the instrument and measure a reference value (max. 1500 digits).

#### **Control Functions**

- Briefly press the ZERO I ESC key.
  - The instrument acknowledges storage of the reference value with an acoustic signal, and the "ZERO  $\Delta$ REL" or the " $\Delta$ REL" symbol appears at the LCD. The value measured at the moment the key is pressed serves as a reference value.
- The reference value can be cleared by once again pressing the ZERO I ESC key.

#### Notes Regarding Relative Measurement

- Relative measurement effects the digital display only. The analog display continues to read out the original measured value.
- In the case of relative measurement,  $\Omega$  F or AC quantities may also appear as negative values.

#### 4.3 Display (LCD)

#### 4.3.1 Digital Display

### Measured Value, Unit of Measure, Type of Current, Polarity

The measured value with decimal and plus or minus sign appears at the digital display. The selected unit of measure and current type are displayed as well. A minus sign appears to the left of the value during the measurement of zero-frequency quantities, if the plus pole of the measured quantity is applied to the "L" input. The "D.d , 5P" parameter can be used to determine whether leading zeros will be appear or be suppressed at the measured value display (see chapter 7.4).

#### Overranging

If the upper range limit of 3100 digits is exceeded " $D\!L$ " (overload) appears at the display.

Exceptions: "DL" appears at the display as of 610.0 V in the case of voltage measurement in the 600 V range, as of 5100 digits for diode testing, and as of 1100 digits in the 1 A range.

#### 4.3.2 Analog Display

#### Measured Value, Polarity

The analog display demonstrates the dynamic performance of a moving-coil mechanism. This display is especially advantageous for observing measured value fluctuation, and for balancing procedures.

Two different display modes can be selected in the "**£££**" menu with the help of the "*£*.4 , *5*" parameter (see chapter 7.4):

- Bar graph
- Pointer: the current measured value is tracked in real-time

The analog scale displays a negative range of 5 scale divisions for the measurement of zero-frequency quantities, allowing for precise observation of measured value fluctuation around zero. If the measured value exceeds the negative range of 5 scale divisions, polarity is reversed at the analog display.

Scaling of the analog scale is automatic. This is very helpful for manual measuring range selection.

#### Overranging

Overranging in the positive range is displayed by means of the right triangle symbol.

#### Refresh Rate

In the bar graph and pointer modes, the analog display is refreshed 40 times per second.

#### 4.4 Measured Value Storage: DATA (auto-hold / compare)

An individual measured value can be automatically "frozen" with the DATA function (auto-hold). This is useful, for example, when contacting the measuring points with the test probes requires your full attention. After the measuring signal has been applied and the measured value has settled in in accordance with the "condition" listed in the table below, the measured value is frozen at the digital display and an acoustic signal is generated. The test probes can now be removed from the measuring points, and the measured value can be read from the digital display. If the measuring signal falls below the value specified in the table, the function is reactivated for storage of the next value.


#### Measured Value Comparison (DATA Compare)

If the currently frozen value deviates from the first saved value by less than 100 digits, the acoustic signal is generated twice. If deviation is greater than 100 digits, only one brief acoustic signal is generated.



The DATA function has no effect on the analog display, at which the current measured value continues to appear. However, when the digital display is "frozen", the decimal point is fixed as well (fixed measuring range, symbol: MAN). The selected measuring range should not be manually changed as long as the DATA function is active.

The DATA function is deactivated by pressing and holding the DATA/MIN/MAX key (approx. 1 second), when the measuring function is changed or when the instrument is switched off and back on again.

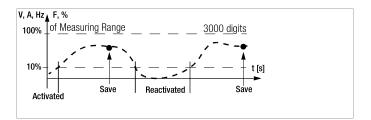

		Cond	dition	Response from Instrument			
DATA Function	Press DATA / Min/Max	Measuring Function	Measuring Signal	Dis MV Digital	DATA	Acou- stic	
Activate	Brief			3	Blinks	Once	
Save (stabilized measured		V, A, F, Hz, % Ω □())	> 10% of R ≠∏	ls dis- played	Static	Once Twice <sup>2)</sup>	
value)  Reactivate 1)		- <del>▶</del> - V, A, F, Hz, %	< 10% of R	Stored	Stored	Stored Blinks	
neactivate /		Ω□)) →	= OL	MV	DIIIIKS		
Change to Min/Max	brief	See table in chapter 4.4.1					
Exit	long			Is cleared	Is cleared	Twice	

1) Reactivation results from falling short of specified measured value limits. 2) Two acoustic signals are generated the first time a measured value is saved as a reference value. For subsequent data hold, two acoustic signals are only

generated if the currently frozen value deviates from the first saved value by less than 100 digits.

Key: MV = measured value, R = measuring range

#### **Control Functions**

#### Example

The voltage measuring range is set manually to 30 V. The first measured value is 5 V and is stored to memory because it is greater than 10% of the measuring range (= 3 V), and is thus reliable above the background noise level. As soon as the measured values drops to less than 10% of the measuring range, i.e. amounts to less than 3 V which corresponds to removal of the test probes from the measuring point, the instrument is ready to store a new value.

#### 4.4.1 Saving Minimum and Maximum Values – MIN/MAX Function

Minimum and maximum measured values applied to the measuring instrument's input after the Min/Max function has been activated can be "frozen" at the display. The most important use of this function is the determination of minimum and maximum values during long-term measured value observation.

The Min/Max function can be activated in all measuring functions. The Min/Max function has no effect on the analog display, at which the current measured value continues to appear.

Apply the measured quantity to the instrument and set the measuring range with the MAN / AUTO key before activating the Min/Max function.

The Min/Max function is deactivated by pressing and holding the DATA/MIN/MAX key (approx. 1 second), when the measuring function is changed or when the instrument is switched off and back on again.



#### Note

As opposed to the DATA function, the Min/Max function can also be used for temperature measurement.

			Response from Instrument			
Function	Press DATA / Min/Max	Min. and Max.	Display	Aco		
Min/Max		Measured Values	Measured Value Digital	Max. Min.	us- tic Sig- nal	
1 Activate and save	2 x brief	Are saved	Current measured value	Max and min	Twice	
2 Save and	2 Brief Storage continues in background, new min. and max. values are displayed.	Saved min. value	Min.	Once		
		Saved max. value	Max.	Once		
3 Return to 1	Brief	Same as 1, stored values are not deleted	Same as 1	Same as 1	Once	
Stop	Long	Are deleted	Current measured value	Is deleted	Twice	

#### 4.5 Measurement Data Recording

The cable multimeter is capable of recording measurement data using an adjustable sampling rate for long periods of time in the form of measurement series. Data are stored to a battery-backed memory module, and are retained even after the multimeter is switched off. The system acquires measured values relative to real-time.

Stored measured values can subsequently be read out with the help of METRAwin 10 software. The only prerequisite is a PC which is connected by means of an interface cable to the USB X-TRA bidirectional interface adapter, which is plugged onto a cable multimeter. See also chapter 8, "Interface Operation".

#### **Memory Parameters Overview**

Parameter	Page: Header			
CLEAr 24: Clear Memory				
ENPLY	ENPLY 24: Clear Memory – appears after ELEA-			
DECLP 24: Querying Memory Occupancy				
FRILE 54: rAtE – set the sampling rate				
SEARL 23: Starting Recording via Menu Functions				
5LoP 24: Ending Recording				

#### The STORE Menu Function

- First set the sampling rate for memory mode operation (see chapter 7.4 the *-ALE* parameter), and then start memory mode operation.
- First select the desired measuring function and an appropriate measuring range.
- Check the battery charge level before starting long-term measurement recordings (see chapter 7.3). Connect the NA X-TRA power pack if required.

#### Starting Recording via Menu Functions

Switch to the "SELP" mode by pressing MEASURE I SETUP, and select the "56-E" menu.



- Memory mode operation is started by activating FUNC I ENTER. STORE appears underneath the analog display and indicates that the memory mode has been activated. "5LoP" appears at the digital display.
- Press MEASURE I SETUP in order to return to the measuring function.

#### **Control Functions**

#### **During Recording**

**STORE** is displayed underneath the analog display during memory mode operation, and **memory occupancy** can be monitored:

5toP > 000.3%

The following message appears as soon as memory is full: " IDD.D%".

In order to be able to **observe measured values during recording**, switch to the measuring function by pressing **MEASURE I SETUP**. The display is returned to the memory menu after once again pressing **MEASURE I SETUP**.

A new memory block is created when another measuring function is selected with the rotary switch or the **FUNC I ENTER** key. Data storage then continues automatically.

#### **Ending Recording**

⇒ "5½0" appears at the display after pressing MEASURE I SETUP.

- Acknowledge the "5Lop" display by pressing FUNC | ENTER.

  STORE is cleared from the display indicating that recording has been ended.
- Press MEASURE I SETUP in order to return to the measuring function.
- Memory mode operation can also be exited by switching the multimeter off.

#### **Querying Memory Occupancy**

Memory occupancy can be queried during recording with the help of the " Irra" menu (see also chapter 7.3).

Memory occupancy range: 000. 1% to 099.9%.

Memory occupancy can be queried before recording is started via the "Start" menu.

#### **Clear Memory**

This function deletes all measured values from memory! This function cannot be executed during memory mode operation.

#### 5 Measurements

#### 5.1 Voltage Measurement

#### **Notes Regarding Voltage Measurement**

- The multimeter may only be operated with the batteries installed.
   Dangerous voltages are otherwise not indicated, and the instrument may be damaged.
- The multimeter may only be operated by persons who are capable of recognizing contact hazards and taking the appropriate safety precautions. Contact hazards exist anywhere, where voltages of greater than 33 V RMS may occur.
  - The test probes may only be only gripped up to the finger guard. Do not touch the metallic test probes under any circumstances.
- Avoid working alone when taking measurements which involve contact hazards. Be certain that a second person is present.
- Maximum allowable voltage between terminals 9 or 10 and ground (8) is 600 V for measuring category II, and 300 V for measuring category III.
- Be prepared for the occurrence of unexpected voltages at devices under test (e.g. defective devices). For example, capacitors may be dangerously charged.
- No measurements may be made with this instrument in electrical circuits with corona discharge (high-voltage).
- Special care is required when measurements are made in HF electrical circuits. Dangerous pulsating voltages may be present.

- Be aware of the fact that dangerous voltage spikes are not displayed during measurement with the low-pass filter.
   We recommend measuring voltage without the low-pass filter first, in order to be able to detect any dangerous voltages.
- Be absolutely certain that the measuring ranges are not overloaded beyond their allowable capacities. Limit values are included in chapter 9, "Technical Data", in the table entitled "Measuring Functions and Measuring Ranges" in the "Overload Capacity" column.

#### 5.1.1 Direct and Pulsating Voltage Measurement, V DC and V (DC+AC)

Set the *EL P* parameter to **OFF** in the current clip setup menu. Otherwise all measured values are displayed in amperes, and are corrected by the amount resulting from the selected transformation ratio for an interconnected clip-on current sensor.


- In accordance with the voltage to be measured, turn the rotary switch to V .... or V ≅.
- Connect the measurement cables as shown. The "\( \pm \)" connector jack should be grounded.



An intermittent acoustic signal warns the operator if the measured value exceeds the upper range limit in the 600 V

Make sure that a current measuring range ("A") has not been activated when the multimeter is connected for voltage measurement! If the fuse's blowing limits are exceeded as a result of operator error, both the operator and the instrument are in danger!

With the rotary switch in the V position, the multimeter is always in the 3 V measuring range immediately after it is switched on. As soon a the MAN / AUTO key is pressed, and assuming the measured value is less than 280 mV, the multimeter is switched to the mV measuring range.

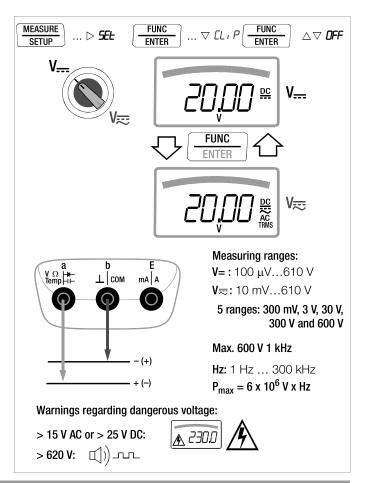

GMC-I Messtechnik GmbH 27

www.calcert.com

## 5.1.2 Alternating Voltage and Frequency Measurement V AC and Hz with Selectable Low-Pass Filter

Set the *EL, P* parameter to **DFF** in the current clip setup menu. Otherwise all measured values are displayed in amperes, and are corrected by the amount resulting from the selected transformation ratio for an interconnected clip-on current sensor.

- In accordance with the voltage or frequency to be measured, turn the rotary switch to V~ or Hz.
- Connect the measurement cables as shown. The "\( \t \)" connector jack should be grounded.

#### Voltage Measurement



An intermittent acoustic signal warns the operator if the measured value exceeds the upper range limit in the 600 V range.

Make sure that a current measuring range ("A") has not been activated, when the multimeter is connected for voltage measurement! If the fuse's blowing limits are exceeded as a result of operator error, both the operator and the instrument are in danger!

- You can switch back and forth between voltage measurement with and without low-pass filter.
- □ Repeatedly press the FUNC I ENTER multifunction key, until the V or V/Fil unit of measure appears at the display.

#### **Frequency Measurement**

- Apply the measured quantity is the same way as for voltage measurement.
- Manually select the measuring range for the voltage amplitude. When the instrument is switched to frequency measurement, the previously selected voltage measuring range remains active.
- You can switch back and forth between frequency measurement with and without low-pass filter. Repeatedly press the FUNC I ENTER multifunction key, until the Hz or Hz/Fil unit of measure appears at the display. Lowest measurable frequencies and maximum allowable voltages are included in chapter 9, "Technical Data".

#### Measurement with Low-Pass Filter



#### Attention!


Be aware of the fact that dangerous voltage spikes are not displayed during this type of measurement (see also "Voltage Comparator".

We recommend measuring voltage without the low-pass filter first, in order to be able to detect any dangerous voltages.

A 200 Hz low-pass filter can be activated if required, in order to filter out capacitively induced high frequency pulses of greater than 200 Hz, for example when performing measurements at cables, i.e. undesired voltages of greater than 200 Hz can be suppressed.

An active low-pass filter is indicated by the Fil display. The multimeter is automatically switched to manual measuring range selection.


Specified measuring accuracy is not reached with signals of greater than 100 Hz when the filter is active.

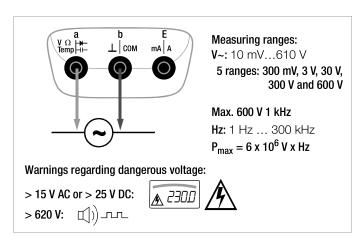

### Voltage Comparator for Displaying Dangerous Voltage

The input signal or measuring signal is checked by a voltage comparator for dangerous spikes, because these do not appear at the display when the low-pass filter is used.

At voltages of greater than 15 V AC or 25 V DC, a danger symbol appears at the display: /

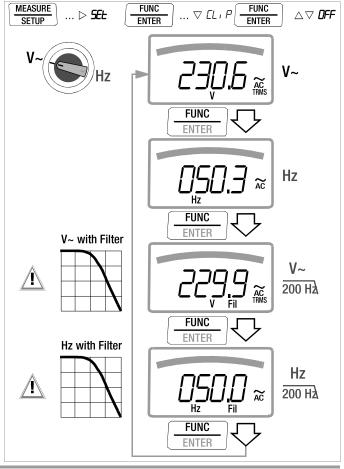

### Measurements: V/Hz $-\Omega - \square(1)$ - Temp $- \dashv \vdash - m - A/Hz$

#### 5.2 Resistance Measurement, Ohm

- Disconnect supply power from the electrical circuit of the device to be measured, and discharge all high-voltage capacitors.
- A Make sure that the device under test is voltage-free. Interference voltages distort measurement results! Refer to chapter 5.1.1 regarding testing for the absence of voltage with the help of the direct voltage measurement.
- $\Rightarrow$  Set the rotary switch to " $\Omega$ ".
- Connect the device under test as shown.




Use short or shielded measurement cables in the case of high-impedance resistance.



Resistance measurement " $\Omega$ " is not suitable for measurements in symmetrical copper cable networks. Use the loop impedance measurement function instead, see chapter 6.1.

### Improving Accuracy by means of Zero Balancing

Cable resistance and contact resistance can be eliminated in all measuring ranges by means of zero balancing (see chapter 4.2).

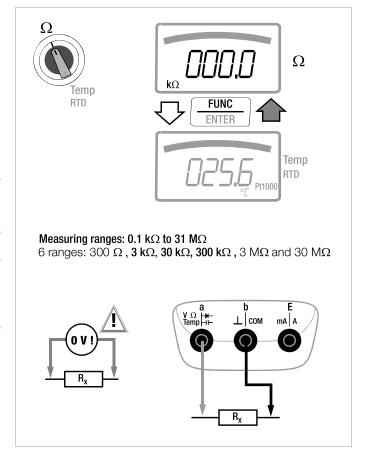

#### 5.3 Temperature Measurement – Temp RTD

Temperature measurement is performed with a Pt100 or Pt1000 resistance thermometer (accessory, not included), which is connected to the voltage input.

#### Selecting the Unit of Measure for Temperature



(°C = default setting)

#### 5.3.1 Measurement with Resistance Thermometers

 $\Rightarrow$  Set the rotary switch to " $\Omega$ " or "Temp<sub>RTD</sub>".

Press the **FUNC I ENTER** key in order to change to the other measuring function if required.

The sensor type, i.e. Pt100 or Pt1000, is detected automatically and displayed.

There are two different ways to compensate for cable resistance:

#### **Automatic Compensation**


Acknowledge by pressing the ZERO I ESC key. "Short leads" appears at the display.

If you prefer to enter cable resistance directly, you can skip the following entry prompt.

Short circuit the measuring instrument's connector cables. "DDD.D" appears at the display. After pressing the FUNC I ENTER key, automatic compensation of cable resistance is activated for all subsequent measurements. The short-circuit can now be eliminated, and the device is ready for use.

#### **Enter Cable Resistance**

- Press the ZER0 I ESC key once again in the automatic compensation menu.
- Enter the known resistance of the connector cables with the scroll keys: Select the digit to be changes with the  $\lhd \rhd$  keys, and change the respectively selected digit with the  $\triangledown \triangle$  keys. The default value is 0.16  $\Omega$ . Values can be selected within a range of 0 to 50  $\Omega$ .
- □ Upon pressing the FUNC I ENTER key, the selected value is activated and the display is returned to the measuring function. Cable resistance remains in memory even after the instrument has been switched off.

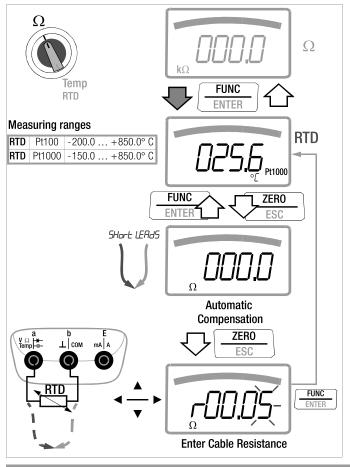


### 5.4 Continuity Test □()

- Disconnect supply power from the electrical circuit of the device to be measured, and discharge all high-voltage capacitors.
- Make sure that the device under test is voltage-free. Interference voltages distort measurement results!
- ⇒ Set the rotary switch to "R<sub>SI</sub>" or "乓)".
- ⇒ Briefly press the yellow multifunction key **FUNC I ENTER**. A loudspeaker symbol appears at the display.
- Connect the conductor path under test as shown.

Depending upon the selected limit value, the multimeter generates a continuous acoustic signal in the case of continuity or short-circuiting, i.e. at a value of less than the selected limit value. "DL" appears at the display in the case of an open connection. The limit value can be adjusted in the "FLP" menu (see also chapter 7.4):



(10 = default setting)

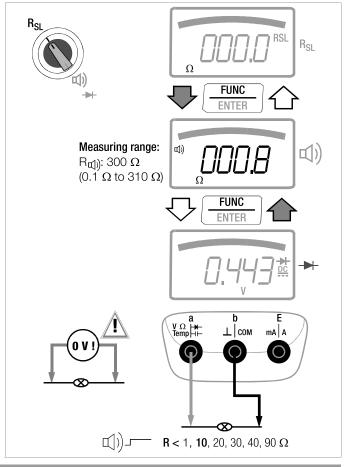

### Measurements: V/Hz $-\Omega - \square(1)$ - Temp $- \dashv \vdash - m - A/Hz$

#### 5.5 Diode Testing → with 1 mA Constant Current

- Disconnect supply power from the electrical circuit of the device to be measured, and discharge all high-voltage capacitors.
- A Make sure that the device under test is voltage-free. Interference voltages distort measurement results! Refer to chapter 5.1.1 regarding testing for the absence of voltage with the help of the direct voltage measurement.
- ⇒ Set the rotary switch to "R<sub>SL</sub>" or "□")".
- Pepeatedly press the FUNC | ENTER key until the diode symbol appears at the display.
- Connect the device under test as shown.

#### **Conducting Direction and Short-Circuit**


The instrument displays the conducting-state voltage in volts (display: 4 places). As long as voltage drop does not exceed the maximum display value of 5.1 V, several series connected components or reference diodes can be tested with a small reference voltage and Zener diodes.

### **Reverse Direction and Interruption**

The measuring instrument indicates overload DL



Resistors and semiconductor paths connected in parallel to the diode distort measurement results!

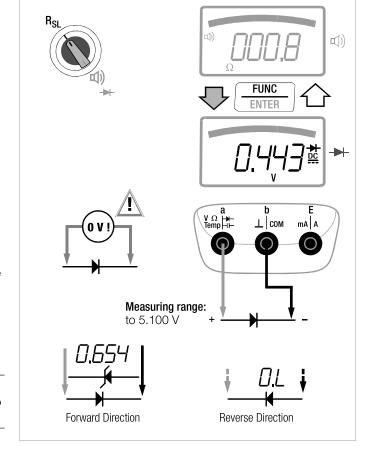

#### 5.6 Capacitance Measurement → ⊢

- Disconnect supply power from the electrical circuit of the device to be measured, and discharge all high-voltage capacitors.
- Make sure that the device under test is voltage-free. Capacitors must always be discharged before measurement is performed.

Interference voltages distort measurement results! Refer to chapter 5.1.1 regarding testing for the absence of voltage with the help of the direct voltage measurement.

- Set the rotary switch to "--.".
- Connect the (discharged!) device under test to the sockets with the measurement cables as shown.



The "-" pole of polarized capacitors must be connected to the

Resistors and semiconductor paths connected in parallel to the capacitor distort measurement results!



This function is to be used especially for the measurement of components. For telecommunications networks, the special capacitance measurement is recommended, see chapter 6.4

#### 5.6.1 Cable Length Measurement m

In the cable length measuring mode, the instrument calculates length as a function of the capacitance value entered by the user:

$$Length (km) = \frac{measured capacitance (nF)}{capacitance value (nF / km)}$$

Preparation and execution of this measurement is the same as for capacitance measurement.

Press the yellow multifunction key **FUNC | ENTER.** "k" and "m" (i.e. kilometers) appear at the display instead of "F".


Refer to chapter 7.4 with regard to adjusting the "CAP" scaling factor (capacitive linear electric constant).

### Note

When measuring cable length, make sure that the cable parameters (e.g. cross-section) are identical. Varying cable parameters, for example interconnected cables of varying type or cross-section, distort measurement results.

### Note

This function is to be used especially for the measurement of components. For telecommunications networks, the special cable length measurement is recommended, see chapter 6.4.1

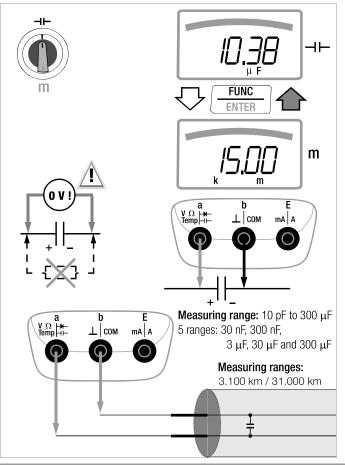


#### 5.7 Current Measurement

#### **Notes Regarding Current Measurement**

- The multimeter may only be operated with installed batteries or rechargeable batteries. Dangerous currents are otherwise not indicated, and the instrument may be damaged.
- Set up the measuring circuit in a mechanically secure fashion, and secure it against inadvertent breaks. Select conductor cross-sections and lay out connections such that they do not overheat.
- A continuous acoustic signal warns of current greater than 1.2 A.
- The input for the current measuring range is equipped with a fuse link. Maximum permissible voltage for the measuring circuit (= rated voltage of the fuse) is 600 V AC/DC. Use specified fuses only! The fuse must have a breaking capacity of at least 10 kA.
- If the fuse for the active current measuring range blows, "FuSE" appears at the digital display, and an acoustic signal is generated at the same time.
- If a fuse should blow, eliminate the cause of overload before placing the instrument back into service!
- Fuse replacement is described in chapter 10.3.
- Be absolutely certain that the measuring ranges are not overloaded beyond their allowable capacities. Limit values are included in chapter 9, "Technical Data", in the table entitled "Measuring Functions and Measuring Ranges" in the "Overload Capacity" column.

#### 5.7.1 Direct and Pulsating Current Measurement, Direct Connection, A DC and A (DC+AC)


- First disconnect supply power from the measuring circuit or the power consumer (1), and discharge any capacitors.
- □ In accordance with the current to be measured, set the rotary switch to  $A = \text{ or } A \equiv$ .
- Select the type of current appropriate for the measured quantity by briefly pressing the FUNC I ENTER multifunction key. Each time the key is pressed, the instrument is switched back and forth between A DC and A (DC + AC)<sub>TRMS</sub>, which is indicated by means of an acoustic signal. The current type is indicated at the LCD by means of the DC or the (DC+AC)TRMS symbol.
- Safely connect the measuring instrument (without contact resistance) in series to the power consumer (2) as shown.
- Switch supply power to the measuring circuit back on (3).
- Pead the display. Make a note of the measured value if the instrument is not being operated in the memory mode or the transmission mode.
- Disconnect supply power from the measuring circuit or the power consumer (1) once again, and discharge any capacitors.
- Remove the test probes from the measuring point and return the measuring circuit to its normal condition.

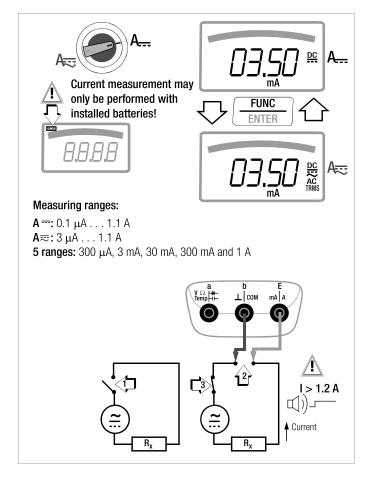

Measurements: V/Hz  $-\Omega - \square(1)$  - Temp  $- \dashv \vdash - m - A/Hz$ 

#### 5.7.2 Alternating Current and Frequency Measurement, Direct Connection, A AC and Hz

- First disconnect supply power from the measuring circuit or the power consumer (1), and discharge any capacitors.
- □ In accordance with the current or frequency to be measured, turn the rotary switch to A~ or Hz.
- Select the desired measured quantity by briefly pressing the FUNC | ENTER multifunction key. Each time the key is pressed, ACTRMS and Hz are alternately selected, and switching is acknowledged with an acoustic signal.
- Safely connect the measuring instrument (without contact resistance) in series to the power consumer as shown.
- Switch supply power to the measuring circuit back on (3).
- Pead the display. Make a note of the measured value if the instrument is not being operated in the memory mode or the transmission mode.
- Disconnect supply power from the measuring circuit or the power consumer (1) once again, and discharge any capacitors.
- Remove the test probes from the measuring point and return the measuring circuit to its normal condition.

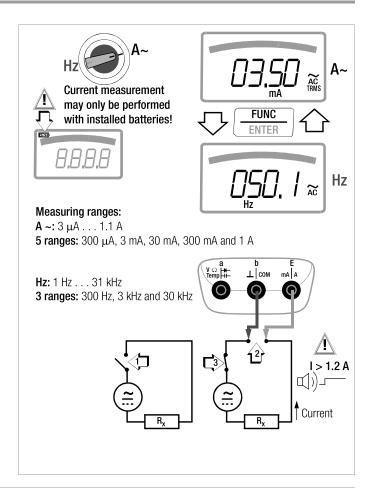

#### 5.7.3 Direct and Pulsating Current Measurement with Clip-On Current Sensor, A DC and A (DC+AC)

#### Transformer Output, Voltage/Current


When a clip-on current sensor is connected to the multimeter (V input), all current displays appear with the correct value in accordance with the selected transformation ratio. The only prerequisite is that the current sensor is equipped with at least one of the below listed transformation ratios, and that the ratio has been previously selected in the following menu ( $\mathcal{L}L \cdot P \neq \mathcal{D}FF$ ) (see also chapter 7.4).

#### **Current Clip Setup Menu**



Trans. Ratio	Measuring Rai	Clip Type		
CL, P	300 mV	3 V	30 V	
<b>1:1</b> 1 mV / 1 mA	300.0 mA	3.000 A	30.00 A	WZ12C
<b>1:10</b> 1 m V / 10 mA	3.000 A	30.00 A	300.0 A	WZ12B, Z201A/B, METRAFLEX
<b>1:100</b> 1m V / 100 mA	30.00 A	300.0 A	3,000 kA	Z202A/B, METRAFLEX
<b>1:1000</b> 1 mV/1 A	300.0 A	3,000 kA	30.00 kA	Z202A/B, Z203A/B, WZ12C, METRAFLEX

Maximum allowable operating voltage is equal to the current transformer's nominal voltage. When reading the measured value, additional error resulting from the clip-on current sensor must also be taken into consideration (default value:  $LL \cdot P = DFF = voltage dis$ play).

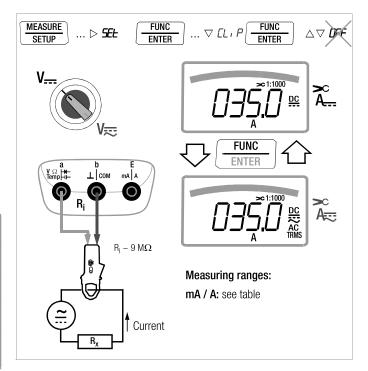

### 5.7.4 Alternating Current Measurement with Clip-On Current Sensor, A AC and Hz

### Transformer Output, Voltage/Current


When a clip-on current sensor is connected to the multimeter (V input), all current displays appear with the correct value in accordance with the selected transformation ratio. The only prerequisite is that the current sensor is equipped with at least one of the below listed transformation ratios, and that the ratio has been previously selected in the following menu ( $\mathit{LL}, \mathit{P} \neq \mathit{DFF}$ ) (see also chapter 7.4).

### Current Clip Setup Menu



Trans. Ratio	Measuring Rai	Clip Type		
CL, P	300 mV	3 V	30 V	
<b>1:1</b> 1 mV / 1 mA	300.0 mA	3.000 A	30.00 A	WZ12C
<b>1:10</b> 1m V / 10 mA	3.000 A	30.00 A	300.0 A	WZ12B, Z201A/B, METRAFLEX
<b>1:100</b> 1m V / 100 mA	30.00 A	300.0 A	3,000 kA	Z202A/B, METRAFLEX
<b>1:1000</b> 1 mV/1 A	300.0 A	3,000 kA	30.00 kA	Z202A/B, Z203A/B, WZ12C, METRAFLEX

Maximum allowable operating voltage is equal to the current transformer's nominal voltage. When reading the measured value, additional error resulting from the clip-on current sensor must also be taken into consideration (default value: [L, P = DFF = voltage display).

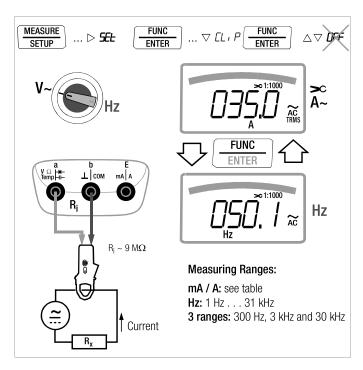

#### Measurements in Symmetrical Copper Cable Networks 6

### "R<sub>SL</sub>" Loop Impedance Measurement with 2 mA Constant Current

- Disconnect supply power from the electrical circuit of the device to be measured, and discharge all high-voltage capacitors.
- Interference voltages distort measurement results!
- $\Rightarrow$  Set the rotary switch to  $R_{SL}$ . RSL appears at the display.
- Connect the measuring point under test as shown.

Depending upon the selected limit value / threshold, the multimeter generates a continuous acoustic signal if the respective value is exceeded.


"DL" appears at the display in the case of an open connection. The limit value can be adjusted in the "566" menu (see also chapter 7.4):



(2 = default setting)



This measurement is particularly geared to the measurement in copper cable networks.

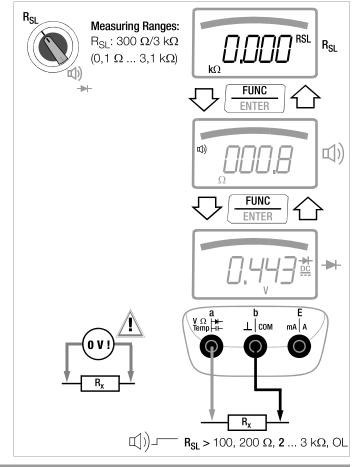


### 6.2 Detection of Interference Voltages

Set the rotary switch to the a-b, a-E and b-E positions, one after the other, in order to display any interference voltage for all three conductor pairs.



Insulation resistance may only be measured at voltage-free devices.

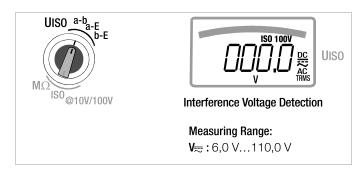

### 6.3 Insulation Resistance Measurement: in Telecommunications Networks – $M\Omega$ ISO Function

Three jacks (a, b and E) are provided for **measurements in** symmetrical copper cable networks with two conductors and a shield. The rotary selector switch can be set to determine whether insulation testing will be performed between a and b, a and E or b and E.

Interruption of a single core or contact with an open-circuit core (capacitive asymmetry) can be recognized by switching rapidly with the POL / UISO key.

In the event of a **good cable**, the bar graph must be identical in the a-E and b-E selector switch positions (open-circuit cable only!).

Long cable: long bar graph display Short cable: short bar graph display

The overall length of the bar graph represents a range of capacitance from 50 nF to 100 nF.

## Note

### Insulation resistance measurement with 10 V test voltage

The measuring range of the digital display is limited to  $30 \text{ M}\Omega$ .

Exceeding values are shown as "OL".

In contrast, the bargraph serves as a trend indicator and displays values up to 100 M $\Omega$ , however, without any specified accuracy.

### 6.3.1 Connecting the Measurement Cables


## Note

### **Testing the Measurement Cables**

The test probes at the ends of the measurement cables should be short circuited before performing insulation resistance measurements with the selector switch in the  $\Omega$ or the (1) position, in order to make sure that a value close to  $0 \Omega$  is displayed at the instrument. Incorrect connection or a broken measurement cable can be detected in this way.


### Cable connection:


Connect the measurement cables to jacks a, b and E.

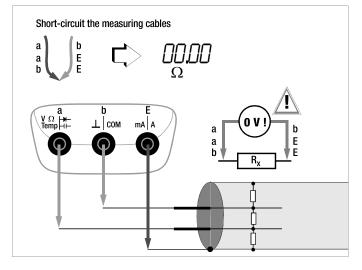

### 6.3.2 Selection of Test Voltage or Galvanic Signature

In the interference voltage detection mode you can select test voltages of 10 V or 100 V with the  $\triangle$  or  $\nabla$  key. The selected test voltage is shown as a segment above the digital display, the signature recognition mode is shown as a digital display.

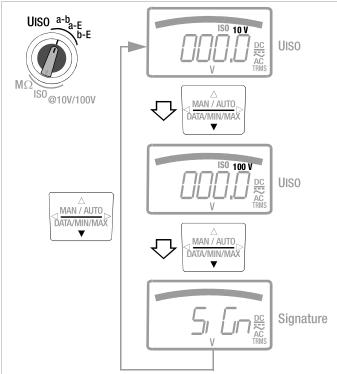

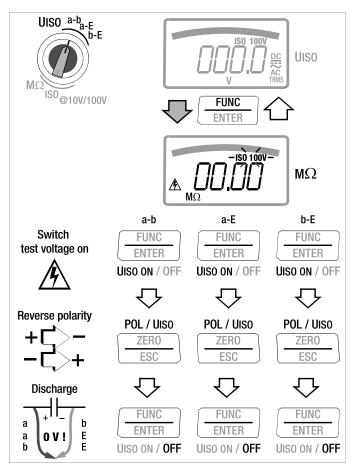

### 6.3.3 Performing Insulation Resistance Measurements

### Caution High-Voltage!

Do not touch the conductive ends of the test probes when the instrument has been activated for the measurement of insulation resistance. If at all possible, only plug in the measurement cables actually required for this test, because loose test probes and cable ends represent a contact hazard. You may otherwise be exposed to a current of 1.5 mA (limited in the measuring instrument), and although this is not life endangering, the resulting electrical shock is quite discernible. If, on the other hand, measurement is being performed on a capacitive device under test, for example a cable, it may be charged up to approximately ±120 V. Touching the device under test after measurement has been performed is life endangering in this case!

Starting the insulation resistance measurement: Briefly press the UISO ON / OFF key. Insulation resistance is displayed for the currently selected conductor pair (analog display is logarithmic).

- Property Property Property Reversing polarity of the cable under test:
  - Normal polarity reversal: Press and hold the POL / UISO kev.
  - Rapid polarity reversal: Press the POL / UISO key at short intervals. bAL.C appears at the display (ballistic capacitance) for relative cable length determination. After key activation has ceased for a period of approximately 2 seconds, the instrument is switched back to standard insulation resistance measurement.
- $\Rightarrow$  Switch the rotary selector switch to the M $\Omega_{ISO}$ \_a-b, M $\Omega_{ISO}$ \_a-E and  $M\Omega_{ISO}$ \_b-E positions, one after the other, in order to execute the desired tests.

Auto-ranging is active during insulation resistance measurement. If the measured value is less than 10% of the measuring range after manual measuring range selection (see chapter 4.1.2), ur (under-range) appears at the display. You should then select the next smaller measuring range with the help of the < key.

### Automatic Recognition of Interference Voltage During Insulation Resistance Measurement (only in AUTORANGE Mode)

If, during insulation measurement, the instrument detects an interference voltage of greater than 15 V AC or 25 V DC (assuming: Uin $terference \neq U_{ISO}$ , Riq < 100 k $\Omega$ ), "Error" is briefly displayed at the LCD. The instrument is then automatically switched to voltage measurement, and the currently measured voltage value is displayed.



A polarity-dependent dead zone results in erroneous measurements for automatic interference voltage detection. The dead zone lies within a range of 60 to 135 V DC ACTRMS sinusoidal (in the case of an interference voltage whose value is equal to that of measuring voltage, the two voltages neutralize each other).

Manual switching to insulation resistance measurement is disabled for as long as voltage is applied to the test terminals. If interference voltage is no longer present, the  $M\Omega_{ISO}$ measurement can be started by once again pressing the UISO ON / OFF key.

If a voltage of greater than 110 V DC AC is present, it is indicated by means of an acoustic signal, as well as optically with the "UHI" symbol at the display.



## Attention!

If "Error" appears at the display, the cable (the device under test) is most likely capacitively charged to a significant extent. Remedy: Short circuit conductors a-b, a-E and b-E. Repeat the measurement.

### 6.3.4 Ending the Measurement and Discharging

⇒ Briefly press the UISO ON / OFF key.

After measurement has been completed, any remaining residual voltage is displayed which may result from cable capacitance. The instrument's internal 120 k $\Omega$  resistor causes rapid discharging. However, contact to the device under test must be maintained. The falling voltage value can be observed directly at the LCD. Do not disconnect the device under test until the voltage value has dropped to below 25 V!



The instrument's batteries are rapidly depleted during insulation resistance measurement. Deactivate insulation resistance measurement between measurements for this reason. Use only alkaline manganese batteries in accordance with IEC 6 LR61.



Rotary selector switch positions a-b, a-E and b-E are intended solely for the detection of interference voltage up to 110 V during insulation resistance measurement. Voltage measurement may only be performed with the rotary selector switch set to the V  $\sim$  , V = or the V  $\approx$  position. The DATA, MIN/MAX and ZERO functions are not available in this case.

# 6.4 Interference-immune Capacitance Measurement in Telecommunications Networks – CAP Function

Three jacks (a, b and E) are provided for **measurements in symmetri- cal copper cable networks** with two conductors and a shield. The rotary selector switch can be set to determine whether capacitance testing will be performed between a-b, a-E or b-E.

In contrast to the capacitance measurement in selector switch position  $\neg \vdash$ , the measured value is only affected to a minor degree by line interference and/or parallel resistance with this capacitance measurement method.

- Connect the measuring cables to jacks a, b and E
- Set the rotary switch to "a-b, a-E and b-E", one after the other, in order to display any interference voltage for all three conductor pairs, see also chapter 6.2.
- Press ZER0 I ESC. The display switches from V to F. This conversion is accompanied by a double acoustic signal.
- Measure the capacitance successively in the 3 selector switch positions.
- Return to the interference voltage detection mode by pressing ZER0 | ESC once more.



"000.0 nF" indicates a short circuit at the jacks.



If an activated DSL modem/router is connected to the customer-side cable end emitting acoustic handshake signals, the high level of the signals will interfere with the measurement when short leads (up to approx. 500 m) are used. These signals can be attenuated by plugging on the signa-

ture measuring adapter, thus making measurement possible. The capacitance of 100 nF of measuring adapter SM100 must be taken into account for measurement.

#### 6.4.1 Cable Length Measuremnemt m

In the cable length mode the instrument calculates the length as a function of the capacitance value entered by the user:


Length (km) = 
$$\frac{\text{measured capacitance (nF)}}{\text{capacitance value (nF/km)}}$$

- Connect the measurement cables to jacks a, b and E
- Set the rotary switch to "a-b, a-E and b-E", one after the other, in order to display any interference voltage for all three conductor pairs.
- Press **ZERO I ESC**. The display switches from V to F.
- ⇒ Press multifunction key FUNC I ENTER. "k" and "m" are indicated for km length instead of "F" in the display.
- Measure the cable length successively in the 3 selector switch positions.
- Return to the capacitance measuring mode by pressing FUNC | ENTER once more.


Refer to chapter 7.4 for details on setting the scaling factor "CAP" (capacitive linear electric constant) for cable length measurement.

### Note

Please make sure that the cable parameters (e.g. cross sections) are identical when determining the cable lengths. Differing cable parameters, e.g. in the case of cables composed of **different cable types or cross sections**, distort the measuring results.

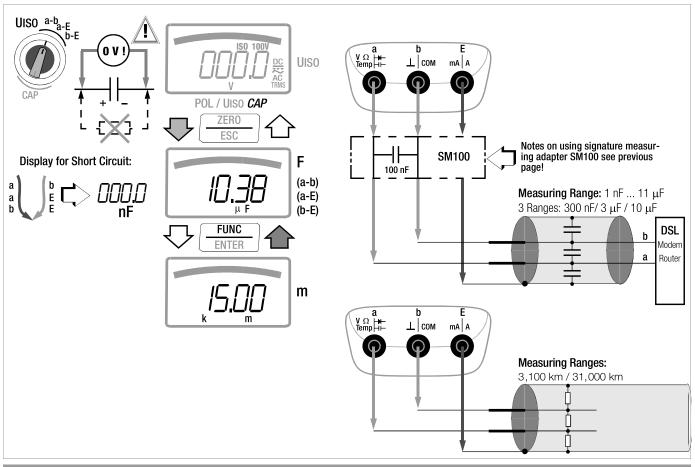

 **6.5 Galvanic Signature Recognition in Selector Switch Positions a-b** Measuring function for the recognition of a galvanic signature which may be contained in the connection cable of a DSL modem/router.



Electrical circuit diagram of a DSL signature

- Set the rotary switch to "a-b" in order to display any interference voltage.
- $\Rightarrow$  Select the signature recognition function "5  $\mathit{Ln}$ " with key  $\triangle$  or  $\nabla$ .
- Start measurement with the FUNC | ENTER key.

Measurement is now conducted with a voltage below the conducting-state voltage of the Zener diodes: "La V" is therefore shown in the display until the first measured value in the ±300% range is indicated. Since the measuring voltage is smaller than the threshold voltage of the Zener diodes of the signature, only parasitic influences are indicated in this case: this value is therefore subsequently designated as influence value.

If the influence value is stable, a high measuring voltage can be selected by pressing and holding the **ZERO I ESC** key. This is indicated in the display with  $_{\nu}H_{\nu}$  V".

If a value between approximately +60 and +200% is shown in the display, a signature exists, for values below +20%, however, no signature exists. Since this value determines whether a signature exists or not, it is subsequently designated as decision value.

The influence value last measured is taken into account for calculating the decision value: It is therefore of importance that the influence value is stable and remains within the applicable range between  $-50\,\%$  and  $+30\,\%$ ! The display blinks if the value is beyond that range.

#### **Notes**

### Prerequisites for the application of the signature measurement

Parallel resistance  $>200~\text{k}\Omega,$  parallel capacitance  $<1~\mu\text{F},$  Ripple voltage <4~Vss 50 Hz and exclusively high-resistance DC voltage

#### Passive test termination between a and b

A passive test termination leads to a deviation < 10% for both values and can thus be neglected for the signature recognition.

### Signature at the output of a DSL splitter

If the signature is located at the output of a DSL splitter (operation according to Annex B), it is not recognized due to the high-pass filter in the splitter. If it is attached to the F jack (low-pass) by mistake, the signature is recognized nevertheless.

Switch positions (a-b) (a-E) (b-E)


### NTBA connected

If an NTBA is connected, measurement is not possible as the input circuit of the NTBA prevents recognition (influence value = -OL)

### DSL modem active

If a DSL modem is active and the connector cable is very short (<500 m), an SM100 signature adapter must be plugged on in oder to attenuate the DSL signals (handshake signals). The SM100 adapter attenuates the acoustic handshake signals, thus making measurement possible.

This adapter, however, must be removed from the instrument for all other tests and measurements except for the capacitance measurement with connected DSL modem/router described above, see chapter 6.4.

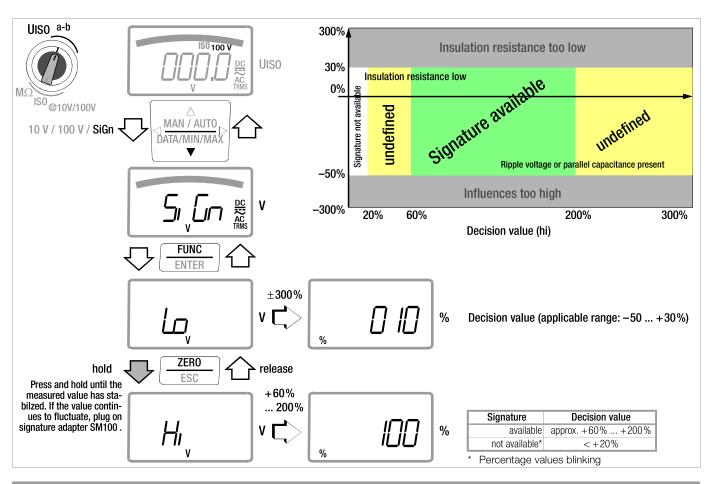

### **Device and Measuring Parameters**

The instrument's "5564" mode (menu mode) makes it possible to set operating and measuring parameters, query information and activate the interface.

- The menu mode is accessed by pressing the MEASURE I SETUP key, assuming that the instrument is switched on and set to "Measure" (measuring mode operation). " Info" appears at the display.
- The main menus, i.e. the "SEL" and "LENP" menus, as well as the "Start" and "Start" menus, are accessed, and the display is returned to ",  $\neg f \circ$ ", by repeatedly activating the  $\triangleleft \triangleright \triangle \nabla$  keys (in any direction).
- After selecting the desired main menu, sub-menus are accessed by pressing the FUNC I ENTER key.
- The desired parameter is selected by repeatedly pressing the  $\triangle \nabla$  keys.
- In order to check or change a parameter, acknowledge it with the **FUNC I ENTER** key.
- $\Rightarrow$  The  $\triangleleft \triangleright$  keys can be used to position the cursor at the entry
  - The desired value is selected with the help of the  $\triangle \nabla$  keys.
- Changes can only be accepted with the FUNC I ENTER key.
- You can return to the sub-menu without making any changes by pressing the **ZERO I ESC** key, and to the main menu by pressing the ZERO I ESC key once again etc.
- You can switch to the measuring mode from any menu level by pressing the FUNC I ENTER key.


After repeatedly pressing the MEASURE I SETUP key (without first turning the multimeter off), you can return to the last selected menu or parameter from the measuring mode.

### **Example: Setting Time**



### Setting hours and minutes:

 $\triangleleft \triangleright$ Advance to desired entry position. Change the setting, the entry position blinks.  $\triangle \nabla$ Press and hold the key to change the setting rapidly. FUNC The new time setting is activated after ENTER acknowledgement.

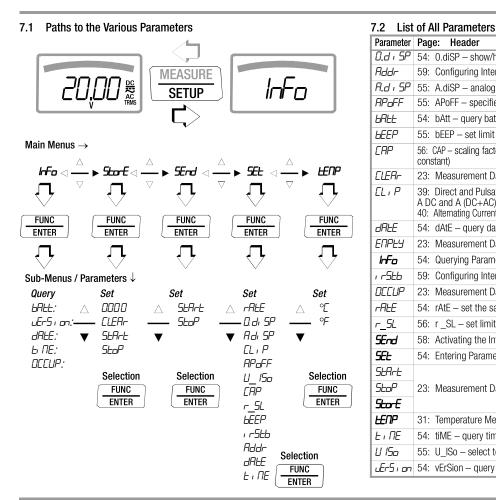

#### D.d. 5P 54: 0.diSP – show/hide leading zeros Addr 59: Configuring Interface Parameters R.d , SP 55: A.diSP - analog display: select display mode AP<sub>o</sub>FF 55: APoFF - specified time for automatic shutdown and continuous ON 54: bAtt - query battery voltage BALL 55: bEEP - set limit value for continuity testing ЬЕЕР CAP 56: CAP – scaling factor for cable length measurement (capacitive linear electric CLEA-23: Measurement Data Recording CL, P 39: Direct and Pulsating Current Measurement with Clip-On Current Sensor, A DC and A (DC+AC) 40: Alternating Current Measurement with Clip-On Current Sensor, A AC and Hz dALE 54: dAtE - query date, 56: dAtE - enter date ENPLY 23: Measurement Data Recording 54: Querying Parameters – InFo Menu (as moving letters) hFo , rSEb 59: Configuring Interface Parameters OCCUP 23: Measurement Data Recording rALE 54: rAtE - set the sampling rate r 5L 56: r\_SL - set limit value for protective conductor resistance

Parameter Page: Header

GMC-I Messtechnik GmbH

5End

SEL

SEALE

StoP

Stor E

Æ∏P

Ŀ ι ΠΕ

U 15o

58: Activating the Interface

54: Entering Parameters - SETUP Menu

31: Temperature Measurement - Temp RTD

54: tiME - query time, 56: tiME - set time

23: Measurement Data Recording

55: U ISo - select test voltage

שבר 54: vErSion – query firmware version

### Querying Parameters - InFo Menu (as moving letters)

 
### bAtt - query battery voltage



### vErSion - query firmware version



### dAtE - query date



Date and time must be reentered after replacing the batteries.

### tiME - query time



h = hours, m = minutes, s = seconds

Date and time must be reentered after replacing the batteries.

### OCCUP - query memory occupancy



### **Entering Parameters - SETUP Menu**

### rAtE - set the sampling rate

The sampling rate specifies the time interval after which the respective measured value is transmitted to the interface, or to measured value memory.

Any one of the following sampling rates can be selected: [mm:ss.t]: 00:00,1, 00:00,2, **00:00.5**, 00:01,0, 00:02,0, 00:05.0 [h:mm:ss.t] (h=hours, m=minutes, s=seconds, z=tenths of a sec.): 0:00:10, 0:00:20, 0:00:30, 0:00:40, 0:00:50, 0:01:00, 0:02:00, 0:05:00, 0:10:00, 0:20:00, 0:30:00, 0:40:00, 0:50:00, 1:00:00, 2:00:00, 3:00:00, 4:00:00, 5:00:00, 6:00:00, 7:00:00, 8:00:00, 9:00:00

Setting the Sampling Rate



(00:00.5 = 0.5 s = default value)

### 0.diSP - show/hide leading zeros

This parameter determines whether or not leading zeros will appear in the measured value display.

**DDDD.D**: with leading zeros (default value) 0.0 : leading zeros suppressed

$$\triangle \triangledown \boxed{ \frac{\text{FUNC}}{\text{ENTER}}}$$

### A.diSP – analog display: select display mode

One of two different display modes can be selected for the analog display:

- *bA-G*: bar graph
- Parnt: pointer

 


 $(P_{a}, nE) = default setting)$ 

### APoFF - specified time for automatic shutdown and continuous ON

The instrument is switched off automatically if the measured value remains unchanged for a long period of time and if none of the keys or the rotary switch have been activated before the specified time "APaFF" (entered in minutes) has elapsed.


If the an setting is selected, the multimeter is set for long-term measurement and on appears in the display to the right of the battery symbol. In this case, the multimeter can only be switched off manually. The "an" setting can only be cancelled by changing the respective parameter, and not by switching the instrument off.



(10 minutes = default setting)

### U\_ISo - select test voltage

 The desired test voltage for insulation resistance measurement can be selected here:



### bEEP - set limit value for continuity testing



 $(10 \Omega = default setting)$ 

### irStb - status of the infrared receiver in the stand-by mode

See chapter 8.2 on page 59 regarding settings.

### Addr - set device address

See chapter 8.2 on page 59.

### dAtE - enter date

Entering the current date makes it possible to acquire measured values in real-time.

Date and time must be reentered after replacing the batteries.

### tiME - set time

Entering the correct time makes it possible to acquire measured values in real-time.

Date and time must be reentered after replacing the batteries.

### CLIP - set current clip factor

See chapter 5.7.3 and chapter 5.7.4.

r\_SL – set limit value for protective conductor resistance

(2 = default setting)

CAP - scaling factor for cable length measurement (capacitive linear electric constant)

(100 nF = default setting)\_

### 7.5 Default Settings

Previously entered changes can be undone, and the default settings can be reactivated. This may be advisable under the following circumstances:

- after the occurrence of software or hardware errors,
- if you are under the impression that the multimeter does not work correctly.
- Disconnect the device from the measuring circuit.
- Remove the batteries temporarily (see also chapter 10.2).
- Simultaneously press and hold the SEC and IGHT

keys, and connect the battery at the same time.

### Interface Operation

### 8 Interface Operation

The cable multimeter is equipped with an infrared interface for the transmission of measurement data to a PC. Measured data are optically transferred through the instrument housing by means of infrared light to an interface adapter (accessory), which is attached to the multimeter. The adapter's USB interface allows for the establishment of a connection to the PC via an interface cable. Beyond this, commands and parameters can be transmitted from the PC to the multimeter as well. The following functions can be executed:

- Configuration and read-out of measuring parameters,
- · Measuring function and measuring range selection,
- Start measurement,
- · Read out stored measured values.

### 8.1 Activating the Interface

The interface is automatically activated for receiving operation (multimeter receives data from the PC) as soon as the interface is addressed by the PC, assuming that the ", r5Lb" parameter has been set to ", ran" (see chapter 8.2), or the instrument is already switched on (the first command wakes up the multimeter, but does not yet execute any further commands).

The "continuous transmission" operating mode is selected manually as described below. In this operating mode, the instrument continuously transmits measurement data to the PC via the interface adapter, which can then be displayed with the help of a terminal program.

### Starting Continuous Transmission Operation with Menu Functions



The **IR** symbol blinks at the display in order to indicate interface operation.

### Stopping Continuous Transmission Operation with Menu Functions



The **↓IR**↑ symbol is cleared from the display.

### **Automatic Activation and Deactivation of Transmission Mode Operation**

If the sampling rate is 10 seconds or longer, the display is switched off automatically between samples in order to prolong battery service life. The only exception is when the multimeter is set to continuous operation.

As soon as an event occurs, the display is automatically switched back on.

### 8.2 Configuring Interface Parameters

### r5th - status of the infrared receiver in the stand-by mode

There are two possible switching statuses for the infrared interface when the multimeter is switched off:

IR appears at the display and the infrared interface is יר סח: active, i.e. signals such as making commands can be received, and power is consumed even though the multimeter is switched off.

ı roFF: IR does not appear at the display and the infrared interface is switched off, signals cannot be received.

(rFbb = rDFF = default setting)

### Addr- - Address

If several multimeters are connected to the PC via an interface adapter, a separate address can be assigned to each instrument. Address number 1 should be selected for the first instrument, 2 should be assigned to the second and so forth.

(15 = default setting)

### **Technical Data**

## **Technical Data**

Meas. Func- tion	Measuring Range		Input im	pedance		Intrinsic Uncertainty er Reference Condit ± ( % rdg. + d)		Ove Capa	rload city <sup>2)</sup>
(input)		Limit	===	~/≅	===	~ 1), 11)	≂ 1), 11)	Value	Time
	300.0 mV	100 μV	9 ΜΩ	9 MΩ // < 50 pF	0.5 + 3 <sup>10)</sup>	1.5 + 3 (> 300 d)	1.5 + 3 (> 300 d)	600 V	
v	3.000 V	1 mV	9 ΜΩ	9 MΩ // < 50 pF	0.5 + 1	, , ,	,	DC	
-	30.00 V	10 mV	9 ΜΩ	$9 \text{ M}\Omega$ // $< 50 \text{ pF}$	0.5 + 1	15 . 0 / 20 4	15 . 0 ( 100 d)	AC RMS	Cont.
(a)	300.0 V	100 mV	9 ΜΩ	$9 \text{ M}\Omega$ // $< 50 \text{ pF}$	0.5 + 1	1.5 + 3 (> 30 d)	1.5 + 3 (> 100 d)	Sine	
	600 V	1 V	9 ΜΩ	$9 \mathrm{M}\Omega// < 50 \mathrm{pF}$	0.5 + 1			6	
			Voltage drop at a	pprox. range limit		<b>~</b> 1), 11)	≂ 1), 11)		
	300.0 μΑ	100 nA	18 mV	18 mV	0.5 + 5	1.5 + 5 (> 100 d)	1.5 + 5 (> 100 d)		
A	3.000 mA	1 μΑ	160 mV	160 mV		, ,	, ,		
	30.00 mA	10 μΑ	32 mV	32 mV	0.5 + 3	15.54.004	1.5 + 5 (> 100 d)	0.3 A	Cont.
(E)	300.0 mA	100 μΑ	320 mV	320 mV		1.5 + 5 (> 30 d)			
	1.000 A	1 mA	600 mV	600 mV	0.5 + 5			1.6 A	5 min.
	Factor: 1:1/10/100/1000	Input	Input im	pedance	=== 10)	<b>∼</b> 1), 11)	≂ 1), 11)		
A>c	0.3/3/30/300 A	300 mV	\/ II		0.5 + 3	1.5 + 3 (> 300 d)	1.5 + 3 (> 300 d)	Measure	ment input
	3/30/300/3k A	3 V	voitage measuremer	nt input approx. 9 M $\Omega$ socket)	0.5 + 5	1.5 + 3 (> 30 d)	1.5 + 3 (> 100 d)	600 V	Max. 10 s
(a)	30/300/3k/30k A	30 V	΄Λ.	Plus clip-on current sensor error		r error	TRMS	IVIAX. TU S	
			Open-circuit voltage	Meas. current at range limit	,	lg. + d)			
	300.0 Ω	100 mΩ	< 1.4 V	Approx. 250 μA	0.5 + 3	10)			
	3.000 kΩ	1 Ω	< 1.4 V	Approx. 160 μA	0.5 + 1				
Ω	30.00 kΩ	10 Ω	< 1.4 V	Approx. 28 μA	0.5 + 1				
(a)	300.0 kΩ	100 Ω	< 1.4 V	Approx. 2.9 μA	0.5 + 1			600 V	
(a)	3.000 MΩ	1 kΩ	< 1.4 V	Approx. 0.31 μA	0.5 + 1			DC	
	30.00 MΩ	10 kΩ	< 1.4 V	Approx. 33 nA	2.0 + 5			AC RMS	Max. 10 s
	000.0	100 0			0.5			Sine	
R <sub>SL</sub>	300.0 Ω	100 mΩ	Approx. 13 V	Approx. 2 mA const.	3 + 5				
	3.000 kΩ	1 Ω	Approx. 13 V		3 + 5				
4)	300.0 Ω	100 mΩ	Approx. 3 V	Approx. 1 mA const.	3 + 5				
<b>→</b>	5.1 V <sup>3)</sup>	1 mV	Approx. 13 V		2 + 5				

					Discharge resist.	U <sub>O m</sub>	nax	± ( % rdg. + d)		
	30.00	nF	10	pF	10 MΩ	0.7	٧	1 + 6 4), 10)	600 V	
F (a)	300.0 nF		100	pF	1 ΜΩ	0.7	٧	1 + 6 <sup>4)</sup>	DC	
	3.000	μF	1	nF	100 kΩ	0.7	٧	1 + 6 <sup>4)</sup>	DC AC RMS	Max. 10 s
	30.00	μF	10	nF	12 kΩ	0.7	٧	1 + 6 <sup>4)</sup>	RMS Sine	
	300.0	μF	100	nF	3 kΩ	0.7	٧	5 + 6 <sup>4)</sup>	Silie	
						f <sub>min</sub>	5)	± ( % rdg. + d)		
Hz (V)/	300.0	Hz	0.1	Hz		1	Hz		Hz (V) <sup>6)</sup> Hz(A <b>&gt;c</b> ) <sup>6</sup> 600 V	
Hz (A)	3.000	kHz	1	Hz		1	TIZ	0.5 + 1 8)	Hz(A <b>&gt;c</b> ) <sup>c</sup>	/: Max. 10 s
11Z (A)	30.00	kHz	10	Hz		10	Hz	0.5 + 1 /		
Hz (V)	300.0	kHz	100	Hz		100	Hz		Hz (A): <sup>7</sup>	
								± ( % rdg. + d) <sup>9)</sup>		
	Pt100 +	· 200.0 -200.0 °C						2 K + 5		
°C	+	-200.0 -850.0 °C	0.1	0.1 °C				1 + 5	600 V DC/AC RMS	Mov 10 o
-	- 150.0 +200.0 °C		0.1	U				2 K + 5	RMS Sine	Max. 10 s
		-200.0 -850.0 °C						1 + 5		

<sup>&</sup>lt;sup>1)</sup> 15 ... <u>45 ... 65 Hz</u> ... 10 (5) kHz sine. See following page for influences.

11)Residual value of 1 to 10 d with short circuited terminal tips, exception: mV / µA range of 1 to 35 d at zero point due to the TRMS converter

**Key:** R = meas. range, d = digit(s), rdg. = measured value (reading)

<sup>&</sup>lt;sup>2)</sup> At 0° ... + 40° C

<sup>3)</sup> Display of up to max. 5.1 V, "OL" in excess of 5.1 V.

<sup>4)</sup> Applies to measurements at film capacitors and with battery operation

<sup>5)</sup> Lowest measurable freq. for sinusoidal meas. signals symmetrical to zero point

<sup>6)</sup> Overload capacity of the voltage measurement input: power limiting: frequency x max. voltage 6 x 10<sup>6</sup> V x Hz: e.g. max. 600 V 1 kHz

<sup>7)</sup> Overload capacity of the current measurement input: See current measuring ranges for maximum current values.

<sup>8)</sup> Input sensitivity, sinusoidal signal, 10% to 100% of the voltage or current measuring range; limitation: up to 30% of the range at up to 100 kHz in the mV measuring range, 50% of the range at up to 300 kHz, 30% of the range in the 1 A measuring range. The voltage measuring ranges with max. 30 kHz apply in the A measuring range.

<sup>9)</sup> Plus sensor deviation

<sup>10)</sup>With ZERO function active

### **Technical Data**

### Insulation Resistance Measurement in Selector Switch Positions (a-b) (a-E) (b-E) 1)

				. , . , . ,	
	Measuring Range			Intrinsic Error under Reference Conditions ±(% rdg + d)	
	6 V 110 V ≅ <sup>2)</sup>	0.1 V	Ri approx. 120 k $\Omega$	3 + 30	
l	5 310.0 kΩ	0.1 kΩ	<b>10</b> //100 V	3 + 5	
	$0.280 \dots 3.100  \mathrm{M}\Omega$	1 kΩ	<b>10</b> //100 V	3 + 5	
	02.80 31.00 MΩ	10 kΩ	<b>10</b> //100 V	5 + 5	
	028.0 310.0 MΩ	100 kΩ	<b>10</b> //100 V	5 + 5	

During insulation resistance measurement (M $\Omega_{@{\rm UISO}}$ ): If ERROR is displayed as "Error" >> limits:  $U_{interference} > 10 \dots 20 \text{ V}$  and  $U_{interference} \neq U_{ISO}$ ,  $Ri < 10 \text{ k}\Omega$  @ Uiso 10 V,  $Ri < 100 \text{ k}\Omega$  @ Uiso 100 V

<sup>&</sup>lt;sup>2)</sup> Interference voltage measurement TRMS (V AC + DC) with 120  $k\Omega$  input resistance, bandwidth 15 Hz ... 500 Hz, measuring error 3% + 30 Digit

Measuring Function Switch Setting	Nom. Voltage U <sub>N</sub> @100k	Open- Circuit Voltage U <sub>o</sub>	Nom. Cur- rent I <sub>N</sub> @100k	Short- Circuit Cur- rent I <sub>k</sub>	Acoustic Signal for	Overload Value	Capacity Time
$U_{interference}/$ $M\Omega_{ISO}$	_	_	_	_	U > 110 V	110 V≅	Cont.
$M\Omega_{ SO}$	100 V	Max. 120 V	> 1.0 mA	< 1.2 mA	U > 110 V	100 V≅	10 s
	8.7 V	11 V	0.09	< 0.260	U > 110V	100 V≂	10 s

Ripple voltage < 4 Vss 50 Hz, parallel capacitance < 3 µF

### Interference-immune Capacitance Measurement in Selector Switch Positions (a-b) (a-E) (b-E)

Measuring Range	Resolution 3100/1100 Digit	Intrinsic Uncertainty under Reference Conditions ± ( % rdg. + d)	Measuring Cycle (max.)	Overload Capacity
300 nF	100 pF	2 + 10	2 s	600 V / PTC
3 μF	1 nF	2 + 10	2 s	max. 10 s
10 μF	10 nF	5 + 10	2 s	IIIax. 10 3

Measuring voltage  $U_0$  = 2 Vss approx. 1 Hz, parallel resistance > 5 M $\Omega$ Ripple voltage < 4 Vss 50 Hz

### Galvanic Signature Ascertainment in Selector Switch Positions (a-b)

Signature	if interference value is stable in range	plus decision value
available	-50% +30%	approx. +60% +200%
not available	-50 % +50 %	< +20%

Prerequisites:

Parallel resistance > 200 k $\Omega$ , parallel capacitance < 1  $\mu$ F, Ripple voltage < 4 Vss 50 Hz

and exclusively high-resistance DC voltage

### Influencing Quantities and Influence Error

Influencing Quantity	Sphere of Influence	Measured Quantity/ Measuring Range 1)	Influence Error (% rdg. + d) / 10 k	
		V <del></del>	0.2 + 5	
		V~	0.4 + 5	
	0 °C +21° C and +25° C +40° C	$300~\Omega \dots 3~\mathrm{M}\Omega$	0.5 + 5	
		30 MΩ	1 + 5	
Temperature		mA/A ===	0.5 + 5	
		mA/A ≂	0.8 + 5	
		30 nF 300 μF	1 + 5	
		Hz	0.2 + 5	
		°C/°F (Pt100/Pt1000)	0.5 + 5	

1) With zero balancing

Influ- encing Quan- tity	Measured Quantity / Measuring Range		Sphere of Influence	Intrinsic Error <sup>3)</sup> ±( % rdg. + d)
		300 mV	> 15 Hz 45 Hz	0 5 000 45-45-
V <sub>AC</sub>	V <sub>AC</sub>	300 V	> 65 Hz 10 kHz	3 + 5 > 300 digits
		600 V	> 65 Hz 5 kHz	3 + 5 > 60 digits
Fre-		300 μΑ	> 15 Hz 45 Hz	2 . 10 . 200 digita
quency	A <sub>AC</sub>	1 A	> 65 Hz 10 kHz	3 + 10 > 300 digits
	A <sub>AC</sub>	300 μΑ	> 15 Hz 45 Hz	2 . 20 . 200 digita
	+DC	1 A	> 65 Hz 10 kHz	3 + 30 > 300 digits
	A <sub>AC</sub>	300 mV / 3 V / 30 V	>65 Hz 10 kHz	3 + 5 > 300 digits

Power limiting: frequency x voltage, max. 6 x 10<sup>6</sup> V x Hz
 The accuracy specification is valid as of a display value of 10% and up to 100% of the measuring range for both measuring modes with the TRMS converter in the A AC and A (AC+DC) ranges.

Influencing Quantity	Sphere of Influence	Measured Quantity / Measuring Range	Influence Error <sup>5)</sup>
Crest Factor CF	1 3	V ~. A ~	± 1% rdg.
	> 3 5	V ∼, A ∼	± 3% rdg.

<sup>5)</sup> Except for sinusoidal waveshape

Influencing Sphere of Quantity Influence		Measured Quantity	Influence Error	
Relative 75%, Humidity 3 days, instrument off		V, A, Ω, F, Hz, °C	1 x intrinsic error	
Battery voltage	2.0 to 3.6 V	ditto	Included in intrinsic error	
Mains operation	5 V	ditto	± 10 Digit	

Influencing Quantity	Sphere of Influence	Measured Qty. / Measuring Range	Damping
	Interference quantity max. 600 V $\sim$	V ===	> 120 dB
Common Mode Interference		3 V ∼, 30 V ∼	> 80 dB
Voltage	Interference quantity max. 600 V ~ 50 Hz 60 Hz, sine	300 V ∼	> 70 dB
	00 112 111 00 112, 01110	600 V ∼	> 60 dB
Series Mode Interference Voltage	Interference quantity: $V \sim$ , respective nominal value of the measuring range, max. 600 V $\sim$ , 50 Hz 60 Hz sine	V <del></del>	> 50 dB
9-	Interference quantity max. 600 V —	V ~	> 110 dB

### Response Time (after manual range selection)

Measured Quantity / Measuring Range	Response Time Digital Display	Measured Quantity Jump Function
V === , V ~ A === , A ~	1.5 s	From 0 to 80% of upper range limit value
300 Ω 3 MΩ	2 s	
30 MΩ	5 s	
Continuity	< 50 ms	From ∞ to 50% of upper range limit value
°C (Pt 100)	Max. 3 s	or apper range in ite raide
<b>→</b>	1.5 s	
30 nF 300 μF	Max. 5 s	From 0 to 50%
>10 Hz	1.5 s	of upper range limit value

### **Reference Conditions**

Ambient temperature +23° C ±2 K Relative humidity 40% to 75% Meas. Qty. Freq. 45 Hz ... 65 Hz

Meas. Qty. Waveshape Sine Battery voltage 3 V ±0.1 V

### **Technical Data**

### **Ambient Conditions**

0° C ... +40° C Accuracy range Operating temp. range-10° C ... +50° C

Storage temp. range -25° C ... +70° C (without batteries) Relative humidity 40 to 75%, no condensation allowed

Elevation to 2000 m

Deployment Indoors, except within specified ambient

conditions

### Display

LCD panel (65 mm x 36 mm) with analog and digital display including unit of measure, type of current and various special functions

### Background illumination

Background illumination is switched off approximately 1 minute after it has been activated.

Analog

Polarity display

LCD scale with bar graph or pointer, Display

depending upon the selected parameter

Linear (ranges other than  $M\Omega_{ISO}$ ): Scaling

∓ 5 ... 0 ... ±30 with 35 scale divisions for == , 0 ... 30 with 30 scale divisions in all

other ranges

bar graph instead of pointer With automatic switching

Overflow display With the ▶ symbol

Measuring rate 40 measurements per second and display

refresh

### Digital

Display / Char. Height 7-segment characters / 15 mm Number of places 

Overflow display "OL" is displayed for ≥3100 digits Polarity display

"-" (minus sign) is displayed if plus pole is connected to "L"

10 and 40 measurements per second with Measuring rate

the Min/Max function except for the capacitance, frequency and duty cycle

measuring functions

Refresh Rate 2 times per sec., every 500 ms

### **Electrical Safety**

II per DIN EN 61010-1:2011/ Safety class

VDE 0411-1:2011

Measuring category Ш 111 Nominal voltage 600 V 300 V

Fouling factor

3.5 kV~ per DIN EN 61010-1:2011/ Test voltage

VDE 0411-1:2011

### **Fuses**

Fuse link FF 1.6 A/700 V AC/DC;

6.3 mm x 32 mm; switching capacity:

50 kA at 700 V AC/DC;

protects the current measurement input in

the 300 µA through 1 A ranges



### **Power Supply**

Battery 2 ea. 1.5 V mignon cell (2 ea. size AA),

alkaline manganese per IEC LR6

Service life With alkaline manganese batteries: approx.

200 hours without  $M\Omega_{ISO}$  measurement

Battery test Battery capacity display with battery

symbol in 4 segments: . .

Querying of momentary battery voltage via

menu function.

Power OFF function The multimeter is switched off automatically:

- If battery voltage drops to below approx.

2.0 V

 If none of the keys or the rotary switch are activated for an adjustable duration of 10 to 59 minutes, and the multimeter is not in

the continuous operation mode

Power pack socket If the power pack has been plugged into

the instrument, the installed batteries are

disconnected automatically.

Rechargeable batteries can only be

recharged externally.

Measuring Function	Nominal Voltage U <sub>N</sub>	Resistance of the DUT	Service life in Hours	Number of Possible Measurements with Nominal Current per VDE 0413
V ===			200 <sup>1)</sup>	
V ~			150 <sup>1)</sup>	
MΩ	10 V/100 V	1 ΜΩ	50	
IVIS 2	10 V/100 V	100 kΩ		3000

<sup>1)</sup> Times 0.7 for interface operation

### **Electromagnetic Compatibility (EMC)**

Interference emission EN 61326-1:2013 class B

Interference immunity EN 61326-1:2013

EN 61326-2-1:2013

### **Data Interface**

Type Optical via infrared light through the housing

Data transmission Serial, bidirectional (not IrDa compatible)

Protocol Device specific Baud Rate 38,400 baud

Functions - Select/query measuring functions

and parameters

Query momentary measurement data

The USB X-TRA plug-in interface adapter (see accessories) is used for adaptation to the PC's USB port.

### **Internal Measured Value Storage**

Memory capacity

4 MBit / 540 kB for approx. 15,400 measured values with indication of date

and time

### **Technical Data**

## **Mechanical Design**

Housing Impact resistant plastic (ABS)

Dimensions 200 x 87 x 45 mm

(without protective rubber cover)

Weight Approx. 0.35 kg with batteries

Protection Housing: IP 54

(pressure equalization by means of the

housing)

Table Excerpt Regarding Significance of the IP Code

IP XY (1 <sup>st</sup> digit X)	Protection against foreign object entry	IP XY (2 <sup>nd</sup> digit Y)	Protection against the penetration of water
0	Not protected	0	Not protected
1	≥ 50.0 mm dia.	1	Vertically falling drops
2	≥ 12.5 mm dia.	2	vertically falling drops with enclosure tilted 15°
3	≥ 2.5 mm dia.	3	Spraying water
4	≥ 1.0 mm dia.	4	Splashing water
5	Dust protected	5	Water jets

### Maintenance - Calibration

#### **Maintenance and Calibration** 10



#### Attention!

Disconnect the instrument from the measuring circuit before opening the battery compartment lid or fuse cover when replacing batteries or fuses!

10.1 Displays - Error Messages

Message	Function	Meaning
FuSE	Current measurement	Blown fuse
	In all operating modes	Battery voltage has fallen below 2.0 V
DL	Measurement	Indicates overflow
ur	$M\Omega_{ISO}$ measurement	Measured value of less than 10% of the measuring range
Error	$M\Omega_{ISO}$ measurement	Interference voltage detected

### 10.2 Batteries



#### Removing the Batteries During Periods of Non-Use

The integrated quartz movement draws power from the batteries even when the instrument is switched off. It is advisable to remove the batteries during long periods of non-use for this reason (e.g. vacation). This prevents excessive depletion of the battery, which may result in damage under unfavorable conditions.



### **Battery Replacement**

Stored measurement data are lost when the batteries are replaced. In order to prevent data loss, it is advisable to

backup your data to a PC with the help of METRAwin 10 software before replacing the batteries.

The selected operating parameters remain in memory, although date and time must be reentered.

### **Battery**

The current battery charge level can be gueried in the " Infa" menu:



Make sure that no battery leakage has occurred before initial start-up, as well as after long periods of storage. Continue to inspect the batteries for leakage at short, regular intervals.

If battery leakage has occurred, carefully and completely clean the electrolyte from the instrument with a damp cloth, and replace the battery before using the instrument.

If the "symbol appears at the display, the batteries should be replaced as soon as possible. You can continue working with the instrument, but reduced measuring accuracy may result.

The instrument requires two 1.5 V batteries in accordance with IEC LR 6, or two equivalent rechargeable NiCd batteries.

### Replacing the Batteries



#### Attention!

Disconnect the instrument from the measuring circuit before opening the battery compartment lid in order to replace the

- Set the instrument face down onto the working surface.
- Turn the slotted screw on the lid with the battery symbols counterclockwise.
- Lift off the lid and remove the batteries from the battery compartment.
- □ Insert two new 1.5 V mignon batteries into the battery compartment, making sure that the plus and minus poles match up with the provided polarity symbols.
- When replacing the battery compartment lid, insert the side with the guide hooks first. Tighten the screw by turning it clockwise.
- Please dispose of depleted batteries in accordance with environmental protection regulations!

#### 10.3 Fuses

## Testing the Fuse

The fuse is tested automatically:

- When the instrument is switched on with the rotary switch in the A position
- When the instrument is already on and the rotary switch is turned to the A position
- In the active current measuring range when voltage is applied

If the fuse is blown or has not been inserted, "FuSE" appears at the digital display. The fuse interrupts the current measuring ranges. All other measuring ranges remain functional.



### Replacing the Fuse

If a fuse should blow, eliminate the cause of overload before placing the instrument back into service!



### Attention!

Disconnect the instrument from the measuring circuit before opening the fuse cover in order to replace the fuse!

- Set the instrument face down onto the working surface.
- Turn the slotted screw on the cover with the fuse symbol counterclockwise.
- Lift off the cover and pry the fuse out using the flat side of the fuse cover.
- ⇒ Insert a new fuse. Make sure that the fuse is centered, i.e. between the tabs at the sides.
- When replacing the fuse cover, insert the side with the guide hooks first. Tighten the screw by turning it clockwise.
- Dispose of the blown fuse with the trash.

### Maintenance - Calibration



### Attention!

Use specified fuses only!

If fuses with other blowing characteristics, other current ratings or other breaking capacities are used, the operator is placed in danger, and protective diodes, resistors and other components may be damaged.

The use of repaired fuses or short-circuiting the fuse holder is prohibited.



### Testing the Fuse with the Instrument Switched On

After inserting the fuse with the instrument switched on, the instrument must be switched off briefly and then switched back on, or briefly switched to a non current measuring range and then back to the A measuring range. If contact is poor or the fuse is blown, FUSE appears at the display.

### 10.4 Housing Maintenance

No special maintenance is required for the housing. Keep outside surfaces clean. Use a slightly dampened cloth for cleaning. Avoid the use of cleansers, abrasives or solvents.

### 10.5 Return and Environmentally Sound Disposal

The **instrument** is a category 9 product (monitoring and control instrument) in accordance with ElektroG (German electrical and electronic device law). This device is subject to the WEEE directive. Furthermore, we make reference to the fact that the current status in this regard can be accessed on the Internet at

We identify our electrical and electronic devices in accordance with WEEE 2012/19/EU and ElektroG with the symbol shown at the right per DIN EN 50419.



These devices may not be disposed of with the trash.

Please contact our service department regarding the return of old devices (see chapter Standard Equipment - Contact Persons).

If you use batteries or rechargeable batteries in your instrument or accessories which no longer function properly, they must be duly disposed of in compliance with the applicable national regulations.

Batteries or rechargeable batteries may contain harmful substances or heavy metal such as lead (PB), cadmium (CD) or mer-

They symbol shown to the right indicates that batteries or rechargeable batteries may not be disposed of with the trash, but must be delivered to collection points specially provided for this purpose.



### 10.6 Recalibration

The respective measuring task and the stress to which your measuring instrument is subjected affect the ageing of the components and may result in deviations from the guaranteed accuracy.

If high measuring accuracy is required and the instrument is frequently used in field applications, combined with transport stress and great temperature fluctuations, we recommend a relatively short calibration interval of 1 year. If your measuring instrument is mainly used in the laboratory and indoors without being exposed to any major climatic or mechanical stress, a calibration interval of 2-3 years is usually sufficient.

During recalibration\* in an accredited calibration laboratory (DIN EN ISO/IEC 17025) the deviations of your instrument in relation to traceable standards are measured and documented. The deviations determined in the process are used for correction of the readings during subsequent application.

We are pleased to perform DAkkS or factory calibrations for you in our calibration laboratory. Please visit our website at

By having your measuring instrument calibrated regularly, you fulfill the requirements of a quality management system per DIN EN ISO 9001.

\* Verification of specifications or adjustment services are not part of the calibration. For products from our factory, however, any necessary adjustment is frequently performed and the observance of the relevant specification is confirmed.

#### 10.7 Manufacturer's Guarantee

All METRAHIT digital multimeters and calibration instruments are guaranteed for a period of 3 years after shipment. The manufacturer's guarantee covers materials and workmanship. Damages resulting from use for any other than the intended purpose or operating errors, as well as any and all consequential damages, are excluded.

The calibration certificate confirms that the product conformed to the specified technical data at the time of calibration. We guarantee the observance of the specified technical data within the admissible tolerance limits for a period of 12 months from delivery.

### Accessories

### 11 Accessories (Standard Equipment See Page 2)

#### 11 1 Genera

The extensive accessories available for our measuring instruments are checked for compliance with currently valid safety regulations at regular intervals, and are expanded as required for new applications. Currently up-to-date accessories which are suitable for your measuring instrument along with photo, order number, description and, depending upon the scope of the respective accessory, data sheet and operating instructions are listed at www.gossenmetrawatt.com.

# 11.2 Technical Data for Measurement Cables (scope of delivery: KS21-T safety cable set)

### **Electrical Safety**

•		
Maximum Rated Voltage	1000 V	1000 V
Measuring Category	CAT III	CAT II
Maximum Rated Current	1 A	16 A
with safety cap applied	•	_
without safety cap applied	_	•

Please observe the maximum values of the electrical safety of the device.

### Ambient Conditions (EN 61 010-031)

Temperature −20 °C ... + 50 °C

Relative humidity 50 to 80%

Fouling factor 2

### Application KS21-T



#### Attention

In conformity with standard DIN EN 61010-031, measurements in an environment according to measuring category III may only be performed with the safety cap applied to the test probe of the measurement cable.

For establishing contact in 4 mm jacks you have to remove the safety cap by levering out the snap lock of the safety cap with another sharp object (e.g. the second test probe).

### 11.3 Power Pack NA X-TRA

Use only power packs from GMC-I Messtechnik GmbH only in combination with your instrument. This assures operator safety by means of an extremely well insulated cable, and safe electrical isolation (nominal secondary ratings: 5 V / 600 mA). Installed batteries are disconnected electronically if the power pack is used, and need not be removed from the instrument.



#### Note

Use of the power pack may result in an additional measuring error on account of capacitive coupling.

We therefore recommend battery operation for measuring capacitance and AC quantities.

The specified technical data only apply for battery operation.

### 11.4 Interface Accessories

### **USB X-TRA Bidirectional Interface Adapter**

This adapter makes it possible to connect cable multimeters, as well as **METRAHIT** | **X-TRA** multimeters which are equipped with a serial IR interface, to the USB port at a PC. The adapter allows for data transmission between the multimeter and the PC.

### METRAwin 10 PC Analysis Software

**METRAwin 10** PC software is a multilingual, measurement data logging program\* for recording, visualizing, evaluating and documenting measured values from **METRAHIT** | multimeters. Details on the system requirements are given in the installation instructions of **METRAwin 10/METRAwin 45**.

<sup>\*</sup> runs under any IBM compatible Windows operating system

### Index

12 Index		
Numerics	D	Measuring Range Selection
0.diSP54	dAtE54, 56	Automatic18
Α	Default Settings57	Manual18
A.diSP55	Device Returns70	Memory
Addr 59	Diode Test34	Clear24
APoFF55	Discharging46	Ending Recording24
Automatic Shutdown	Display Illumination16	Querying Occupancy24
Disable17	F	Start Recording23
Specify Time17	Error46	0
Auto-Range Function	Error Messages68	OCCUP54
•	, , , , , , , , , , , , , , , , , , ,	Overview
<b>B</b> bAtt	<b>r</b> Fuse	Keys and Connections12
Batteries 54	Replacement69	Parameters
Charge Level68	періасептент	D.
Level Indicator13		P Polarity Reversal45
Periods of Non-Use	Interfaces	Power Pack
Replacement69	Accessories73	Accessories72
bEEP55	Statuses13	Initial Start-Up
<u> </u>	Interference Voltage Detection46	Power Pack Adapter Socket
C	irStb59	Position of the Connector Socket
Cable Length Measurement35	M	Product Support
Cable length measurement	Maintenance	Product Support Hotline
Cable Resistance	Housing70	
Capacitance Measurement35	Manufacturer's Guarantee71	R
Clip-On Current Sensor	Measured Value Storage	rAtE
Continuity Test	DATA Function21	Recalibration Service4, 71
Current Measurement	MIN/MAX Values22	Repair and Replacement Parts Service4
Notes36	Measurement Cables72	Resistance Measurement30
	Measuring Category	
	Significance8	

### Index

S	
Safety Precautions	8
Scaling Factor	
Scaling factor	47
Software Enabling	
Standard Equipment	
Switching the Instrument On	
Manual	16
Via PC	16
Symbols	
Device	15
Digital Display	13
Rotary Switch Positions	
T Temperature Mesurement With Resistance ThermometerstiME	
U Under-Rangeur (under-range)	46, 68
V vErSion	E
Voltage Comparator	
Voltage Measurement	28
Notes	26
W WEEE Mork	1.5