



## MG430

### Digital Insulation Tester/Megohmmeter



#### Introduction

Congratulations on your purchase of Triplett's Digital Insulation Tester/Megohmmeter. The MG430 provides three test ranges plus continuity and AC/DC voltage measurement. A handy test lock feature and a data hold function are also included. This professional meter, with proper care, will provide years of reliable service.

#### Safety

- Circuits under test must be de-energized and isolated before connections are made (except for voltage measurements).
- Circuit connections must not be touched during a test. Use extreme caution when working near bare conductors and bus bars. Accidental contact with conductors could result in electrical shock.
- Use caution when working near voltages above 60VDC or 30VACrms.
- After insulation tests, capacitors must be discharged.
- Test leads (including alligator clips) must be in good working order, clean and without broken or cracked insulation.
- When servicing, use only specified replacement parts.

#### International Safety Symbols



Caution, refer to this manual before using this meter



Dangerous Voltages



Meter is protected throughout by double or reinforced insulation



## Meter Description

1. LCD Display
2. Hold Button
3. Test Button
4. Rotary Switch
5. Lock Button
6. Backlight Button
7. Input Terminals



## Operation


### Warning

Ensure that the circuit under test does not include components that can be damaged by 1000VDC; such devices include power factor correction capacitors, low voltage mineral insulated cables, electronic light dimmers, and ballasts/starters for fluorescent lamps.

## Connecting Test Leads

For all measurements, connect the red test lead to the V input terminal and the black test lead to the COM input terminal.


## Test Lead Check

- ☐ Set the rotary switch to the 200range. 
- ☐ Touch the test lead tips together.
- ☐ Resistance should read less than 0.5 and the audio tone should sound.
- ☐ With the leads not touching, the display should read infinity indicated by "1".
- ☐ Readings displayed other than the readings described above are indicative of a test lead problem. The test leads must be replaced before using the meter. Failure to do so could result in damage to equipment and electrical shock.

## Insulation Resistance Measurements (Megohmmeter Tests)

**Warning:** Do not perform Insulation Resistance measurements if AC Voltage is present on the device under test.


1. Connect the red test lead to the V input terminal; black lead to the COM terminal.
2. Set the function switch to the desired M test voltage position.
3. Connect the tips of the test leads to the equipment under test. If there is a voltage present, a constant beep will sound and the voltage will be displayed.
4. The display will show "1" until the TEST button is pushed. Press and hold the TEST button.

The upper right display shows the test voltage applied and the flashing high voltage symbol  will be displayed. The main display shows the resistance.

5. Keep the test leads connected to the equipment under test and release the TEST button. The circuit will discharge through the meter. Keep the test leads connected until the circuit is completely discharged and the upper right display shows 0 volts.

## Lock Function

For hands-free operation, use the LOCK feature.

1. With the test leads connected to the equipment under test, simultaneously press the TEST and LOCK keys.
2. The LOCK icon  will appear on the display. A beeper will sound every 2 seconds to indicate that the meter is in Lock mode.
3. Press the LOCK key to disable the Lock function and end the test.

## Notes on IR (Megohmmeter) testing:

5. The maximum measurement range for the 380260 is 2000M $\Omega$ . Frequently, insulation resistance will exceed this value. When this happens, the display will indicate "1", meaning the resistance is very high and the insulation being tested is good.
6. If the device being tested is highly capacitive, the display will indicate an increasing resistance value over time. Always wait until the reading has stabilized before recording the value.

## AC/DC Voltage Measurement

1. Set the Rotary switch to the ACV or DCV position.
2. Connect the red test lead to the V terminal and the black test lead to the COM terminal.
3. Connect the test leads to the circuit under test.
4. Read the voltage value on the LCD.
- 5.


## Resistance Measurement

### WARNING

Do not run this test unless ACV = 0. Do not use this mode to check diodes.

1. Set the Rotary switch to the 200k position.
2. Connect the red test lead to the V terminal and the black lead to the COM terminal.
3. Connect the tips of the test leads to the circuit under test.
4. Read the resistance value on the display.

## Low Resistance (Continuity) Measurement

1. Set the Rotary switch to the 200 $\Omega$   position.
2. Connect the red test lead to the V terminal and the black lead to the COM terminal.
3. Connect the tips of the test leads to the circuit under test.
4. Read the resistance value on the display. When the resistance of a circuit is less than approx. 40 $\Omega$  the audible tone will sound.

## Auto Power Off

To conserve battery life, the meter will automatically turn off after approx. 15 minutes of non-use. To turn the meter back on, turn the rotary switch to OFF, then to the desired function.

## Hold Function

The hold function freezes the reading in the display. Press the HOLD key momentarily to activate or to exit the hold function

## Backlight

Press the key for to turn on the display backlight function. The backlight will automatically turn off after 15 seconds.

## Applications

### Measuring Power Tools and Small Appliances


This section applies to any device under test that uses a line cord. For double insulated power tools, the meter's leads should be connected to the device's housing (chuck, blade, etc.) and the lines of the power cord.



### Testing AC Motors

Disconnect the motor from the line by disconnecting the wires from the motor terminals or opening the mains switch.

If the mains switch is opened, and the motor also has a motor-starter, then the starter must be held in the ON position. With the mains switch opened, the measured resistance will include the resistance of the motor wire and all other components between the motor and the main switch. If a weakness is indicated, the motor and other components should be checked individually. If the motor is disconnected at the motor terminals, connect one meter lead to the grounded motor housing and the other lead to one of the motor leads. Refer to diagram at below.

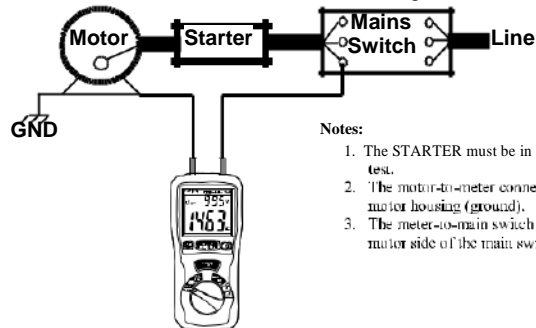

**Notes:**

1. The STARTER must be in the ON position during the test.
2. The motor-to-meter connection must be made to the motor housing (ground).
3. The meter-to-main switch connection must be to the motor side of the main switch as shown.

### Testing DC Motors

1. Disconnect the motor from the line.
2. To test the brush rigging, field coils and armature, connect one meter lead to the grounded motor housing and the other lead to the brush on the commutator.
3. If the resistance measurement indicates a weakness, raise the brushes off of the commutator and separately test the armature, field coils and brush rigging (one at a time). Leave one lead connected to the grounded motor housing while testing the motor components. This also applies to DC Generators.

## Specifications

### Range Specifications

Accuracies are specified as % reading + digits at 23°C ± 5°C < 80% RH

#### MEGOHMMETER RANGES

| Range              | Resolution | Accuracy | Terminal Voltage  |
|--------------------|------------|----------|-------------------|
| 200M 250V          | 0.1M       | ±3% + 5d | 250V + 10% ~ -0%  |
| 200M 500V          | 0.1M       | ±3% + 5d | 500V + 10% ~ -0%  |
| 0-1000M 1000VDC    | 1M         | ±3% + 5d | 1000V + 10% ~ -0% |
| 1000-2000M 1000VDC | 1M         | ±5% + 5d | 1000V + 10% ~ -0% |

| Range              | Test Current |             | Short Circuit Current |
|--------------------|--------------|-------------|-----------------------|
| 200M 250V          | 1mA          | 250k (load) | <1mA                  |
| 200M 500V          |              | 500k (load) |                       |
| 0-1000M 1000VDC    |              | 1M          |                       |
| 1000-2000M 1000VDC |              |             |                       |

#### AC VOLTAGE (40Hz-400Hz)

| Range  | Resolution | Accuracy    | Input Impedance | Overload Protection |
|--------|------------|-------------|-----------------|---------------------|
| 750VAC | 1V         | ±1.2% + 10d | 10M             | 750Vrms             |


**DC VOLTAGE**

| Range   | Resolution | Accuracy         | Input Impedance | Overload Protection |
|---------|------------|------------------|-----------------|---------------------|
| 1000VDC | 1V         | $\pm 0.8\% + 3d$ | 10M             | 1000Vrms            |

**RESISTANCE**

| Range | Resolution | Accuracy       | Max. Open Circuit Voltage | Overload Protection |
|-------|------------|----------------|---------------------------|---------------------|
| 200   | 0.1        | $\pm 1\% + 2d$ | 4.5V                      | 250Vrms             |
| 200k  | 0.1k       | $\pm 1\% + 2d$ | 3V                        | 250Vrms             |


#### General specifications

|                                      |   |
|--------------------------------------|---|
| Display                              | LCD with dual display   |
| Sampling rate                        | 2.5 readings per second   |
| Continuity beeper voltage 4.5V       | <40 $\Omega$ , short circuit current <200mA, open circuit                           |
| Over range indicator                 | '1' displayed   |
| Zero adjust                          | Automatic   |
| Low battery indicator                | Low battery symbol displayed when battery voltage is low                            |
| Environmental<br>Altitude up to 2000 | Installation category III, Pollution Degree 2,<br>meters, Indoor use only           |
| Power source                         | Six (6) 1.5 'AA' batteries  |
| Fuse                                 | 250mA/600V ceramic 3AG Fast blow  |
| Operating conditions                 | 0 to 40°C (32 to 104°F); 80% RH   |
| Storage conditions                   | -10 to 60°C (14 to 140°F); <80% RH  |
| Dimensions                           | 200 x 92 x 50mm (7.8 x 3.6 x 1.9")  |
| Weight                               | 700g (24.6oz)   |
| IEC 1010                             | CAT III-1000V   |
| Approvals                            |  |


## **Maintenance**

---

### **Battery Replacement**

When the low battery symbol  appears on the LCD, the six 1.5V 'AA' batteries must be replaced.

1. Turn the meter off and remove the test leads
2. Unsnap the tilt stand from the rear of the meter
3. Remove the four Phillips head screws holding the battery cover
4. Remove the battery compartment cover
5. Replace the batteries observing polarity
6. Affix the rear cover and secure the screws.
7. Reattach the tilt stand

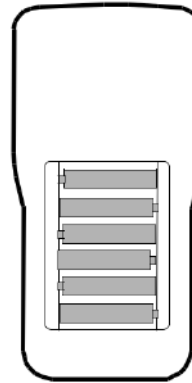

### **Warranty Information**

Triplett / Jewell Instruments extends the following warranty to the original purchaser of these goods for use. Triplett warrants to the original purchaser for use that the products sold by it will be free from defects in workmanship and material for a period of (1) one year from the date of purchase. This warranty does not apply to any of our products which have been repaired or altered by unauthorized persons in any way or purchased from unauthorized distributors so as, in our sole judgment, to injure their stability or reliability, or which have been subject to misuse, abuse, misapplication, negligence, accident or which have had the serial numbers altered, defaced, or removed. Accessories, including batteries are not covered by this warranty

**Copyright © 2019 Triplett**