

HIOKI

Instruction Manual

RM3543 RM3543-01

RESISTANCE HiTESTER

HIOKI E. E. CORPORATION

September 2013 Revised edition 2 RM3543A981-02 13-09H

Contents

Task-Oriented Reference	1
Measurement Flow	2
Introduction	3
Verifying Package Contents	3
Safety Information	5
Operating Precautions	7

Chapter 1 Overview 11

1.1 Product Overview and Features	11
■ Block Diagram	14
1.2 Names and Functions of Parts	15
1.3 Screen Organization	17

Chapter 2 Measurement Preparations 21

2.1 Connecting the Power Cord	22
2.2 Connecting Measurement Cables and Test Fixtures	23
■ Making Your Own Measurement Cables ..	24
2.3 Turning the Power On and Off	26

Chapter 3 Measurement Settings (Basic Measurements) 27

3.1 Pre-Operation Inspection	27
3.2 Switching 100 mΩ range Measurement Currents	28
3.3 Setting the Measurement Speed	29
3.4 Setting Measurement Start Conditions (Trigger Source)	30
3.5 Selecting the Measurement Range	31
3.6 Zero Adjustment	32
3.7 Judging Measured Values (Comparator Function)	34
■ Enabling and Disabling the Comparator Function	35
■ Decide According to Reference Value and Tolerance (ABS Mode)	37

■ Decide According to Upper/Lower Thresholds (ABS Mode)	37
3.8 Confirming Faulty Measurements	38

Chapter 4 Customizing Measurement Settings 41

4.1 Making Range-Specific Measurement Settings	41
4.2 Setting Pre-Measurement Delay	42
4.3 Correcting Measured Values (Scaling Function)	44
4.4 Setting the Measurement Integration Time Option	46
4.5 Stabilizing Measured Values (Averaging Function)	48
4.6 Checking for Poor or Improper Contact (Contact Check Function)	49
4.7 Improving Probe Contact (Contact Improver Function)	50
4.8 Detecting Measurement Voltage Faults (Voltage Level Monitor Function)	52
4.9 Applying Current Only When Measuring (Current Mode Setting)	53
4.10 Test for Short-Circuited Probe (Probe Short-Circuit Detection Function)	54
4.11 Comparing the Measurement Settings of Two Instruments (Settings Monitor Function)	56
4.12 Retrying Measurement After a Fault (Retry Function)	59
4.13 Maintaining Measurement Precision (Self-Calibration)	60
4.14 Compensating for Thermal EMF Offset (Offset Voltage Compensation - OVC) ..	61

Chapter 5 System Settings 63

5.1 Disabling and Enabling Key Operations	63
■ Disabling Key Operations	

Contents

■ Re-Enabling Key Operations (Key-Lock Cancel)	64
5.2 Setting the Comparator Decision and Key Beepers	65
■ Enabling or Disabling the Key Beeper	65
■ Setting the Comparator Decision ("JUDGE") Beeper	66
5.3 Power Line Frequency Manual Setting	67
5.4 Setting the Clock	68
5.5 Adjusting Screen Contrast	69
5.6 Adjusting the Backlight	70
5.7 Initializing (Reset)	71
■ Default Settings	72

Chapter 6 Storing and Exporting Data 73

6.1 Storing Data at Specific Times (Data Memory Function)	74
6.2 Store as soon as Measurement is Stable (Auto-Memory Function)	75
6.3 Performing Statistical Calculations on Measured Values	78
■ Using Statistical Calculations	79
■ Confirming, Printing, and Erasing Calculation Results	80
6.4 Auto-Exporting Measured Values (at End of Measurement) (Data Output Function)	81

Chapter 7 Printing 83

7.1 Connecting the Printer	83
■ Connecting the Printer to the Instrument	84
7.2 Instrument Settings	85
7.3 Printing	86
■ Printing Measured Values and Comparator Decisions	86
■ Printing Statistical Calculation Results	86

Chapter 8 External Control 89

8.1 External Input/Output Connector and Signals	89
---	----

■ Signal Descriptions	91
8.2 Timing Chart	92
8.3 Internal Circuitry	94
■ Electrical Specifications	95
■ Connection Examples	96
8.4 External I/O Settings	97
■ Setting End-of-Measurement Signal Output (EOM Signal Setting)	97
■ Setting the Trigger (TRIG) Signal Logic	98
8.5 External Control Q&A	99
8.6 Supplied Connector Assembly	100

Chapter 9 Communications (RS-232C/ GP-IB Interface) 101

9.1 Overview and Features	101
9.2 Specifications	102
9.3 Connecting	103
■ Using the RS-232C Interface	103
■ Using the GP-IB Interface (RM3543-01 only)	104
9.4 Configuring the Communications Protocol	105
■ Configuring RS-232C Interface Communications	105
■ Configuring GP-IB Interface Communications (RM3543-01 only)	106
■ Select the Measurement Data Transmission Format (both RS-232C and GP-IB)	107
9.5 Communication Methods	108
■ To cancel the Remote state (enter the local state)	108
■ Message Format	109
■ Output Queue and Input Buffer	112
■ Status Byte Register	113
■ Event Registers	115
■ Initialization Items	118
■ Command Execution Time	119
■ Errors During Communications	119
9.6 Message List	120
■ Standard Commands	120
■ Device-Specific Commands	121
9.7 Message Reference	126
■ Message Reference Interpretation	126
■ Standard Commands	127
■ Device-Specific Commands	131

9.9	Sample Programs	154
■	Using Visual Basic 5.0 or 6.0	154
■	Creation Procedure (Visual Basic 2005) ..	164
■	Sample Programs (Visual Basic 2005) ...	166
9.10	Device Compliance Statement.....	168

Chapter 10 Specifications 171

Chapter 11 Maintenance and Service 183

11.1	Troubleshooting	183
■	Inspection and Repair	183
11.2	Cleaning	184
11.3	Error Displays and Remedies	185
11.4	Disposing of the Instrument	187
■	Removing the Lithium Battery	187

Appendix A 1

Appendix 1	Four-Terminal (Voltage-Drop) Method.....	A 1
Appendix 2	Effect of Thermal emf	A 2
Appendix 3	Unstable Measurement Values.....	A 3
Appendix 4	Effects of Probing	A 9
Appendix 5	Rack Mounting	A 11
Appendix 6	Dimensional Diagram	A 13
Appendix 7	Calibration.....	A 14
Appendix 8	Adjustment Procedure	A 16
Appendix 9	Table of Commands Compatible with the ADEX AX-1152D	A 17
Appendix 10	Zero Adjustment	A 19

Index Index 1

6

7

8

9

10

11

Appendix

Task-Oriented Reference

To minimize measurement error

- ▶ Setting the measurement speed (p. 29)
- ▶ Setting the averaging function (p. 48)
- ▶ Setting the measurement speed integration time option (p. 46)
- ▶ Correcting measured values (p. 44)
- ▶ Zero-adjustment (p. 32)

To judge measurement results

- ▶ Judge measured values (comparator function) (p. 34)
- ▶ Compare the measurement settings of two instruments (Settings Monitor function) (p. 56)

To correct faulty measurements

- ▶ Confirm faulty measurement (p. 38)
- ▶ Improve probe contact (Contact Improver function) (p. 50)
- ▶ Test for short-circuited probe (probe short-circuit detection function) (p. 54)
- ▶ Compare the measurement settings of two instruments (Settings Monitor function) (p. 56)

To automatically store measured values

- ▶ Store as soon as measurement is stable (Auto Memory function) (p. 75)

To print measurement results

- ▶ Printing (p. 83)

To measure by PLC connection (PLC: Programmable Logic Controller)

- ▶ External control (p. 89)
- ▶ Communications (RS-232C/GP-IB interface) (p. 101)

To connect to a computer

- ▶ Communications (RS-232C/GP-IB interface) (p. 101)

To automatically send measurement data to a computer (RS-232C interface only)

- ▶ Export measurement values automatically (when finished measuring) (p. 81)


To check operation

- ▶ Setting Measurement Start Conditions (Trigger Source) (p. 30)
- ▶ Internal trigger (INT)
- ▶ Calibration (p. A14)


Measurement Flow

Be sure to read the "Operating Precautions" (p. 7) before use.

Installing, Connecting and Turning On

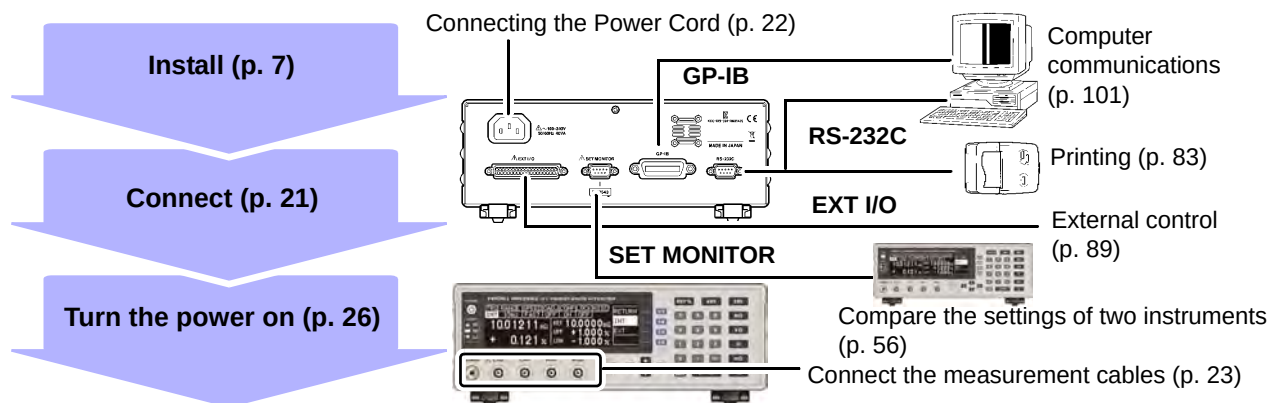

Settings

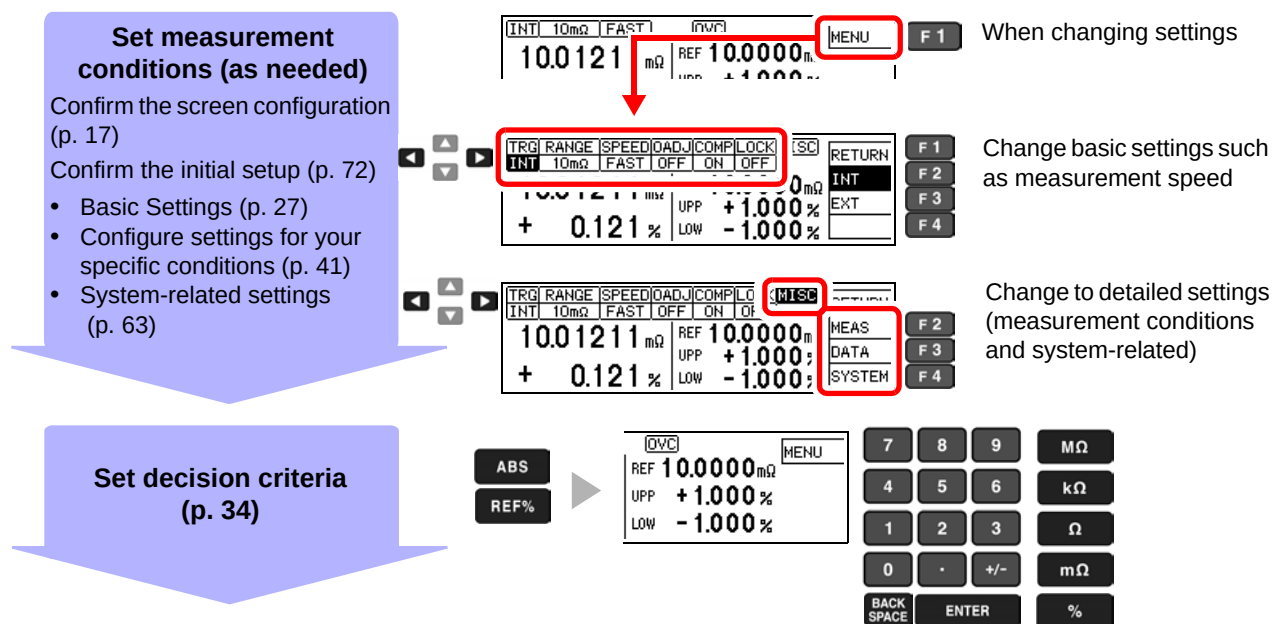

Calculation, Printing, Communication, and External Control Settings

Statistical calculations (p. 78)

Computer communications (p. 101)

Data transmission (p. 81)

External control (p. 89)

Printing (p. 83)

Instrument interface settings must be configured before printing or using communications or remote control.

When Finished

Turn the power off (p. 26)

Introduction

Thank you for purchasing the HIOKI Model RM3543/ RM3543-01 Resistance HiTester.
To obtain maximum performance from the instrument, please read this manual first, and keep it handy for future reference.

Model RM3543-01 is the same as the RM3543, but with GP-IB included.

Registered trademarks

Windows and Visual Basic are registered trademark of Microsoft Corporation in the United States and/or other countries.

Verifying Package Contents

Inspection

When you receive the instrument, inspect it carefully to ensure that no damage occurred during shipping. In particular, check the accessories, panel switches, and connectors. If damage is evident, or if it fails to operate according to the specifications, contact your dealer or Hioki representative.

Content confirmation

Confirm that these contents are provided.

- ☐ Model RM3543 or
RM3543-01 (with GP-IB included)1



- ☐ Instruction Manual (This document)..... 1



- ☐ Operation Guide..... 1




- ☐ Power Cord (2-line + ground)(p. 22)
☐ EXT I/O Male Connector (p. 100)

Options

Contact your dealer or Hioki representative for details.


**Measurement Probes and Fixtures
(connect to measurement jacks)**

- ☐ Model 9140 4-terminal Probe

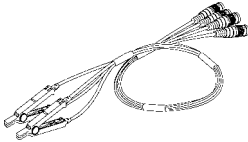


Alligator-clip-type measurement probes. These general-purpose dual-electrode clips fit a wide range of conductor thicknesses.

- ☐ Model 9500 4-terminal Probe

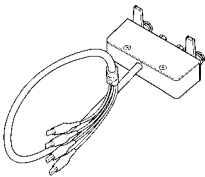


Rubber-sheathed alligator-clip-type measurement probes. This design is ideal for 4-terminal-pair resistance measurement applications, for example measuring standard resistors

- ☐ Model 9262 Test Fixture

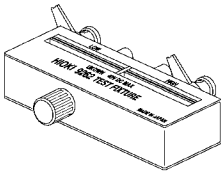

This fixture is for measuring lead components. (less than 10 mΩ residual resistance after zero adjustment)

- ☐ Model 9263 SMD Test Fixture

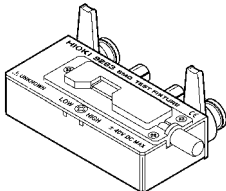

This fixture is for measuring chip components. (less than 10 mΩ residual resistance after zero adjustment)

Interface Cables

- ☐ Model 9637 RS-232C Cable (9-pin to 9-pin/ crossover cable)
- ☐ Model 9638 RS-232C Cable (9-pin to 25-pin/ crossover cable)
- ☐ Model 9151-02 GP-IB Connector Cable (2m)

Safety Information



This instrument is designed to comply with IEC 61010 Safety Standards, and has been thoroughly tested for safety prior to shipment. However, mishandling during use could result in injury or death, as well as damage to the instrument. Using the instrument in a way not described in this manual may negate the provided safety features. Be certain that you understand the instructions and precautions in the manual before use. We disclaim any responsibility for accidents or injuries not resulting directly from instrument defects.

This manual contains information and warnings essential for safe operation of the instrument and for maintaining it in safe operating condition. Before using it, be sure to carefully read the following safety precautions.

Safety Symbols



In the manual, the symbol indicates particularly important information that the user should read before using the instrument.

The symbol printed on the instrument indicates that the user should refer to a corresponding topic in the manual (marked with the symbol) before using the relevant function.



Indicates AC (Alternating Current).

The following symbols in this manual indicate the relative importance of cautions and warnings.



WARNING

Indicates that incorrect operation presents a significant hazard that could result in serious injury or death to the user.



CAUTION

Indicates that incorrect operation presents a possibility of injury to the user or damage to the instrument.

NOTE

Indicates advisory items related to performance or correct operation of the instrument.

Symbols for Various Standards



This symbol indicates that the product conforms to regulations set out by the EC Directive.



WEEE marking:

This symbol indicates that the electrical and electronic appliance is put on the EU market after August 13, 2005, and producers of the Member States are required to display it on the appliance under Article 11.2 of Directive 2002/96/EC (WEEE).

Other Symbols



Indicates a prohibited action.

(p.)

Indicates the location of reference information.

*

Indicates that descriptive information is provided below.

[]

Square brackets indicate instrument display labels (such as setting item names).

SET

Bold characters within the text indicate operating key labels.

(Bold characters)

Unless otherwise specified, "Windows" represents Windows 95, 98, Me, Windows NT4.0, Windows 2000, Windows XP, or Windows Vista.

Click: Press and quickly release the left button of the mouse.

Double click: Quickly click the left button of the mouse twice.

Accuracy

We define measurement tolerances in terms of f.s. (full scale), rdg. (reading) and dgt. (digit) values, with the following meanings.

f.s.	(maximum display value) The maximum displayable value. This is usually the name of the currently selected range.
rdg.	(reading or displayed value) The value currently being measured and indicated on the measuring instrument.
dgt.	(resolution) The smallest displayable unit on a digital measuring instrument, i.e., the input value that causes the digital display to show a "1" as the least-significant digit.

Operating Precautions



Follow these precautions to ensure safe operation and to obtain the full benefits of the various functions.

Preliminary Checks

- Before using the instrument for the first time, verify that it operates normally to ensure that no damage occurred during storage or shipping. If you find any damage, contact your dealer or Hioki representative.
- Before using the instrument make sure that the insulation on the power cord is undamaged and that no bare conductors are improperly exposed. Using the instrument in such conditions could cause an electric shock, so contact your dealer or Hioki representative for repair.
- Before using the instrument, make sure that the insulation on the measurement cables is undamaged and that no bare metal is improperly exposed. If there is any damage, measured values may be unstable and measurement errors may occur.

Instrument Installation

Storage temperature and humidity : -10°C to 50°C at 80% RH or less (non-condensating)
Operating temperature and humidity : 0 to 40°C at 80% RH or less (non-condensating)

Avoid the following locations that could cause an accident or damage to the instrument.



Exposed to direct sunlight
Exposed to high temperature



In the presence of corrosive or explosive gases



Exposed to water, oil, other chemicals, or solvents
Exposed to high humidity or condensation



Exposed to strong electromagnetic fields
Near electromagnetic radiators



Exposed to high levels of particulate dust




Near induction heating systems (e.g., high-frequency induction heating systems and IH cooking utensils)



Subject to vibration

Installation Precautions

- The instrument should be operated only with the bottom downwards.
- Do not place the instrument on an unstable or slanted surface.
- **Vents must not be obstructed.**

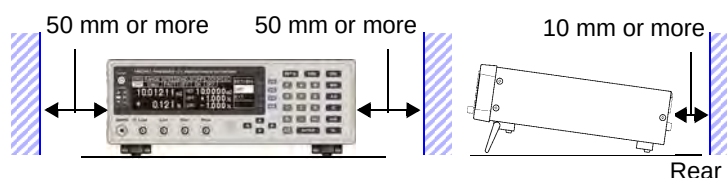

The instrument can be used with the stand (p. 16).
It can also be rack-mounted. (p. A11).

Unplugging the power cord kills power to the instrument. Be sure to provide enough unobstructed space to unplug the power cord immediately in an emergency.

Handling the Instrument**! WARNING**

- Do not allow the instrument to get wet, and do not take measurements with wet hands. This may cause an electric shock.
- Do not attempt to modify, disassemble or repair the instrument; as fire, electric shock and injury could result.

! CAUTION

To avoid damage to the instrument, protect it from physical shock when transporting and handling. Be especially careful to avoid physical shock from dropping.

NOTE

This instrument may cause interference if used in residential areas. Such use must be avoided unless the user takes special measures to reduce electromagnetic emissions to prevent interference to the reception of radio and television broadcasts.

Handling the Cords and Probes**! CAUTION**

- Avoid stepping on or pinching cables, which could damage the cable insulation.
- To avoid breaking the cables, do not bend or pull them.
- To avoid damaging the power cord, grasp the plug, not the cord, when unplugging it from the power outlet.
- When disconnecting the BNC connector, be sure to release the lock before pulling off the connector. Forcibly pulling the connector without releasing the lock, or pulling on the cable, can damage the connector (p. 23).

NOTE

- Use only the specified connection cables. Using a non-specified cable may result in incorrect measurements due to poor connection or other reasons.
- Before using a test fixture, read the instructions provided with it.

Before Turning Power On**! WARNING**

Before turning the instrument on, make sure the supply voltage matches that indicated on its power connector. Connection to an improper supply voltage may damage the instrument and present an electrical hazard.

Before Connecting EXT I/O

WARNING

To avoid electric shock or damage to the equipment, always observe the following precautions when connecting to the EXT I/O connector.

- Always turn off the power to the instrument and to any devices to be connected before making connections.
- Be careful to avoid exceeding the ratings of external terminals (p. 95).
- During operation, a wire becoming dislocated and contacting another conductive object can be serious hazard. Use screws to secure the external connectors.
- Ensure that devices and systems to be connected to the EXT I/O terminals are properly isolated.
- The ISO_5V pin of the EXT I/O connector is a 5 V power output, and the ISO_12V pin is a 12 V power output. Do not apply external power to this pin.

CAUTION

To avoid damage to the instrument, observe the following cautions:

- Do not apply voltage or current to the EXT I/O terminals that exceeds their ratings.
- When driving relays, be sure to install diodes to absorb counter-electromotive force.
- Be careful not to short-circuit ISO_5V to ISO_COM.
- Be careful not to short-circuit ISO_12V to ISO_COM.
- Do not draw loads from ISO_5V and ISO_12V at the same time.

See: "Connector Type and Signal Pinouts" (p. 90)

Before Measuring

CAUTION

- Do not apply any voltage to the measurement jacks. Doing so could damage the instrument.
- Never attempt to measure at a point where voltage is present. In particular, do not measure a transformer or motor immediately after a temperature increase test or withstand-voltage test, as the instrument could be damaged by induced voltage or residual charge.
- Battery internal resistance cannot be measured with this instrument. It will sustain damage. To measure battery internal resistance, we recommend the HIOKI 3554, 3555, BT3562, BT3563, and 3561 Battery HiTesters.

NOTE

- To obtain the guaranteed measurement accuracy, allow at least 30 minutes warm-up.
- The instrument internally retains all settings (but not measured values), such as measurement range and comparator settings. However, measurement settings made through the RS-232C or GP-IB interface are not memorized.
- The DC resistance of a power transformer cannot be measured. Do not measure objects with a large L (100 μ H or higher in the 10 m Ω to 100 Ω range, or 10 μ H or higher in the 1,000 Ω range), such as choke coils and other inductors. In such cases, contact your dealer or Hioki representative.
- You may be unable to obtain accurate measured values when there is a capacitance component in parallel with the measurement target. For this instrument, any parallel capacitance component should be limited to a maximum of 1,000 pF.
- Carefully insulate all H_{CUR}, H_{POT}, L_{POT}, and L_{CUR} wiring. Proper 4-terminal measurements cannot be performed and an error will occur if core and shield wires touch.
- During measurement, a transient current equal to about 1.5 times the steady-state current will flow for several microseconds (or about 10 mA_{pk} in the 1 k Ω range). Exercise special care when measuring targets whose characteristics are prone to vary.

Overview

Chapter 1

1

1.1 Product Overview and Features

The Hioki RM3543 Resistance HiTester employs the 4-terminal method to quickly and accurately measure the DC resistance of components such as resistors and current sensing resistors. It includes advanced contact-check, comparator, and data output functions. The intuitive user interface and high noise immunity are ideal for use with taping machines and separators.

Resistance Measurement

The factory defaults (initial settings) are optimized for current sensing resistors measurements.

Optional Hioki probes and fixtures are available to connect to the measurement jacks (BNC jacks, p. 4). Alternatively, commercially available cables such as 1.5D-2V coax can be used (p. 24).



Judge Measured Values

Measured values are compared with a pre-specified reference value or thresholds, and the result is output externally and indicated by the COMP indicators (comparator function, p. 34).



Save and Output Measured Values

Measured values can be stored in internal memory (p. 73). Statistical calculations can be performed on the stored data, which can be transferred to a computer in batch form (however, stored data cannot be confirmed internally).

Send Measurement Data and Calculation Results to a Printer

Use a commercially available printer with a serial interface to print measured values and calculation results (p. 83).

Connect a PLC or I/O Board



To control from a PLC, connect to the EXT I/O connector. In addition to comparator results, various measurement anomaly signals can be output (p. 89).

Compare Two Instrument's Setting Conditions

When measuring with two interconnected instruments, settings are compared, and an alarm is output and measurement is inhibited if the settings differ (Settings Monitor function, p. 56).

Interface Communications

Connect the instrument to a controller via the RS-232C or GP-IB interface to control measurement data acquisition (p. 101).

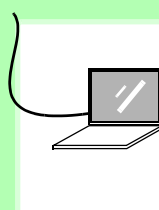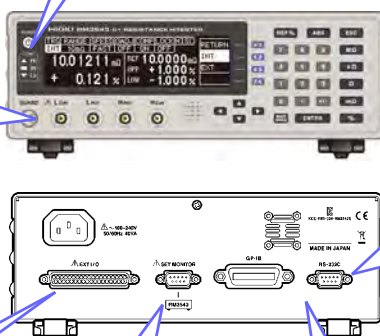

Features

Ultra Fast and Accurate Measurements Increase Productivity

The RM3543 is ideally suited for use in testing current sensing resistors, where there has been remarkable progress in lowering resistance values. Measurement from which the effects of thermal EMF are consistently eliminated (by the OVC function) yields a resolution of $0.01 \mu\Omega$ in the $10 \text{ m}\Omega$ range. Since measurement results are obtained by means of a PASS/FAIL judgment process with a resolution of 0.001% , the instrument can test resistors of $1 \text{ m}\Omega$ and less at a high rate of speed. Thanks to proprietary ultra-fast, high-stability circuit technology, the RM3543 completes the sequence of contact improvement, measurement and contact check, and judgment output in just 1.6 ms.

Multiple Interfaces

EXT I/O is isolated from the measurement and control circuits to provide noise immunity (p. 89). All data can be acquired in real time using the built-in 38.4-kbps high-speed RS-232C interface. Connect the commercially available printer with a serial interface to print measured values and statistical calculation results (p. 83). The GP-IB interface is available for Model RM3543-01 (specified when ordering, p. 101).


Clearly Visible Display and Intuitive Operation

High-contrast LCD provides clear visibility, helping avoid setting mistakes. The optimum range is selected automatically when comparator thresholds are entered.


INT 10mΩ	FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ		
+ 0.121 %	UPP +1.000 %		
	LOW -1.000 %		

Fixtures for Component Measurements (p. 4)

The BNC-type measurement jacks exhibit good noise immunity. Ready availability and easy assembly ensure smooth system setup. Various test fixtures are available for Hioki LCR HiTesters.

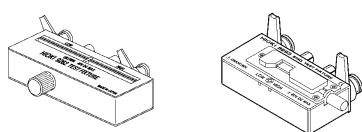**Specially designed for current sensing resistors**

Thanks to its scaling function, the RM3543 can compensate for the difference between resistance values obtained at the time of mounting on the board and during testing. By using the averaging function during super-low-resistance measurement with a small detection voltage, it is possible to achieve even higher levels of accuracy.

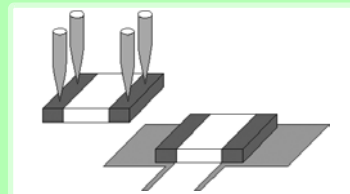**High-Speed Data Output and Ample Memory**

The Data Output function transfers measured data at 5 ms/sample, even via RS-232C. Up to 30,000 measurements can be stored, and all data can be exported at the end of measuring each reel. This function is ideal for system setup, debugging and process management.

Auto Memory Function Convenient for Sampling Tests (p. 75)

The auto memory function is convenient for sampling tests after screen-printing. Measured values are automatically acquired as soon as they stabilize, and statistical calculations proceed until the specified quantity is obtained, upon which an alert notification (alarm) occurs. Selecting [PRINT] (screen display) prints measured values and statistical calculation results (p. 86).




STATISTICS			
Num 19	Val 17	RETURN	
Ave 99.5153Ω	Sn 0.0015Ω	PRINT	
Max 99.5183Ω	Sn1 0.0015Ω	UNDO	
(No:00015)	Cp 1.00	ALLCLR	
Min 99.5113Ω	Cpk 1.00		
(No:00001)			


Features

Reliable Contact Checking (p. 49)


Contact checking (that was previously performed before and after measuring) is now performed during measurement, so probe bounce and contact resistance fluctuations can be detected. Contact checking time can be shortened, improving tact times.

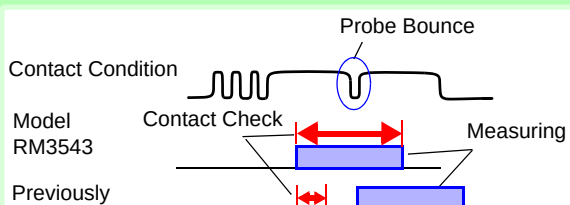**Minimize Human Error and Risk – the Settings Monitor Function (p. 56)**


If the settings of two instruments are different, triggering is inhibited and an alarm notification is generated to avoid setting mistakes due to human error.

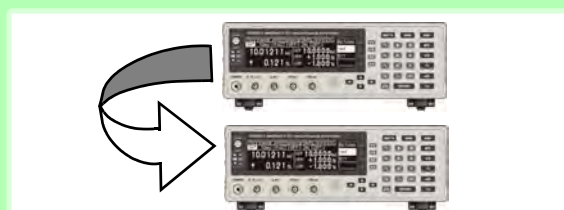**Reject Faulty Data – Voltage Level Monitor Function (p. 52)**


When the contact resistance of the H_{CUR} and L_{CUR} leads fluctuates, the measurement current changes momentarily. Such momentary changes are not detectable by typical contact checking. The Voltage Level Monitor function detects a contact error if the detection voltage changes significantly, which can increase the reliability of measured values.

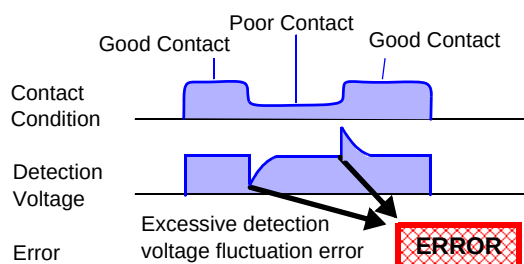**Reliable Four-Terminal Measurement – Probe Short-Circuit Detection Function (p. 54)**

Four-terminal measurements are inhibited when a conductive foreign object is present between the POT and CUR probe tips. Short-circuit probe anomalies are detected by checking the resistance between these tips when not measuring.

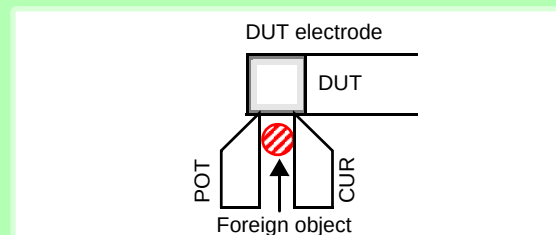**Contact Improver Function (p. 50)**

The Contact Improver function improves bad contacts between probes and test samples. Contacts errors are reduced by penetrating oxidation and impurities between probes and samples. Reducing contact errors can increase productivity and quality. The intensity of the contact improver function can be adjusted according to probe type.

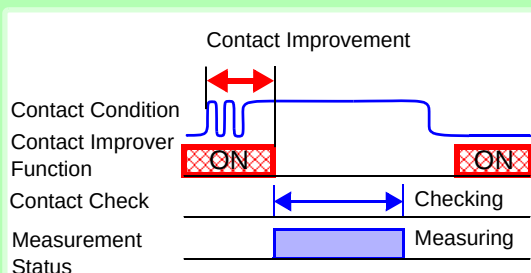
**Measurement Circuit Strongly Immune to Contact Resistance Fluctuations**

The effects of contact resistance fluctuations are reduced even when scattering occurs near the end of probe life. Such effects are minimized by the fast response of the measurement circuit.

Strong Electrical Noise Immunity

The specified measurement accuracy is achieved even with ± 1.5 kV mixed pulse noise. The floating measurement section design is highly impervious to electrical noise, minimizing the effect on measured values even when turning large-induction motors on and off. The free-range power supply input (90 to 264 V) is practically unaffected by voltage fluctuations, so stable measurements are possible even in under poor power conditions.

Block Diagram

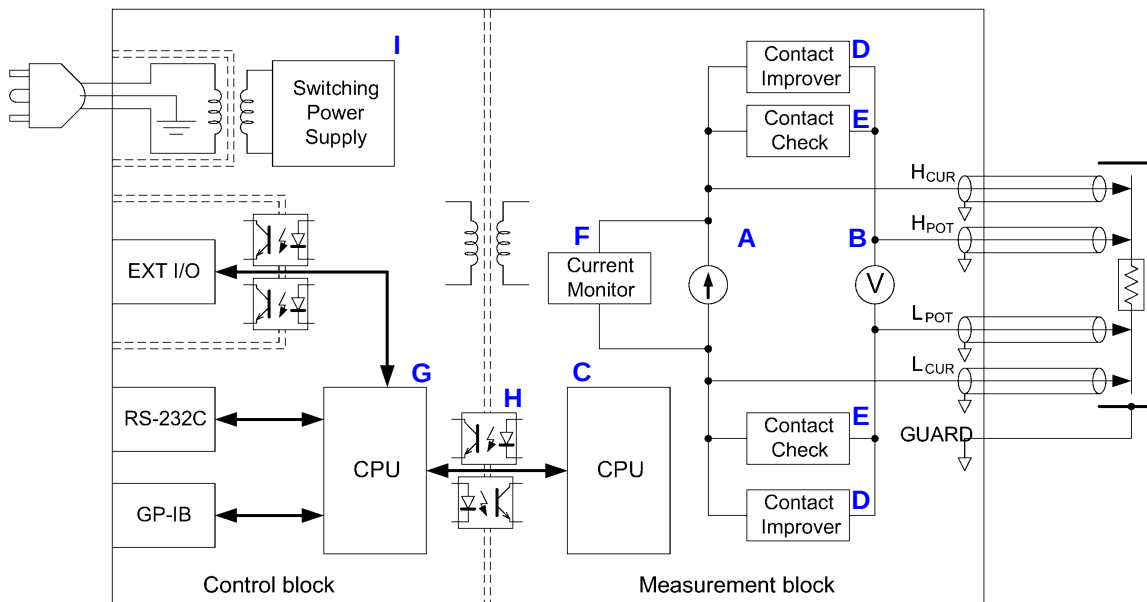


- Constant current (determined by the measurement range) is applied between the H_{CUR} and L_{CUR} terminals while voltage is measured between the H_{POT} and L_{POT} terminals. The resistance value is obtained by dividing the measured voltage (B) by the constant current flow (A).
- The effects of large offset voltage such as from thermal emf are reduced by current flowing in the positive and negative directions (A).
- The constant current source (A) and voltmeter (B) circuit designs are largely unaffected by contact resistance.
- Faulty measurement values caused by unstable or chattering contact conditions can be eliminated by monitoring (C) the detection voltage (B) waveform (Voltage Level Monitor function).
- Before measuring, the Contact Improver circuit (D) optimizes contact when the probes touch the DUT.
- By also performing contact checking (E), short circuits between CUR and POT terminals caused by a clogged probe tip can be detected (probe short-circuit detection function).
- When measurement starts, the contact check circuit (E) and constant current monitor (F) are activated to monitor for fault conditions while measuring. The dual-CPU (C and G) design provides ultra-high-speed measurements and fast system response.
- Immunity from electrical noise is provided by isolation between the Measurement and Control blocks (H).
- The auto-ranging 100-to-240 V switching power supply (I) can provide stable measurements even in poor power quality environments.

1.2 Names and Functions of Parts

1

Front Panel

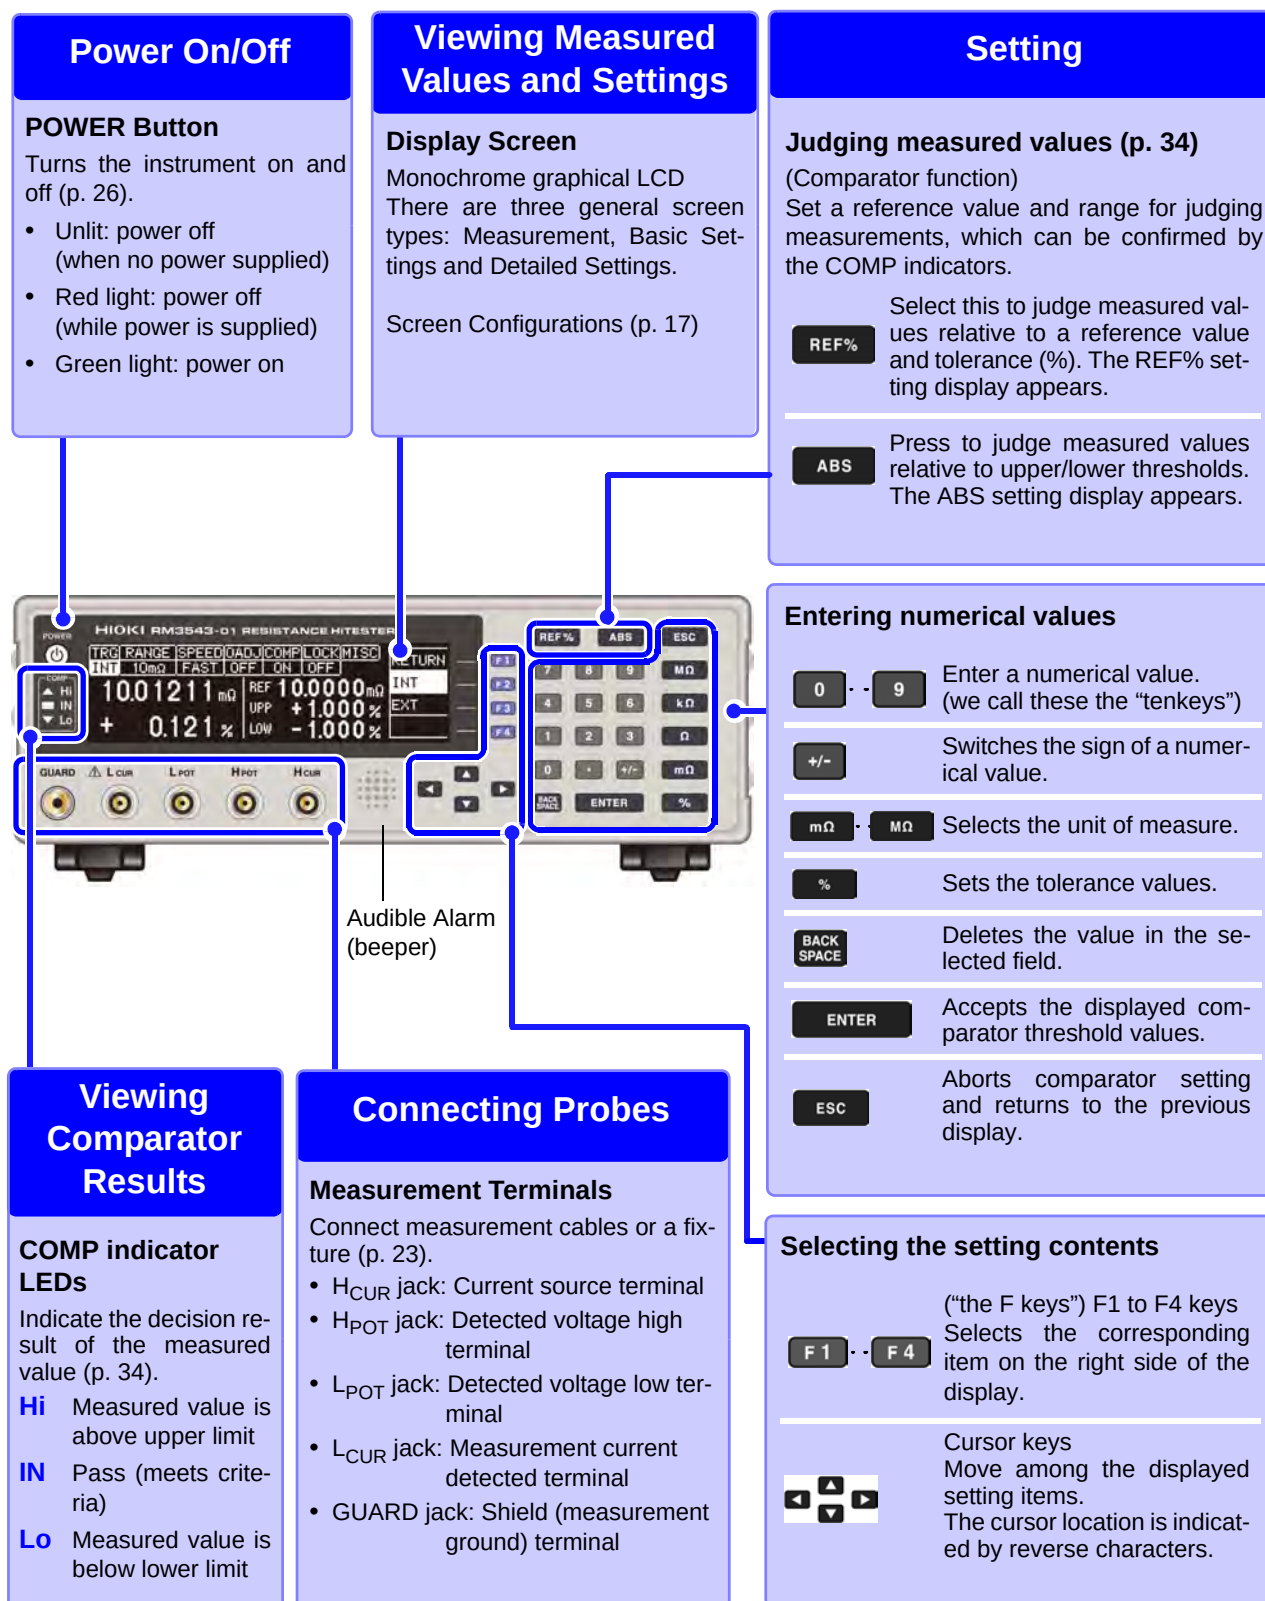


Rear Panel

Connecting the Power Cord

Connect the supplied power cord (p. 22).

Manufacturer's Serial Number

Shows the serial number. Do not remove this label, as it is required for product support.

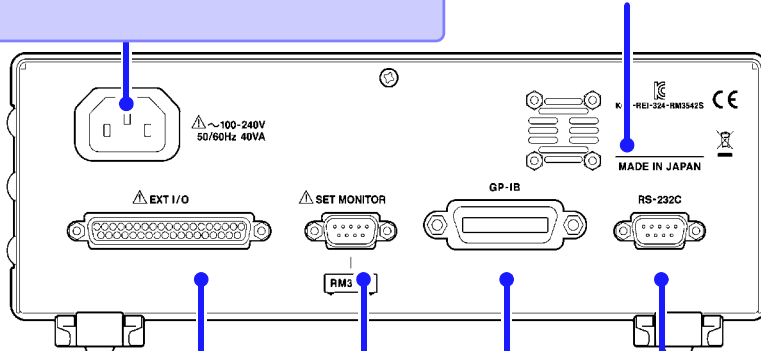

External Control

EXT I/O Connector

Connect to a PLC or I/O board to control measurement start, and to acquire comparator results (p. 89).

RS-232C Communications
Printer Output

RS-232C Connector

The RS-232C interface can be used to connect to a PLC or computer (p. 101). It is also used by the commercially available printer with a serial interface (p. 83).

Compare Two Instruments' Settings

SET MONITOR Connector


Connect another RM3543 here to compare instrument settings (p. 56).

GP-IB Communications

GP-IB Connector (RM3543-01 only)

The GP-IB interface can be used to connect to a computer (p. 101).

Bottom Panel

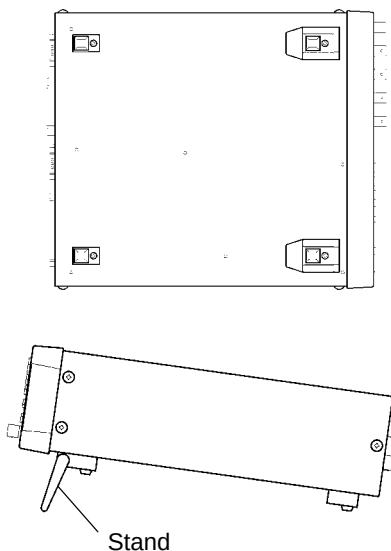

This instrument can be rack mounted.

See: "Appendix 5 Rack Mounting" (p. A11)

Parts removed from this instrument should be stored in a safe place to enable future reuse.

When using the stand

Extend the stand until it clicks into place. Make sure to extend both legs of the stand.

Collapsing the stand

Fold in the stand until it clicks into place.

CAUTION

Do not apply heavy downward pressure with the stand extended. The stand could be damaged.


1.3 Screen Organization

1


The instrument has three general display screen types: Measurement, Basic Settings and Detailed Settings.

Refer to "11.3 Error Displays and Remedies" (p. 185) for error displays.

The screen examples in this guide appear reversed (black on white) for best visibility on the printed page. However, the instrument screens can actually be displayed only as white characters on black background.

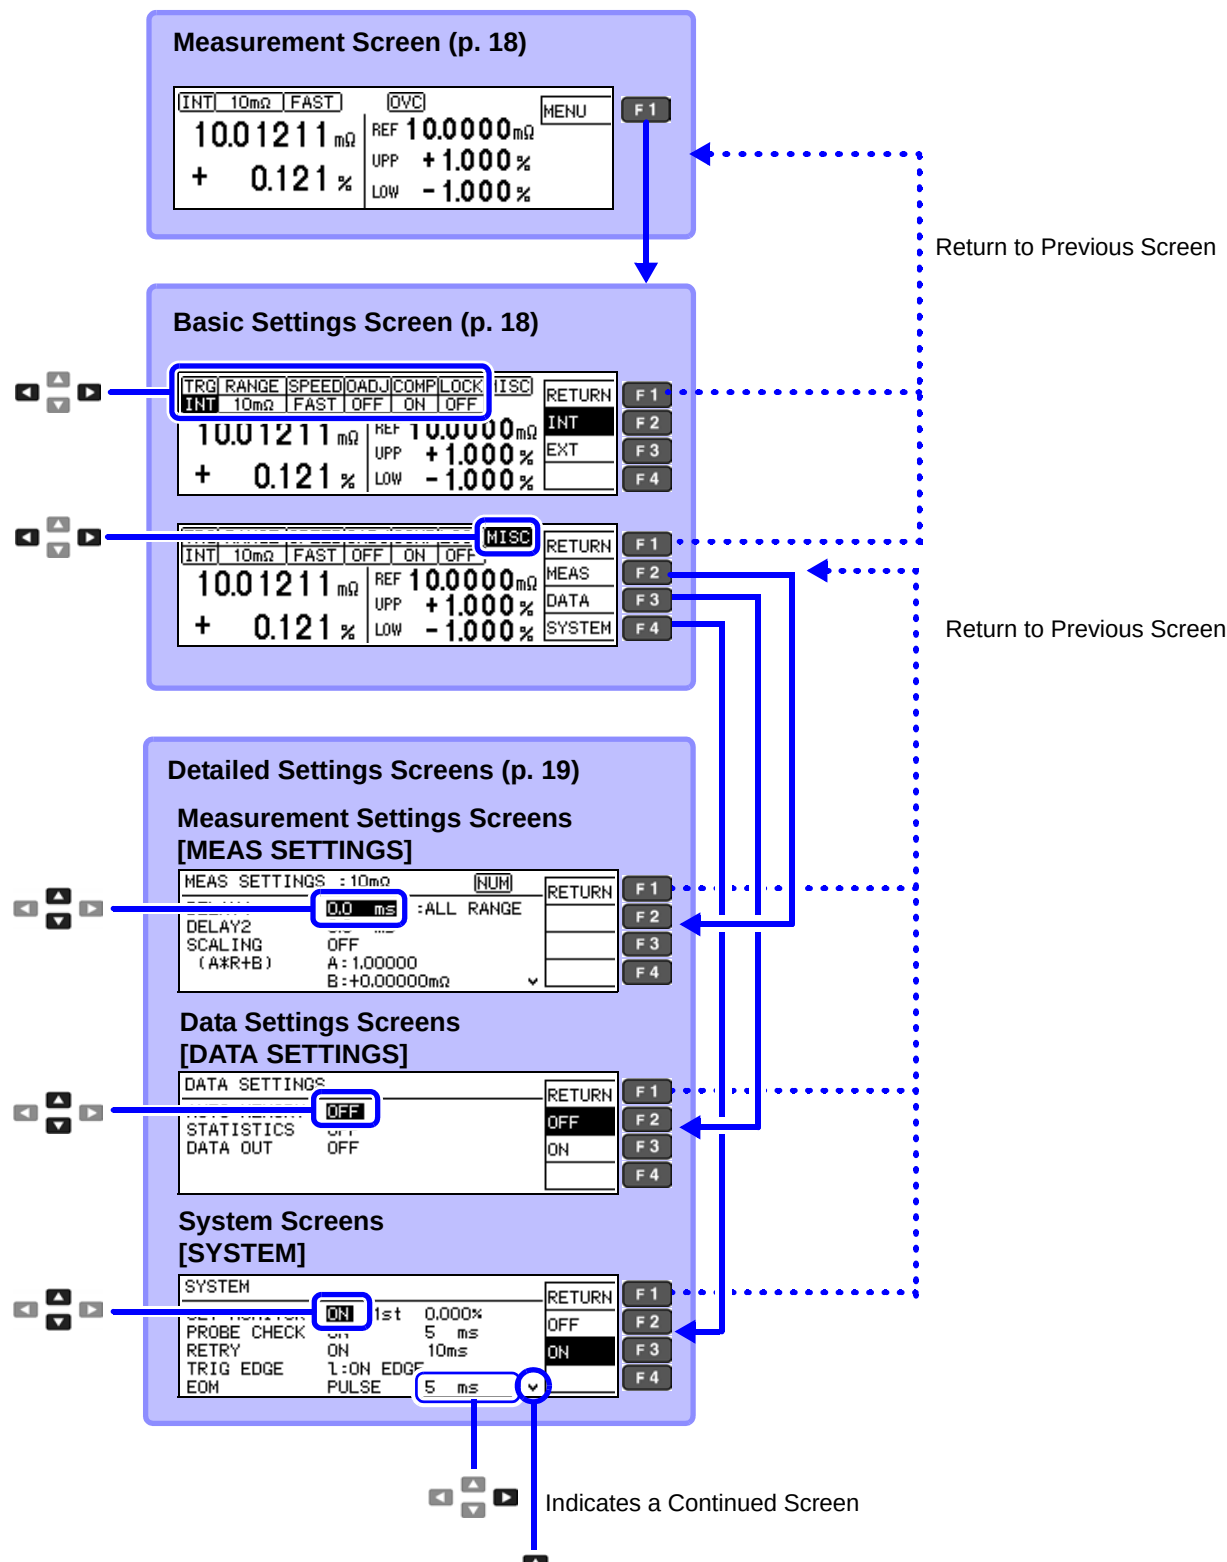

Measurement Screen

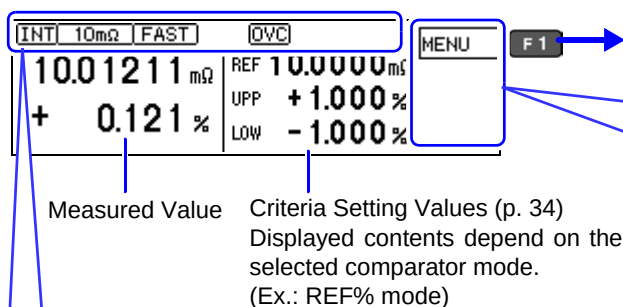

Measurement Conditions

Shows current setting contents. Displayed contents depend on the current settings.

INT/ EXT	Trigger source type (p. 30)
Ω	Measurement range (p. 31)
FAST/ MED/ SLOW	Measurement speed (p. 29)
0ADJ/ OFF (not shown)	Appears only when zero-adjust is enabled (p. 32)
OVC/ OFF (not shown)	(OVC: Offset Voltage Compensation) Appears only when OVC is enabled (p. 61)
SC/ OFF (not shown)	Appears only when the scaling function is enabled (p. 44)
NUM	Appears only when tenkey input is enabled
RMT	Remote control (p. 108)
M.LOCK	Disables all operations except comparator settings (p. 63)
F.LOCK	Disables all operations including comparator settings (p. 63)

This screen normally appears while measuring. View currently measured values and measurement conditions. Some parts of the display depend on the comparator mode and other settings.

To display the Basic Settings screen

Settings Menu (corresponding to F keys)


Displayed contents depend on the current function settings.

Parentheses () indicate the corresponding F-key

MENU (F1)	Displays the Basic Settings screen
PRINT (F2)	Print (p. 85) Appears only when the interface is set for the printer
STAT (F3)	Statistical calculation results (p. 78) Appears only when statistical calculation is enabled
NUMBER (F4)	Set Auto-Memory number (quantity) (p. 75) Displays the number of stored data items and the number of passed and failed products at the lower left.
UNDO (F3)	Deletes the previously stored measurement and calculation result (only one can be deleted) (p. 80) Appears only when calculation results are displayed
ALLCLR (F4)	Clears all memory and calculation (p. 80) Appears only when calculation results are displayed
LOCAL (F1)	Enables local control (p. 108)
UNLOCK (F1)	Cancels the key-lock state (hold 1s) (p. 64)

Basic Settings Screen

Return to previous screen

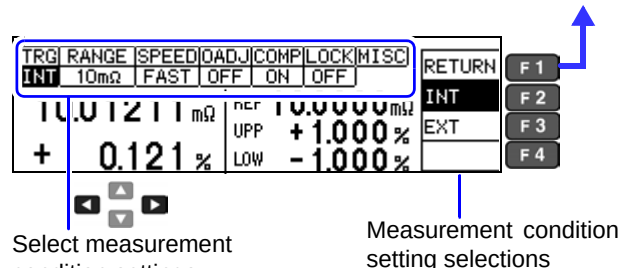

Select measurement condition settings
Move with cursor keys.

Measurement condition setting selections



Make basic measurement condition settings on this screen. Measurement speed and range can be changed while viewing measured values. (Trigger source: INT)

TRG	Change trigger source (measurement start control method) (p. 30) When EXT triggering is enabled, [MANU] appears beside the F4 key (press to trigger measurement manually).
RANGE	Change range (p. 31)
SPEED	Change measurement speed (p. 29)
0ADJ	Turn zero-adjust on/off (p. 32)
COMP	Turn comparator on/off (p. 34)
LOCK	Enable/disable key lock (p. 63)

MISC To display the Detailed Settings screen

To display the [MEAS SETTINGS] screen

To display the [DATA SETTINGS] screen

To display the [SYSTEM] screen

Detailed Settings Screens

Measurement Settings Screen
[MEAS SETTINGS]

MEAS SETTINGS : 10mΩ			RETURN
DELAY1	0.0 ms	:ALL RANGE	↑
DELAY2	0.0 ms		
SCALING (A*R+B)	OFF		
	A: 1.00000		
	B: +0.00000mΩ		

MEAS SETTINGS : 10mΩ			RETURN
AVERAGE	ON	16Times	OFF
CONT CHECK	ON	100Ω	
CONT IMP	ON	35mA	ON
VOLT MONITOR	ON	NORMAL	
CURRENT MODE	PULSE		

Shows detailed settings for measurements.

Adjust the measurement speed, stability and measurement fault detection functions.

DELAY1	Adjust the delay from probing to trigger input (p. 42)
DELAY2	Adjust measurement object electrical response (p. 42)
SCALING(A*R+B)	Correct measured values with the scaling function (p. 44)
INT (FAST/ MED/ SLOW)	Make fine adjustment to integration time (p. 46)
AVERAGE	Stabilize measured values with the averaging function (p. 48)
CONT CHECK	Contact check threshold setting (p. 49)
CONT IMP	Contact Improver function setting (p. 50)
VOLT MONITOR	Voltage level monitor function setting (p. 52)
CURRENT MODE	Current mode setting (p. 53)

Data Settings Screen
(Save, Analysis, and Output)
[DATA SETTINGS]

DATA SETTINGS		RETURN
AUTO MEMORY	OFF	OFF
STATISTICS	OFF	ON
DATA OUT	OFF	

These are settings for memory and statistical calculation functions.

AUTO MEMORY	Turn Auto-Memory on/off (p. 75)
STATISTICS	Statistical calculation on/off (p. 78)
DATA OUT	Automatically output measured values (communications) (p. 81)

System Screen
[SYSTEM]

SYSTEM		RETURN
SET MONITOR	OFF	OFF
PROBE CHECK	OFF	OFF
RETRY	ON 50ms	ON
TRIG EDGE	1:ON EDGE	
EOM	PULSE 5 ms	

Set instrument system-related settings on this screen.



SET MONITOR	Turn two-instrument setting comparison on/off (p. 56)
PROBE CHECK	Turn probe short-circuit detection on/off (p. 54)
RETRY	Retry function setting (p. 59)
TRIG EDGE	(External I/O) Set trigger rising/falling edge (p. 98)
EOM	(External I/O) Set $\overline{\text{EOM}}$ (end-of-measurement) signal (p. 97)
INTERFACE	Communications interface settings (p. 105)
100mΩ CURR	100 mΩ range measurement current settings 100 mA/1 A (p. 28)
CALIBRATION	Self-calibration operation settings (p. 60)
JUDGE BEEP	Comparator beeper settings (p. 66)
KEY BEEP	Key beeper on/off (p. 65)
CLOCK (Y-M-D)	Set internal clock (p. 68)
LINE FREQ	Set power source frequency (p. 67)
CONTRAST	Adjust screen contrast (p. 69)
BACKLIGHT	Adjust screen backlight (p. 70)
RESET	Initialize (p. 71)
ADJUST	Instrument Adjustment (p. A16)

Measurement Preparations

Chapter 2

2

Be sure to read the "Operating Precautions" (p.7) before installing and connecting this instrument. Refer to "Appendix 5 Rack Mounting" (p. A11) for rack mounting.

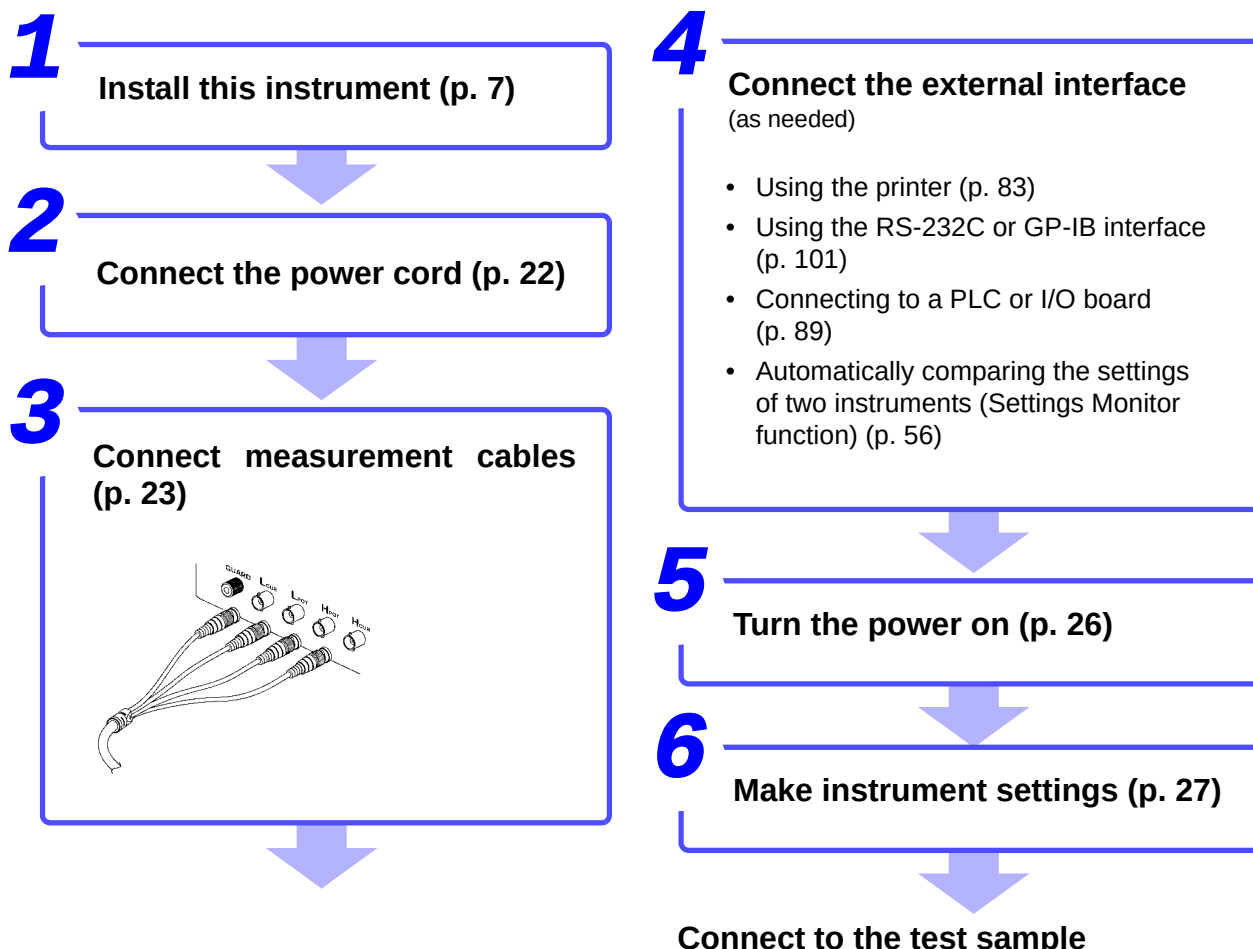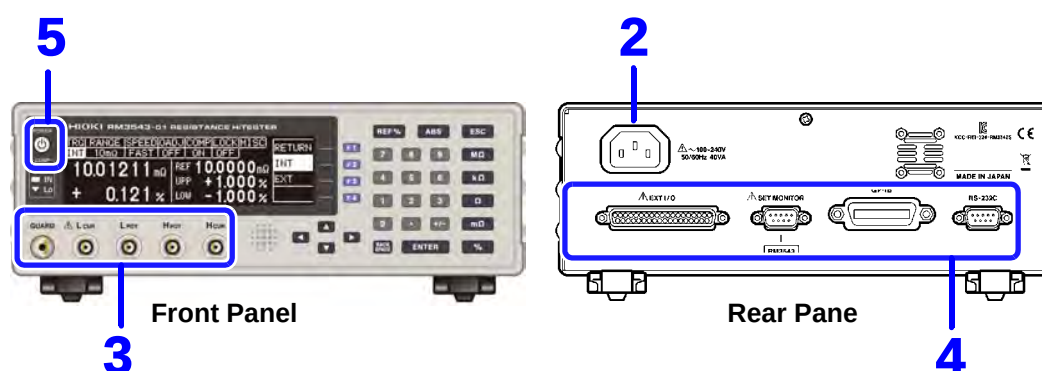

When finished measuring, turn the power off (p. 26)

2.1 Connecting the Power Cord




! WARNING

- Before turning the instrument on, make sure the supply voltage matches that indicated on its power connector. Connection to an improper supply voltage may damage the instrument and present an electrical hazard.
- To avoid electrical accidents and to maintain the safety specifications of this instrument, connect the power cord only to a 3-contact (two-conductor + ground) outlet.
- Before using the instrument, make sure that the insulation on the power cord is undamaged and that no bare conductors are improperly exposed. Any damage could cause electric shock, so contact your dealer or Hioki representative.


! CAUTION

To avoid damaging the power cord, grasp the plug, not the cord, when unplugging it from the power outlet.

Power inlet

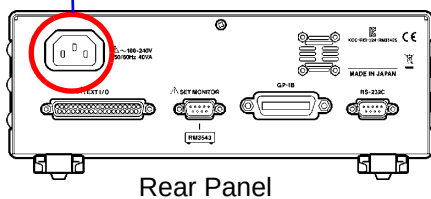

- 1** Confirm that the mains supply voltage matches the instrument, and connect the power cord to the power inlet on the instrument.

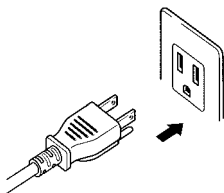

- 2** Plug the power cord into the mains outlet.

The **POWER** button on the front panel lights red.

In event of a power outage, operation resumes with the same settings when power is restored (breaker reset, etc.).

2.2 Connecting Measurement Cables and Test Fixtures




Connect your measurement cables, optional Hioki probes or test fixture to the measurement jacks. Refer to "Options" (p.4) for details. See the instructions provided with the fixture for operating details.

CAUTION

- Do not apply a voltage to the measurement terminals. Doing so may damage the unit.
- When disconnecting the BNC connector, be sure to release the lock before pulling off the connector. Forcibly pulling the connector without releasing the lock, or pulling on the cable, can damage the connector.

NOTE

- We recommend using optional Hioki fixtures.
- Use the GUARD jack only for Faraday shield, and avoid more than 10 mA current flow. This jack is not for guarding network resistance measurements.

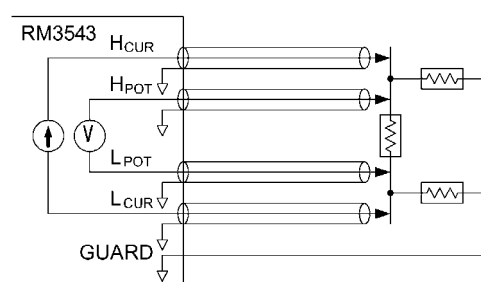


Example of defeated guard measurement

Connection Methods



Connecting measurement cables

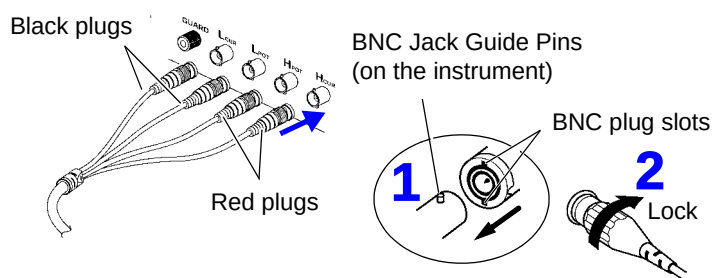


Connect the red plugs to the H_{CUR} and H_{POT} jacks, and the black plugs to the L_{CUR} and L_{POT} jacks.

Align the slots in the BNC plug with the guide pins on the jack on the instrument, then push and twist the plug clockwise until it locks.

Disconnecting BNC connectors
Push the BNC plug, twist it counterclockwise, and pull it out.

Connecting a fixture

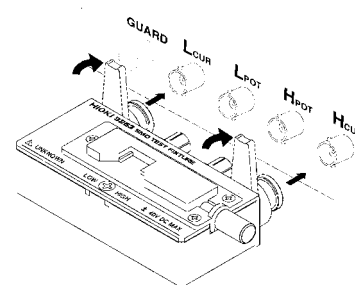

Connect directly to the measurement jacks with the label side up, and affix with the levers on the left and right.

Making your own probes and extenders (p. 24)

Making Your Own Measurement Cables


Recommended Measurement Cable Specifications

Conductor resistance	500 m Ω /m or less
Capacitance	150 pF/m or less
Cable dielectric material	Polyethylene (PE), Teflon* (TFE), polyethylene foam (PEF) Insulation resistance at least 10 G Ω
Connector insulating material	Teflon* (TFE), polybutylene terephthalate (PBT) Insulation resistance at least 10 G Ω
Length	2 m or less

Example: JIS standard 3C-2V, 1.5D-2V MIL standard RG-58A/U

* Teflon is a registered trademark of E. I. du Pont de Nemours and Company.

Wiring Diagram

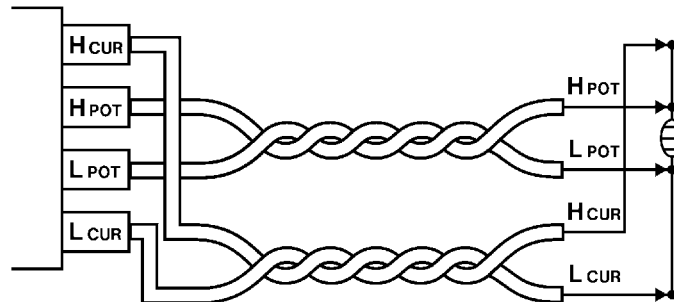

Before Wiring

See: "Appendix 3 Unstable Measurement Values" (p. A3)

- Twist together the H_{POT} and L_{POT} wires, and the H_{CUR} and L_{CUR} wires. If not twisted together, measured values may be unstable, and errors may occur, when measuring with low resistance values.
- The phenomenon of induction becomes pronounced in the 10 m Ω and 100 m Ω ranges (when the measurement current is set to 1 A). Changes in the cable position and configuration may cause measured values to vary. Exercise particular care so that the cable position and configuration do not change. Additionally, measurement cables and measurement targets should be kept as far as possible from metallic objects.
- When using two or more RM3543 units, do not group the wires from multiple instruments together. The "C.E. Volt" error display may be triggered by the phenomenon of induction.
- Refer to the block diagram (p. 14) for internal circuit details.
- Probes and measurement objects should be shielded at BNC or GUARD jack potential.
- Wiring resistance in excess of the following values may cause a current monitor error, making measurement impossible. When using measurement current 1 A ranges, keep the wiring resistance as well as the contact resistance between the DUT and probe low.

Range	10m Ω	100m Ω	100m Ω	1000m Ω	10 Ω	100 Ω	1000 Ω
Measurement Current	1 A	1 A	100 mA	100 mA	10 mA	10 mA	1 mA
Between H _{CUR} and DUT	1 Ω	1 Ω	18 Ω	18 Ω	180 Ω	180 Ω	1.8 k Ω
Between L _{CUR} and DUT	1 Ω	1 Ω	8 Ω	8 Ω	80 Ω	80 Ω	800 Ω


Extending Measurement Cables

Observe the following when extending measurement cables:

- Measurement cable length should not exceed 2 m (with conductor resistance 500 mΩ/m or less). Long cables are more susceptible to noise, and measured values may be unstable.
- Extensions should maintain the four-terminal structure. If converted to a two-terminal circuit in the wiring, correct measurement may not be possible due to the effects of wiring and contact resistance.
- Cables and measurement objects should be shielded.
- After extending measurement cables, confirm operation and accuracy ("Measurement Specifications" (p.180)).
- If cutting the ends off of optional measurement cables, make sure that the shield does not touch the center conductor of the H_{CUR} , H_{POT} , L_{POT} and L_{CUR} cables. Correct measurement is not possible with a shorted cable.
- Do not twist wires from multiple units together.

2.3 Turning the Power On and Off

Turning Power On

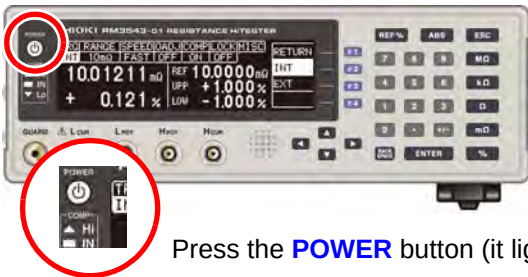


Press the **POWER** button (it lights green).

After Power-On

A self-test (instrument diagnostic routine) is performed.

During the self-test, the following information is displayed while the hardware is verified.

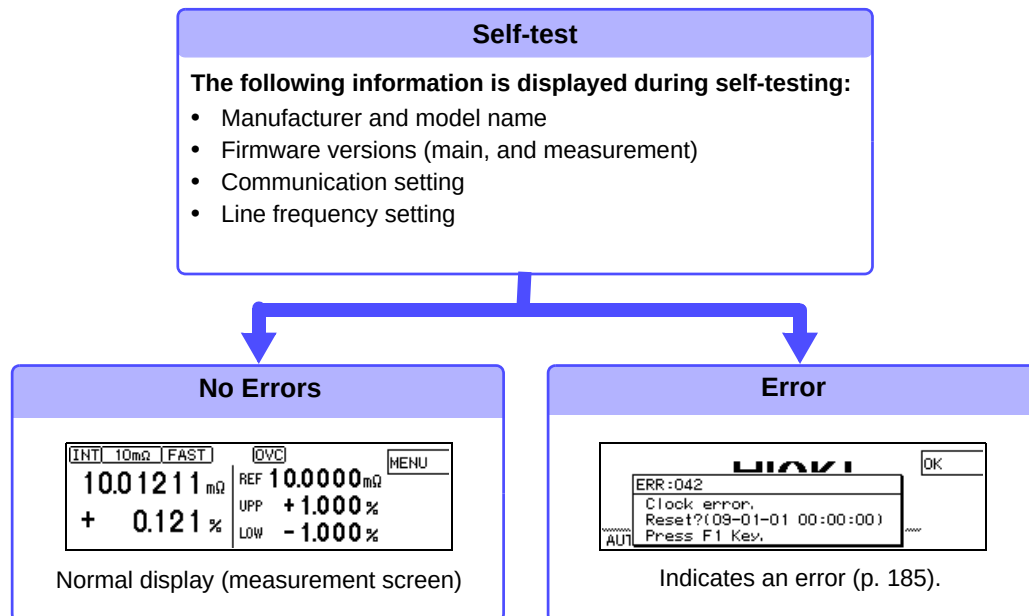

When the power is turned on, the same setting as when the power was last turned off appears (backup function).

When powered up for the first time, the default settings appear.

See: "Default Settings" (p.72)

Before Starting Measurement

To obtain precise measurements, provide about 30 minutes warm-up after turning power on. Measurement settings are recalled from when the power was previously turned off (settings backup).

However, measurement settings made through the RS-232C or GP-IB interface are not retained, although they can be stored using the **:SYSTem:BACKup** command (p. 139).

Turning Power Off

Press the **POWER** button (it lights red when the instrument is off).

Disconnect the power cord from the outlet to extinguish the **POWER** button light.

When power is turned on again, operation resumes with the same settings as when last turned off.

NOTE

If a power outage (e.g., breaker trip) occurs when the instrument is on, it will automatically turn on again when power is restored (without pressing the **POWER** button).

Measurement Settings (Basic Measurements)

Chapter 3

3

See "Measurement Flow" (p. 2) for an outline of the measurement process from preparation to end-of-measurement.

3.1 Pre-Operation Inspection

Before using the instrument for the first time, verify that it operates normally to ensure that no damage occurred during storage or shipping. If you find any damage, contact your dealer or Hioki representative.

1 Peripheral Device Inspection

Is the power cord insulation torn, or is any metal exposed?

Metal Exposed

Do not use the instrument if damage is found, as electric shock or short-circuit accidents could result. Contact your dealer or Hioki representative.

No Metal Exposed

Is the insulation on a measurement cable torn, or is any metal exposed?

Metal Exposed

If there is any damage, measured values may be unstable and measurement errors may occur. Replace the cable with an undamaged one.

No Metal Exposed

2 Instrument Inspection

Is damage to the instrument evident?

Yes

If damage is evident, request repairs.

No

When turning power on

Does the self-test screen appear (model no., version no.)? (p. 26)

No

The power cord may be damaged, or the instrument may be damaged internally. Request repairs.

Yes

Does the Measurement screen appear after self-test?

An error indication occurs (ERR)

The instrument may be damaged internally. Request repairs.
See: "11.1 Troubleshooting" (p. 183)
"11.3 Error Displays and Remedies" (p. 185)

Yes

Inspection complete

Please read the "Operating Precautions" (p. 7) before use.

3.2 Switching 100 mΩ range Measurement Currents

The 100 mΩ range measurement current can be switched between 100 mA and 1 A. The 100 mA setting (which is the factory default) allows measurement at a high level of precision. The 1 A setting can be used to provide better resistance to external noise.

See: "(5) DUT Becomes Warm" (p. A6)

(Example) If the resistance to be measured is 100 mΩ

(Measurement Current)

100 mA $100 \text{ m} \times 0.1^2 = 1 \text{ mW}$

1 A $100 \text{ m} \times 1^2 = 100 \text{ mW}$


To achieve more precise measurement

Measurement Current: 100 mA

To limit the effects of external noise


Measurement Current: 1 A

1 Open the Basic Settings screen.

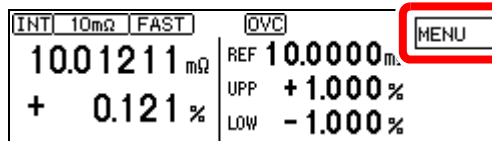


The Basic Settings screen appears.

2 Open the System screen.

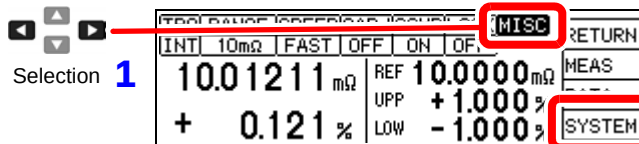

The System screen appears. [SYSTEM]


3 Select the 100 mΩ range measurement current.

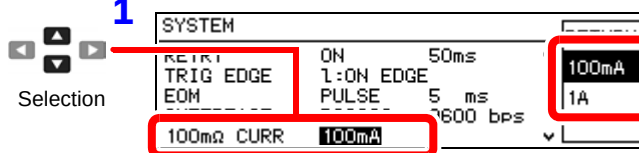


100 mA (default)

1 A

4 Return to the Measurement screen.

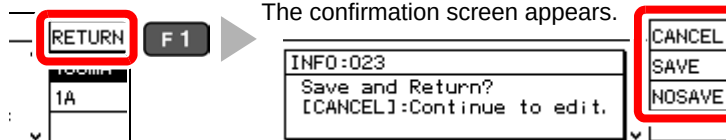

The confirmation screen appears.

 

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

NOTE

- The 100 mΩ range measurement condition settings are configured separately for each measurement current. Consequently, the 100 mΩ range measurement condition settings should be configured after first setting the measurement current.
- During measurement, a transient current equal to about 1.5 times the steady-state current will flow for several microseconds (or about 10 mApk in the 1 kΩ range). Exercise special care when measuring targets


3.3 Setting the Measurement Speed

The measurement speed can be set to FAST, MED (medium), or SLOW. A slower measurement speed provides greater measurement precision, and a faster measurement speed results in greater susceptibility to environmental noise. Ensure that measurement cables and the sample are sufficiently shielded.

NOTE


The averaging function can be used to further stabilize measured values. (p. 48)

1 Open the Basic Settings screen.

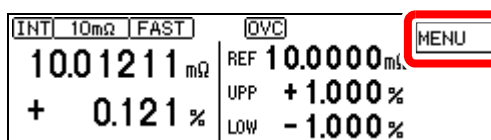


The Basic Settings screen appears.

2 Select the measurement speed.

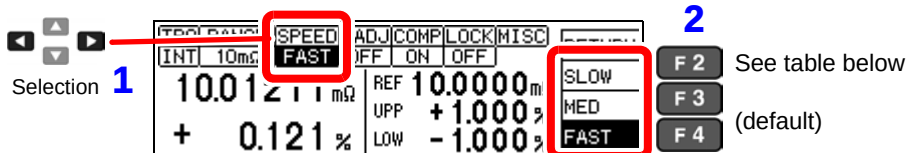

Press the up/down cursor keys to change the setting.

3 Return to the Measurement screen.

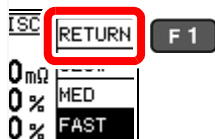

Relationship Between Measurement Range and Speed

(factory defaults)

Measurement Range	FAST	MED	SLOW
10mΩ Average: 16 times ^{*1}	176 ms	272 ms	752 ms 640 ms
10mΩ	11 ms	17 ms	47 ms 40 ms
100mΩ (1A)	5.0 ms	13 ms	43 ms 36 ms
100mΩ (100mA)	3.8 ms	13 ms	43 ms 36 ms
1000mΩ	2.0 ms	6.4 ms	41 ms 35 ms
10Ω	1.6 ms	6.0 ms	41 ms 34 ms
100Ω	1.6 ms	4.0 ms	41 ms 34 ms
1000Ω	1.6 ms	4.0 ms	41 ms 34 ms

Integration time can be optionally set for each range (p. 46).

Upper value: for 50-Hz power line frequency

Lower value: for 60-Hz power line frequency

Tolerance: $\pm 10\% \pm 0.2$ ms

(Without retry)

^{*1} When performing external trigger measurement.
When performing internal trigger measurement, same as when averaging is off.

3.4 Setting Measurement Start Conditions (Trigger Source)

Measurements can be started in two ways.

To measure automatically

Measure with internal (INT) triggering

Trigger signals are automatically generated internally for continuous measurement.

To measure at specific times
To retain measured values

Measure with external (EXT) triggering


Measurements are triggered by an external signal.
Manual measurement triggering is also available.

- Apply a trigger signal at the EXT I/O connector (p. 89)
- Send the *TRG command by communications interface (p. 130)
- Press F4 [MANU] (only appears when EXT is selected)

NOTE


- When internal triggering is enabled, the EXT I/O TRIG signal and the "*TRG" command are ignored (except for memory storage and statistical calculations).
- When using the internal trigger, the delay time (DELAY1) is obtained by adding 100 ms to the setting (to prevent heat generation).
- To measure samples such as inductors that require time to settle, adjust delay time DELAY2. Start with a long delay, and gradually shorten it while watching for the measured value to settle.
See: "4.2 Setting Pre-Measurement Delay" (p. 42)
- When external triggering is enabled, the Auto-Memory function is disabled by force.

1 Open the Basic Settings screen.

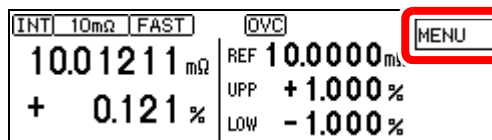

The Basic Settings screen appears.

2 Select internal (INT) or external (EXT) triggering.

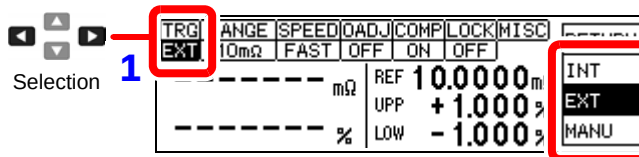

Press F3 [EXT] to display the F4 [MANU] indicator.
Press to trigger a measurement manually.

2

F2 Internal trigger
F3 External trigger (default)

Press the up/down cursor keys to change the setting.

3 Return to the Measurement screen.



Continuous measurement (: INITIATE : CONTINUOUS ON) is the normal trigger state when operating from the front panel. Selecting the internal (INT) trigger source activates continuous triggering ("free-run"). When external (EXT) triggering is selected, each external trigger event initiates one measurement. Continuous measurement can be disabled by sending the : INITIATE : CONTINUOUS OFF command via RS-232C or GPIB. When continuous measurement is disabled, trigger acceptance is controlled only by the host (computer or PLC).

3.5 Selecting the Measurement Range

The measurement range can be set as follows. When making comparator settings with the panel keys, the measurement range is selected automatically according to the settings (reference/tolerance or upper/lower thresholds, see the following table). When the comparator settings are made by remote control commands, the measurement range is unaffected.

Changing the Range


Measurement error is larger when measuring values nearer the bottom of a measurement range.

Auto-Ranging (when making comparator settings)

Reference (REF%) and Upper/Lower Threshold (ABS) Ranges	Selected Range
0 to 10.009 mΩ	10 mΩ
10.01 to 100.09 mΩ	100 mΩ
100.1 to 1000.9 mΩ	1000 mΩ
1.001 to 10.009 Ω	10 Ω
10.01 to 100.09 Ω	100 Ω
100.1 to 1200.0 Ω	1000 Ω


Manual Range Selection

1 Open the Basic Settings screen.

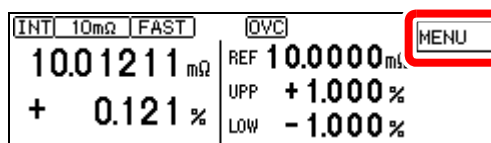

The Basic Settings screen appears.


2 Select the range.

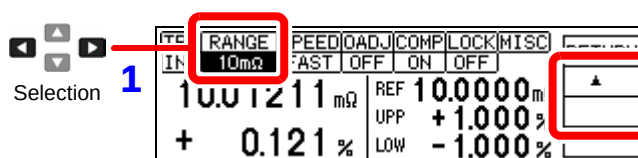


- 10mΩ, 100mΩ, 1000mΩ, 10Ω, 100Ω, 1000Ω (default)

2

F2
F3
Increments the range
Decrements the range

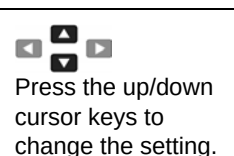

3 Return to the Measurement screen.

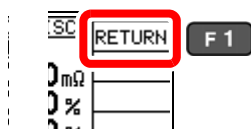

NOTE

- The measurement range is automatically selected when using the comparator function, but an OvrRng error may occur when the scaling function is on. If this occurs, set an appropriate range manually. For example, the 1,000 mΩ range will be selected under the following conditions, but the measurement target of 2 Ω will result in an OvrRng error:
 Measurement target: 2 Ω
 Scaling compensation coefficient: 0.5
 Displayed measured value: 1 Ω
 Comparator reference value: 1 Ω
- During measurement, a transient current equal to about 1.5 times the steady-state current will flow for several microseconds (or about 10 mApk in the 1 kΩ range). Exercise special care when measuring targets

3.6 Zero Adjustment

When four-terminal measurement (Kelvin connection) is impractical such as when measuring very small samples, the additional inherent resistance of the two-terminal wiring should be canceled out. The zero-adjustment function can cancel out up to 10 Ω additional resistance.

NOTE

Before Zero Adjustment


- The guaranteed accuracy of the instrument applies to four-terminal connections without zero adjustment. When using four-terminal connections, do not execute zero adjustment. Executing zero adjustment with incorrect wiring may amplify measurement error. However, zero adjustment may be needed even with four-terminal measurements if they are affected by a large offset voltage, such as due to thermal emf.
- Execute zero adjustment when the ambient temperature has changed, or when a probe is replaced.

Execute zero adjustment after the warm-up period following power on.

1 Open the Basic Settings screen.



2 Select the internal (INT) trigger mode.

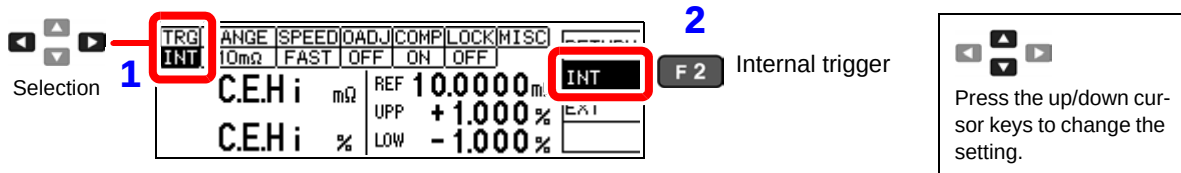

3 Short the probes together.



4 Confirm that the measured value does not exceed 10 Ω .


If no measured value is displayed, increment the measurement range (p. 31).

5 Select whether to enable or disable zero adjustment.



After confirming that the measured value does not exceed 10 Ω , execute zero adjustment.

6 Return to the Measurement screen.

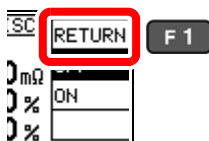

Zero Adjustment Faults

If zero adjustment fails, the following error message appears.



- Before attempting zero adjustment again, confirm the following:
- With the 10 Ω range selected, confirm that the displayed value does not exceed 10 Ω.
 - Confirm that the probe connections are correct.

NOTE

When the scaling calculation function is on, you may be unable to zero out the measured value, even if you perform zero adjustment (because the zero-adjusted measured value is still subject to scaling calculation).


3.7 Judging Measured Values (Comparator Function)

Comparator results are available as external output (at the EXT I/O connector) when the comparator reference/tolerance or upper/lower threshold values have been set.

See: "Chapter 8 External Control" (p. 89)

Comparator results are also indicated by the COMP Hi/IN/Lo panel lamps, and by audible beeper (disabled by default).

See: "Setting the Comparator Decision ("JUDGE") Beeper" (p. 66)

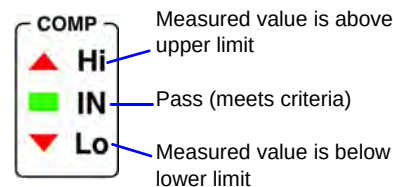

The comparator decision mode can be set as one of the following:

Decide whether a measured value is within specified tolerance limits relative to a specified reference value (p. 35)



Select the REF% (relative values) decision mode

REF%

 
example

12.000 mΩ reference value
+0.080% positive tolerance
-0.080% negative tolerance

Positive tolerance [%]

Reference value [Ω]

Negative tolerance [%]



Decide whether a measured value is between specified upper and lower threshold values (absolute values) (p. 37)



Select the ABS (absolute values) decision mode

ABS

example

100.00 mΩ upper threshold
80.00 mΩ lower threshold

Upper threshold [Ω]

Lower threshold [Ω]



Before Using the Comparator Function

- When the measured value is out of the selected measurement range, comparator decision indicators appear as follows. In the event of a measurement fault, no decision is made.

See: "3.8 Confirming Faulty Measurements" (p. 38)


Out-of-Range Display	Comparator Decision Indicator
+OvrRng	Hi
-OvrRng	Lo

- If power is turned off during comparator setting, changes to settings are lost as they revert to their previous values. To accept the settings, press the **ENTER** key.
- When setting comparator criteria, the appropriate range is selected automatically. Refer to "Auto-Ranging (when making comparator settings)" (p. 31) for range settings.

Enabling and Disabling the Comparator Function


The comparator function is enabled by default.
When the function is disabled, comparator settings are ignored.

1 Open the Basic Settings screen.

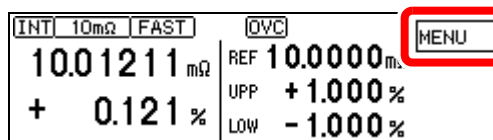


The Basic Settings screen appears.

2 Enable or disable the comparator function.

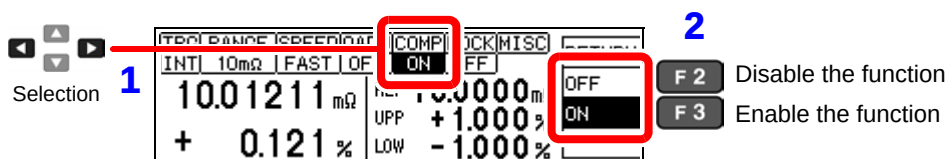

3 Return to the Measurement screen.

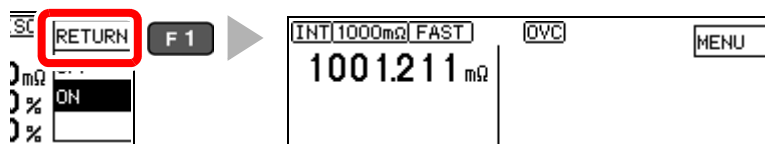

(When the function is disabled)
Comparator decisions are indicated only when the function is enabled.

Decide According to Reference Value and Tolerance (REF% Mode)


$$\text{Relative Value (tolerance)} = \left(\frac{\text{Measured Value}}{\text{Reference Value}} - 1 \right) \times 100 [\%]$$

Setting range:
-9.999% to +9.999% (When 10% or less)
-99.99% to +99.99% (When more than 10%)

Example: Set a reference value of 10.5 $\mu\Omega$ with $\pm 4.5\%$ decision tolerance.

To abort the setting process, press **ESC**. Settings are abandoned and the display returns to the previous screen.


1 Open the relative tolerance setting screen.

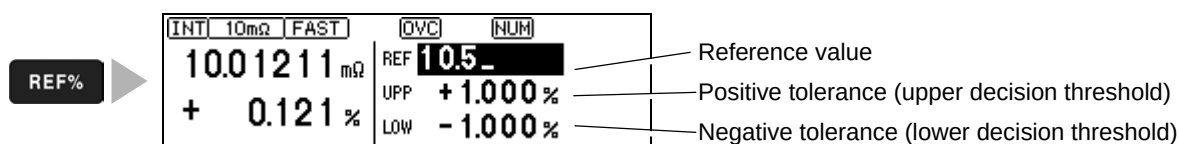


3.7 Judging Measured Values (Comparator Function)

2 Set the reference value.

Pressing an inoperative key during setting sounds a low-pitch beep (when the key beeper is enabled).

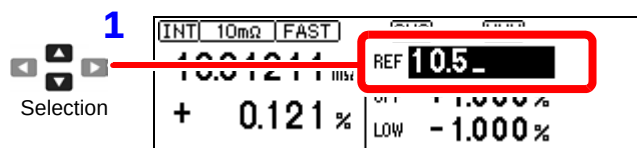

(Example: 10.5mΩ)

 


To Reset Numerical Values

BACK SPACE Deletes entered digits. This key is enabled only when entering numerical values.

To change the value after selecting the units, use the cursor $\blacktriangle$ $\blacktriangledown$ keys to select the item to change, then enter the new value with the tenkeys.

Press the units key to accept the setting and move the cursor to the positive tolerance.

3 Set the positive tolerance.

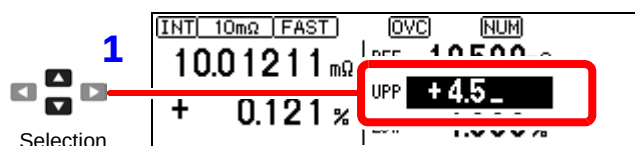

(Example: 4.5%)



To Reset Numerical Values

BACK SPACE Deletes entered digits. This key is enabled only when entering numerical values.

To change the value after selecting the units, use the cursor $\blacktriangle$ $\blacktriangledown$ keys to select the item to change, then enter the new value with the tenkeys.


To Set a Negative Value

+/- Press this key to change the sign, as needed.


Press the % key to accept the setting and move the cursor to the negative tolerance value.

The negative tolerance is initially set to the same amplitude as the positive tolerance (change as needed).

4 Set the negative tolerance in the same way (as needed).

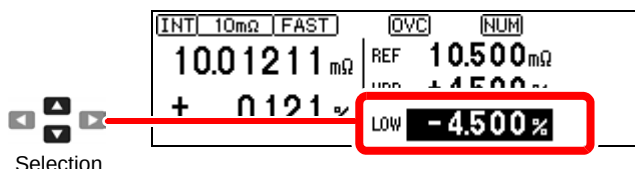

5 Accept the settings and return to the Measurement screen.

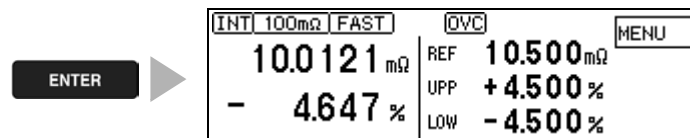

NOTE

- Internal calculations are performed on floating-point values, and decisions round up any fraction of the least-significant digit.
- Displayed values of the reference and tolerances are rounded according to the selected range. Internal calculations use unrounded data, so decisions are based on the entered (setting) values.
- An error message appears if you press **ENTER** with the positive tolerance set lower than the negative tolerance.


See: "11.3 Error Displays and Remedies" (p. 185) (ERR:001)

Decide According to Upper/Lower Thresholds (ABS Mode)

Setting example: Upper threshold 150 mΩ, lower threshold 50 mΩ


To abort the setting process, press **ESC**. Settings are abandoned and the display returns to the previous screen.

1 Open the absolute value threshold setting screen.

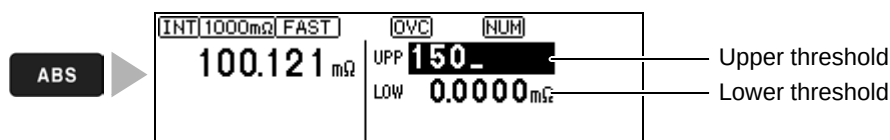


2 Set the positive tolerance.

Pressing an inoperative key during setting sounds a low-pitch beep (when the key beeper is enabled). No error message is displayed.

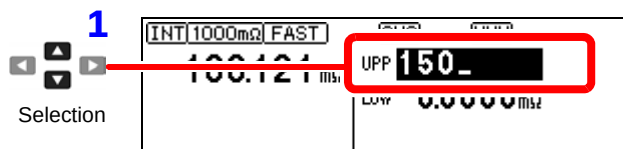

(Example: 150 mΩ)

 


To Reset Numerical Values

BACK SPACE Deletes entered digits. This key is enabled only when entering numerical values.


To change the value after selecting the units, use the cursor **▲▼** keys to select the item to change, then enter the new value with the tenkeys.

Press the units key to accept the setting and move the cursor to the lower threshold value.

3 Set the negative tolerance in the same way.

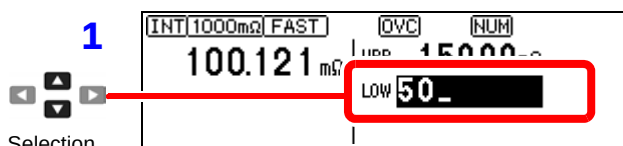


(Example: 50 mΩ)

 

Press the units key to accept the setting and move the cursor to the upper threshold.

4 Accept the settings and return to the Measurement screen.

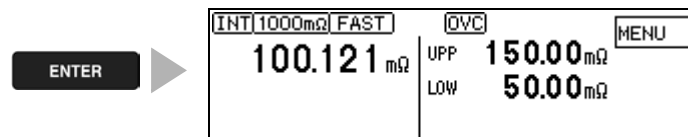

NOTE

- Internal calculations are performed on floating-point values, and decisions round up any fraction of the least-significant digit.
- Displayed values of the reference and tolerances are rounded according to the selected range. Internal calculations use unrounded data, so decisions are based on the entered (setting) values.
- An error message appears if you press **ENTER** with the positive tolerance set lower than the negative tolerance.

See: "11.3 Error Displays and Remedies" (p. 185) (ERR:001)

3.8 Confirming Faulty Measurements

When a measurement is not performed correctly, a measurement fault indicator appears and a measurement fault signal is output at the **ERR** pin of the EXT I/O connector (except for out-of-range detection).

The instrument detects measurement faults by the following four methods.

Out-of-Range

See: "Out-of-Range Detection Function" (p. 39)

Display

+OvrRng
-OvrRng

Appears when the measured value is outside of the measurement or display range.
Check for a broken sample component.
The comparator result is Hi when +OvrRng is displayed, and Lo when -OvrRng is displayed.
No external measurement fault signal (ERR) is output.

Contact Check Fault

See: "4.6 Checking for Poor or Improper Contact (Contact Check Function)" (p. 49)

Display

C.E. Hi
C.E. Lo

The resistance between the H_{POT} and H_{CUR} probe contacts, and between the L_{POT} and L_{CUR} probe contacts, are measured and compared with specified contact fault values.
An error message appears when the measured value reaches or exceeds the specified contact fault values.
If this error persists, probe wear or cable failure may be the cause.
If the error is not cleared by shorting the tips of a known-good measurement cable, the instrument requires repair.

Voltage Level Monitor Fault

See: "4.8 Detecting Measurement Voltage Faults (Voltage Level Monitor Function)" (p. 52)

Display

C.E. Volt

This method monitors the stability of the voltage between H_{POT} and L_{POT} probe contacts.
An error message appears when voltage instability is detected due to chattering of the probe contacts.
If this error persists, the probes may be degraded due to wear.
C.E. Volt may also be displayed when external noise is strong.

Current Monitor Fault

See: "Current Monitor Function" (p. 39)

This method monitors the regulated measurement current for normal flow through the DUT.
An error is detected mainly when a measurement fault occurs due to an open-circuit DUT or between the H_{CUR} and L_{CUR} probe's poor contacts.
The error display depends on the contact check and voltage level monitor states (see the table below).

.....


This display appears after changing measurement settings and before the next measurement is performed.

Display Examples: Display Measurement State and Appearance with Open-Circuit Probe

Display Measurement State		Current Monitor Results	
		Normal (PASS)	Fault (FAIL)
Contact Check Results	Normal (PASS)	Display: Measured Value COMP indicator: According to the measured value	Display: +OvrRng COMP indicator: Hi (when connection to the measurement object is broken)
Voltage Level Monitor Results	Fault (FAIL)	Display: C.E. Hi/ C.E. Lo/ C.E. Volt COMP indicator: No decision EXT I/O: ERR signal output	Display: C.E. Hi/ C.E. Lo/ C.E. Volt COMP indicator: No decision EXT I/O: ERR signal output

The measurement fault display differs according to detection order and settings.

Measurement Fault Detection Order

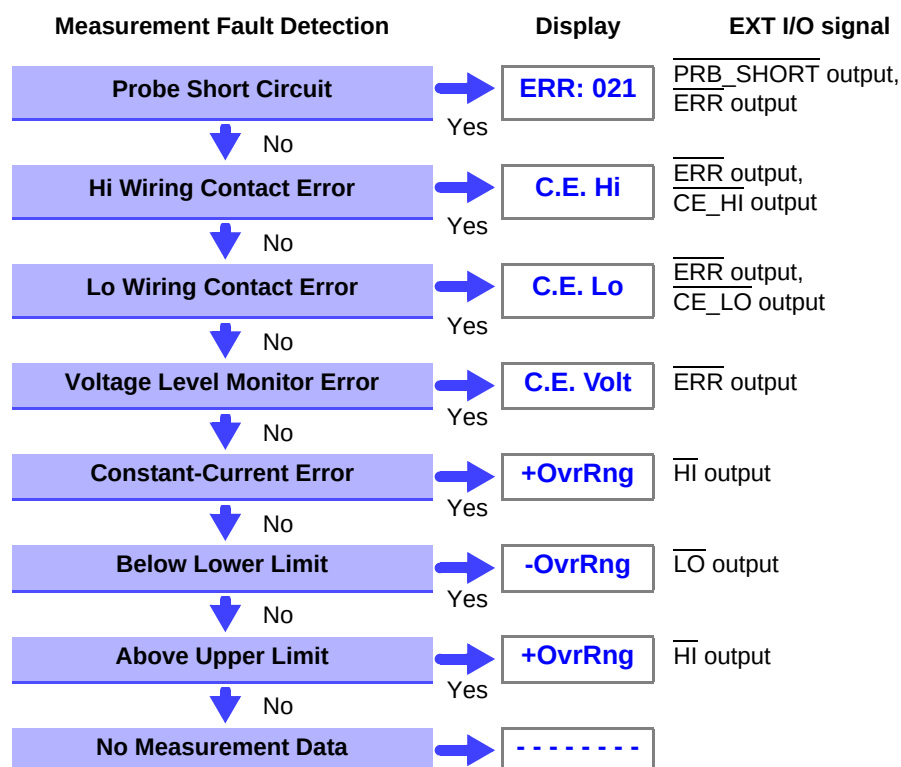**NOTE**

Measurement fault detection proceeds in the order shown at the left, ending with display of the first detected error.

Corresponding measurement fault signals are also output at the EXT I/O connector.

3

Out-of-Range Detection Function

Examples of Out-of-Range Faults

Out-of-Range Detection	Measurement Example
The measured value is outside of the measurement range.	Attempting to measure 13 Ω with the 10 Ω range selected
The relative tolerance (%) display of the measured value exceeds the display range (999.999%).	Measuring 500 Ω (+2400%) with a reference value of 20 Ω
The zero-adjusted value is outside of the display range.	In the 1000 m Ω range with 0.5 Ω zero-adjustment in effect, measuring 0.1 Ω provides a zero-adjusted value of -0.4 Ω , which is outside of the display range.
While measuring, input voltage exceed the A/D converter input range.	Measuring a large resistance value in an electrically noisy environment

Current Monitor Function

- The instrument supplies constant measurement current through the DUT via the H_{CUR} and L_{CUR} probes. A current monitor fault occurs if constant current cannot be attained. If the contact check and voltage level monitor results are normal, the out-of-range and comparator result displays indicate "Hi".
- Wiring resistance in excess of the following values may cause a current monitor error, making measurement impossible. When using measurement current 1 A ranges, keep the wiring resistance as well as the contact resistance between the DUT and probe low.

Range	10m Ω	100m Ω	100m Ω	1000m Ω	10 Ω	100 Ω	1000 Ω
Measurement Current	1 A	1 A	100 mA	100 mA	10 mA	10 mA	1 mA
Between H _{CUR} and DUT	1 Ω	1 Ω	18 Ω	18 Ω	180 Ω	180 Ω	1.8 k Ω
Between L _{CUR} and DUT	1 Ω	1 Ω	8 Ω	8 Ω	80 Ω	80 Ω	800 Ω

Example of Current Monitor Fault

- Broken DUT (open work)
- H_{CUR} or L_{CUR} probe contact fault

Customizing Measurement Settings

Chapter 4

(set as needed)

Change measurement settings as appropriate for your application.
Refer to "Detailed Settings Screens" (p. 19) for the available settings.

4

4.1 Making Range-Specific Measurement Settings

These settings can be made for each range (except for the DELAY1 setting).

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OVC	MENU
10.01211 mΩ		REF 10.0000 m		
+ 0.121 %		UPP +1.000 %		
		LOW -1.000 %		

F 1

The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

Selection 1

INT	10mΩ	FAST	OFF	ON	OFF	MISC	DETAILS
10.01211 mΩ		REF 10.0000 m		MEAS		DATA	
+ 0.121 %		UPP +1.000 %		SYSTEM			
		LOW -1.000 %					

2

F 2

The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Select the range to use.

Selection 1

DELAY1	0.0	ms	ALL RANGE	+
DELAY2	0.0	ms		
SCALING	OFF			
(A*R+B)	A: 1.00000			
	B: +0.00000mΩ			

F 2

F 3

2

4 Set the items as needed.

NOTE

The 100 mΩ range measurement condition settings are configured separately for each measurement current. Consequently, the 100 mΩ range measurement condition settings should be configured after first setting the measurement current (p. 28).

4.2 Setting Pre-Measurement Delay

This setting specifies the delay between trigger signal input and the start of measurement. Adjust this setting to delay measurement until the measured value has time to stabilize, so that even if the sample is connected after triggering, measurement starts only after the specified delay. The delay can be set by two methods, as follows.

Adjust this setting to allow for probe contact mechanical stabilization.

Set DELAY1


The DELAY1 setting is common to all ranges. The default setting is 0 ms (corresponding to trigger signal input at the same time as probe contacts become stable). Setting DELAY1 affects measurements in all ranges.

Adjust this setting to allow for stabilization of the measurement sample.

Set DELAY2

Set DELAY2 to the time needed for stabilization after measurement current is applied, such as may be required for inductive components. The setting affects only the selected range. The default setting is 0 ms (corresponding to resistance measurement of non-inductive components).

DELAY1 and DELAY2 Timing Chart

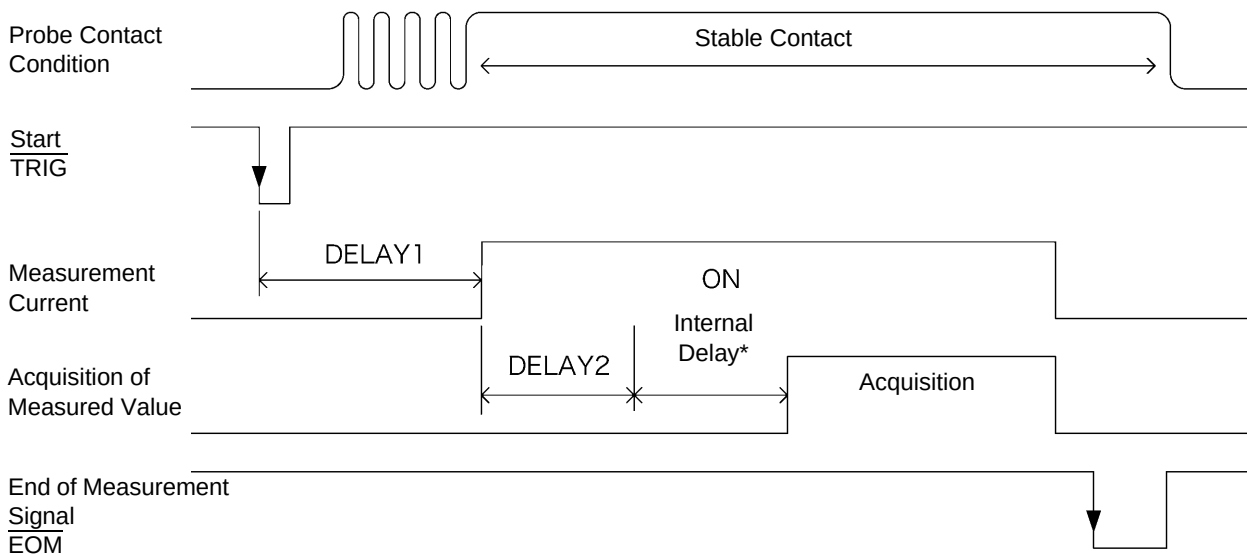

* Internal delay is provided to suit purely resistive (non-reactive) DUTs, and is different for each measurement range.

Determining the Delay Time

Set the delay so that inductance does not affect measurements.

To fine tune the delay, begin with a longer delay than necessary, then gradually shorten it while watching the measured value.

1 Open the Basic Settings screen.

F1 ► The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

2 F2 ► The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Set DELAY1 or DELAY2.

Tenkeys

DELAY1 is common to all ranges, while DELAY2 can be set for each range independently (p. 41).

2 0 9 / . Setting range: 0.0 ms (default) to 100.0 ms

3 ENTER

4 Return to the Measurement screen.

F1 ► The confirmation screen appears

F1 Return to the setting screen.
F2 Save setting and return to previous screen.
F3 Discard setting and return to previous screen.

NOTE

When using the internal trigger, the delay time (DELAY1) is obtained by adding 100 ms to the setting (to prevent heat generation).

4.3 Correcting Measured Values (Scaling Function)

When measuring the resistance of current sensing resistors, there may be a discrepancy between the resistance value at the time of mounting on the board being used and the resistance value obtained when measuring the component alone (due to the effects of the probing location and other factors). The scaling function corrects the resistance measured value obtained from the component alone to yield the resistance value during actual use. Scaling is performed by means of the following equations:

$$R_s = A \times R + B$$

R : Measured value before compensation


R_s : Resistance value after compensation

A : Compensation coefficient Setting range: 0.50000 to 2.00000 (default: 1.00000)

B : Offset resistance value Setting range: ±10% of full scale for each range
(default: 0 mΩ)

See: "Appendix 4 Effects of Probing" (p. A9)


1 Open the Basic Settings screen.

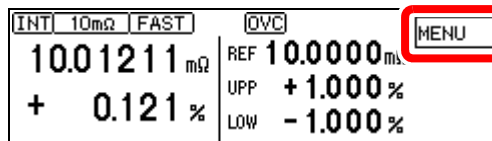

F1

The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

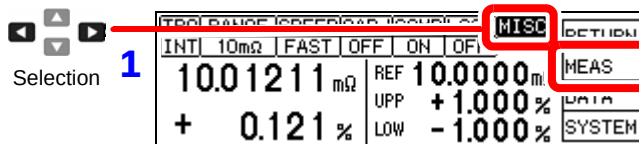


Selection

2

F2

The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Enable the scaling function.

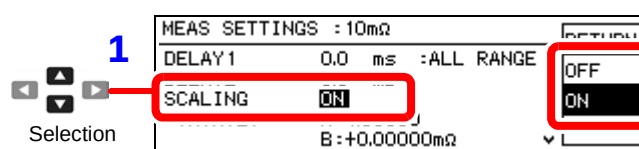

Selection


2

Disables the function (default)
(go to step 6)

Enables the function

The setting is specific to the selected range
(p. 41)

4 Set the compensation coefficient.

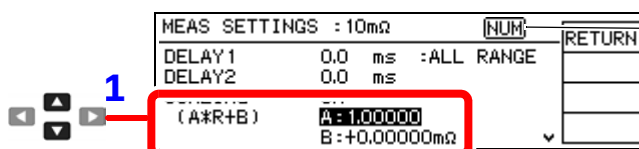

Selection

Tenkeys

2

0 ... 9

Setting range: 0.50000 to 2.00000 (default: 1.00000)

3

ENTER

5 Set the offset.

MEAS SETTINGS : 10mΩ

NUM

RETURN

DELAY1 0.0 ms :ALL RANGE

DELAY2 0.0 ms

(A*R+B) A:1.00000

B:+0.00000mΩ

Tenkeys

Selection

1

2

3

ENTER

Setting range: ±10% of full scale for each range (default: 0 mΩ)

6 Return to the Measurement screen.

RETURN

F1

INFO:023

Save and Return?

[CANCEL]:Continue to edit.

CANCEL

SAVE

NOSAVE

F1

F2

F3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

NOTE

- Scaling calculation is performed on measured values after zero-adjustment calculation. Consequently, measured values may not equal zero even after zero adjustment.
- For the purpose of setting the offset resistance value, range full-scale signifies 1,200,000 dgt.

4.4 Setting the Measurement Integration Time Option

The integration time can be optionally set for each range by selecting FAST, MED, or SLOW measurement speed. Integration time can be set in ms or PLC* units.

* PLC = Power Line Cycle, where one PLC is the period of the power line waveform. At 50 Hz, one PLC = 1/50th of a second, and at 60 Hz, one PLC = 1/60th of a second.


PLC setting units are useful where measurements may be affected by power line noise (high- or low-resistance measurements)

Default Settings

Range	Integration Time [INT]			OVC
	FAST	MED	SLOW	
10mΩ	2.0 ms	5.0 ms	1PLC	ON *1
100mΩ (1A)	1.0 ms	5.0 ms	1PLC	ON *1
100mΩ (100μA)	0.5 ms	5.0 ms	1PLC	ON *1
1000mΩ	0.3 ms	2.5 ms	1PLC	ON *1
10Ω	0.3 ms	2.5 ms	1PLC	ON *1
100Ω	0.3 ms	1.5 ms	1PLC	ON *1
1000Ω	0.3 ms	1.5 ms	1PLC	ON *1


*1. Two measurements are made within the above integration times.

1 Open the Basic Settings screen.

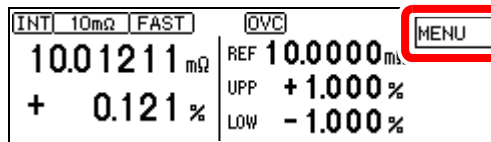

The Basic Settings screen appears.


2 Open the Measurement Settings Screen.

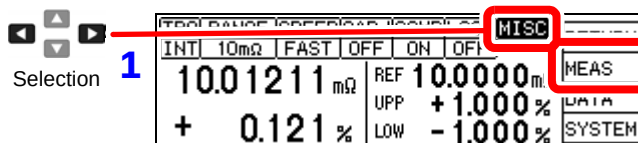

The Measurement Settings Screen appears.

[MEAS SETTINGS]
(The settings for the current measurement range are displayed.)

3 Select the integration setting units.

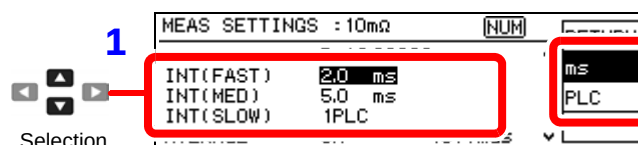


Set in units of time

Set in units of power line cycles

The setting is specific to the selected range
(p. 41)

4 Select the integration time.

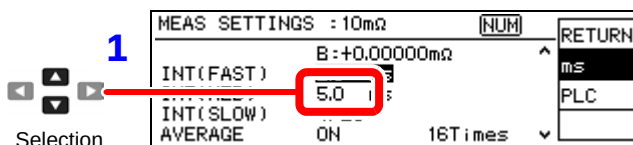

2




Setting range:

- When setting in ms units: 0.1ms to 100.0ms
- When setting power-line-cycle units: 1 to 6PLC (60 Hz), 1 to 5PLC (50 Hz)

3




5 Return to the Measurement screen.

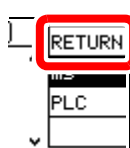

F1

 The confirmation screen appears



F1

F2

F3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

NOTE

- The instruments accuracy specifications are applicable only with the default integration times. Investigate your measurement requirements carefully before changing the integration time.
- When the effects of power line noise can be ignored, the integration time can be set longer than the default to reduce scattering of measured values. On the other hand, if the integration time is too short, scattering increases.

4.5 Stabilizing Measured Values (Averaging Function)

The averaging function averages multiple measured values to stabilize them. Accuracy specifications have been determined for the 16-iteration averaging setting in the 10 mΩ range^{*1}, allowing more precise measurement to be performed.

For internal trigger measurement, a moving average is calculated. For external trigger measurement (and :READ? command operation), a simple average is used.

Default setting Averaging function: OFF
Number of averaging iterations: 16Times

1 Open the Basic Settings screen.

INT 10mΩ FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ	
+ 0.121 %	UPP +1.000 %	
	LOW -1.000 %	

F 1

The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

Selection	1	MISC	2	MEAS
		INT 10mΩ FAST OFF ON OFF		REF 10.0000 mΩ
		10.01211 mΩ		UPP +1.000 %
		+ 0.121 %		LOW -1.000 %

F 2

The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Enable the averaging function.

MEAS SETTINGS : 10mΩ	2	OFF
B : +0.00000mΩ		ON
INT(FAST) 2.0 ms		
INT(MED) 5.0 ms		
1	AVERAGE	ON 16Times

F 2

Disables the function (default)
(go to step 5)

F 3

Enables the function

The setting is specific to the selected range
(p. 41)

4 Set the number of averaging iterations.

MEAS SETTINGS : 10mΩ	NUM	RETURN
B : +0.00000mΩ		
INT(FAST) 2.0 ms		
INT(MED) 5.0 ms		
1	AVERAGE	ON 16Times

Tenkeys

2 0 ... 9 / .

Setting range: 2 to 32 times (default: 16 times)

3 ENTER

5 Return to the Measurement screen.

RETURN	F 1	CANCEL	F 1
		SAVE	F 2
		NOSAVE	F 3

The confirmation screen appears

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

*1. SPEED = SLOW setting only.

NOTE

Turning on the averaging function lengthens the external trigger measurement (and :READ? command operation) time to (number of averaging iterations × measurement time with averaging turned off). Since a moving

4.6 Checking for Poor or Improper Contact (Contact Check Function)

This function detects poor contact between the probes and DUT, and broken measurement cables. The instrument continually monitors the resistance between the H_{CUR} and H_{POT} probes and the L_{CUR} and L_{POT} probes from the start of integration (including response time) and while measuring. When the resistance is outside of the specified value, a contact check fault occurs and the **C.E. Hi** or **C.E. Lo** error message appears. No comparator decision is applied to the measured value. When these error messages appear, check the probe contacts, and check for broken measurement cables. If the error is not cleared by shorting the tips of a known-good measurement cable, the instrument requires repair.

NOTE

- During low-resistance measurement, poor contact of the H_{CUR} or L_{CUR} probe may be detected as an out-of-range measurement.
- When contact checking is disabled, measured values may be displayed even when a probe is not contacting the DUT.

1 Open the Basic Settings screen.

INT 10mΩ FAST	OVF	MENU	F1
10.01211 mΩ	REF 10.0000 m		
+ 0.121 %	UPP +1.000 %		
	LOW -1.000 %		

The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

Selection	1	INT 10mΩ FAST OFF ON OFF	MISC	2	
		10.01211 mΩ	REF 10.0000 m	MEAS	F2
		+ 0.121 %	UPP +1.000 %	DATA	
			LOW -1.000 %	SYSTEM	

The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Enable the Contact Check function.

Selection	1	MEAS SETTINGS : 10mΩ	2	
		INT(MED) 5.0 ms	OFF	F2
		INT(SLOW) 1PLC	ON	F3
		CONT CHECK ON		
		16Times		
		100Ω		
		35mA		

Disables the function (go to step 5)

Enables the function (default)

The setting is specific to the selected range (p. 41)

4 Select the contact check fault threshold resistance.

Selection	1	MEAS SETTINGS : 10mΩ	2	
		INT(MED) 5.0 ms	+	F2
		100Ω	-	F3
		AVERAGE ON		
		CONT CHECK ON		
		CONT IMP ON		

50Ω, 100Ω (default), 150Ω, 200Ω, 300Ω, 400Ω, 500Ω

A contact fault occurs when a measured value exceeds the threshold setting.

5 Return to the Measurement screen.

RETURN	F1	
		INFO:023
		Save and Return?
		[CANCEL]:Continue to edit.
		CANCEL
		SAVE
		NOSAVE

The confirmation screen appears.

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

4.7 Improving Probe Contact (Contact Improver Function)

Probe contacts can be improved by applying current from the POT to the CUR probes before measuring.

**CAUTION**


The Contact Improver function applies voltage to the sample. Be careful when measuring samples with characteristics that may be affected.

The current used for the Contact Improver functions can be selected as follows.
17 mA, 25 mA, 35 mA (default), 50 mA
Higher current provides more effective contact improvement, but at the cost of faster probe deterioration.
Contact Improver current can be set to be disabled (OFF), enabled (ON), or PULSE.
The PULSE setting applies the contact improvement current for about 100 μ s immediately before measurement. The PULSE setting is useful to decrease Joule heating if the DUT is susceptible to its current.

DUT current	Steady-state current: 2 mA max. *
DUT voltage	15 V max.

*: It takes several microseconds for the DUT current to reach the steady-state value. Until the steady-state value is reached, a transient current that is approximately equal to the contact improvement current setting (default setting: 35 mA) will flow.

Timing Chart
(Contact Improver Function)

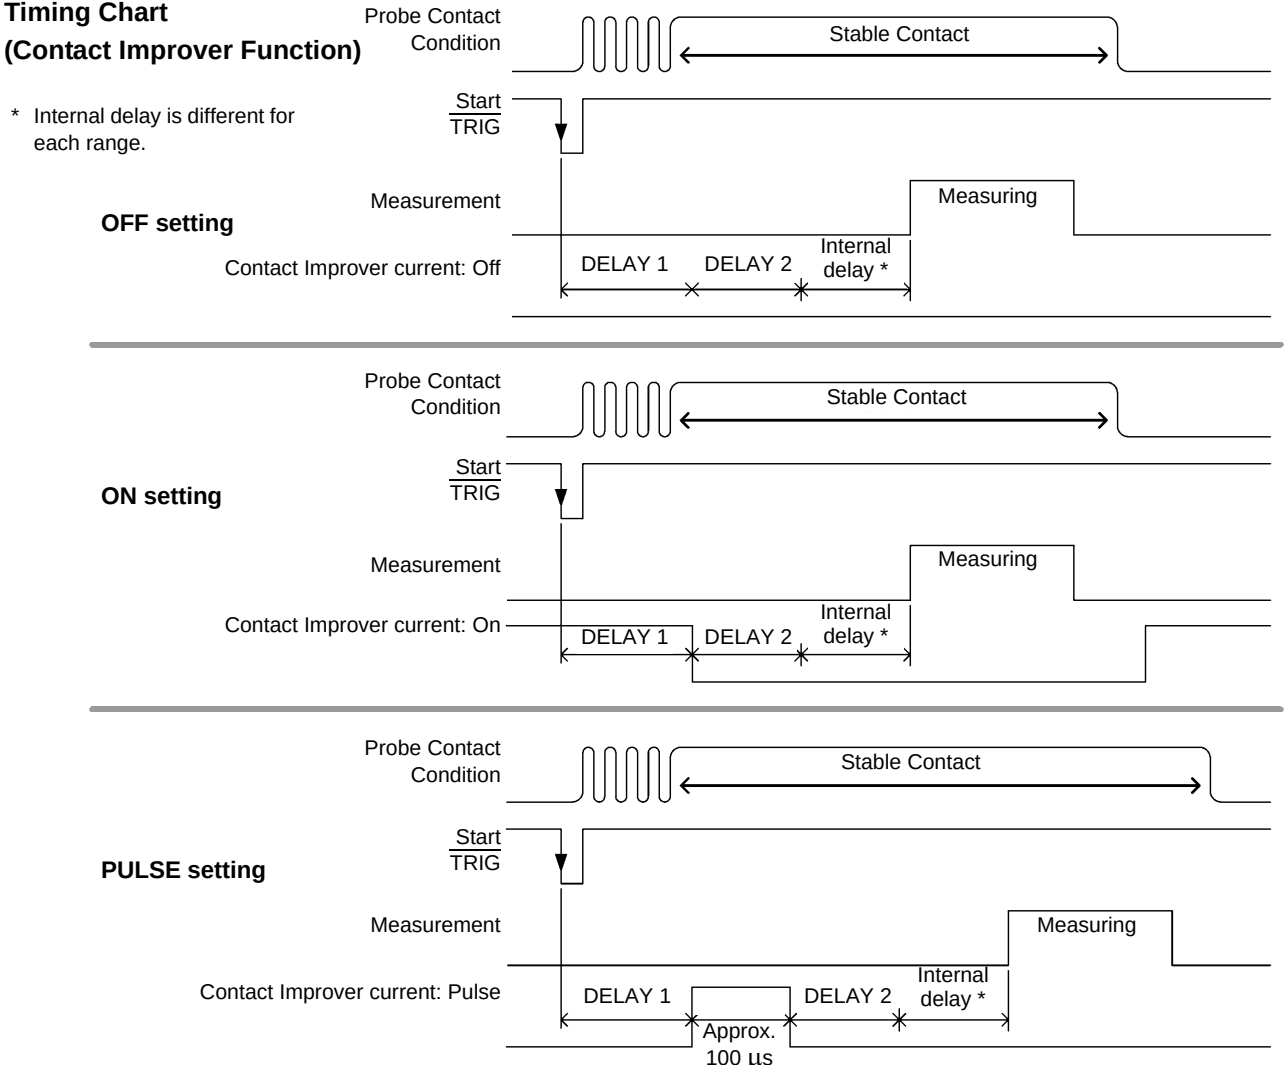

4.7 Improving Probe Contact (Contact Improver Function)

1 Open the Basic Settings screen.

INT 10mΩ	FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ	UPP +1.000 %	
+ 0.121 %	LOW -1.000 %		

F1

The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

Selection 1

INT 10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ	REF 10.0000 mΩ	UPP +1.000 %			MEAS	
+ 0.121 %	LOW -1.000 %				DATA	
					SYSTEM	

2

F2

The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Set the Contact Improver current timing to disabled (OFF), enabled (ON), or PULSE.

Selection 1

MEAS SETTINGS : 10mΩ				RETURN
INT(MED)	5.0 ms			
INT(SLOW)	1PLC			
AVERAGE	ON	18Times		
		100Ω		
		35mA		
CONT IMP	ON			

2

F2

F3

F4

Disable probe contact improvement (go to step 4).

Enable probe contact improvement.

Apply contact improvement current for about 100 μs immediately before measurement.

The setting is specific to the selected range(p. 41)

(When selecting ON or PULSE)

Set the current limit value.

Selection 1

MEAS SETTINGS : 10mΩ				
INT(MED)	5.0 ms			
INT(SLOW)	1PLC			
AVERAGE	ON	18Times		
CONT CHECK	ON			
CONT IMP	ON			
		35mA		

2

F2

F3

17mA, 25mA, 35mA (default), 50mA

4 Return to the Measurement screen.

Selection 1

RETURN
↓

F1

The confirmation screen appears.

INFO:023
Save and Return?
[CANCEL]:Continue to edit.

CANCEL

SAVE

NOSAVE

F1

F2

F3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

4


4.8 Detecting Measurement Voltage Faults (Voltage Level Monitor Function)

When a measurement voltage fault occurs due to probe chattering, the **C.E. Volt** error message appears on the measurement screen and an ERR signal is output. The **C.E. Volt** error may also appear when external noise is strong.

Check the following if errors occur frequently:


- Check for probe deterioration.
- Provide additional noise suppression. "Appendix 3 Unstable Measurement Values" (p. A3)
- Set the voltage level monitor to Loose, or OFF (disable).
- Keep wiring away from nearby equipment.

1 Open the Basic Settings screen.

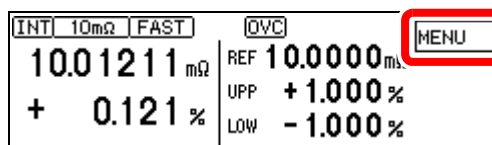


The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

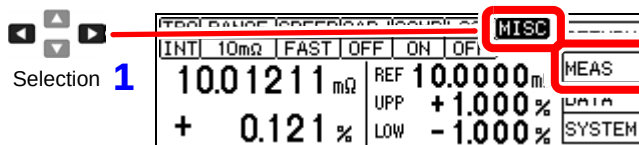

The Measurement Settings Screen appears.
[MEAS SETTINGS]


3 Enable or disable the function.

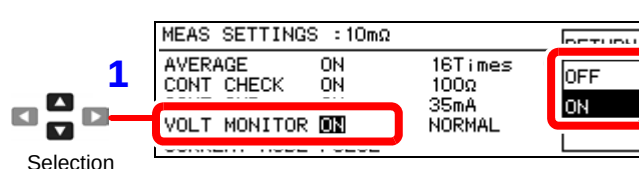

Disables the function (go to step 5)
Enables the function (default)


The setting is specific to the selected range (p. 41)

4 (When enabled (ON selected)) Select the voltage level monitor threshold.

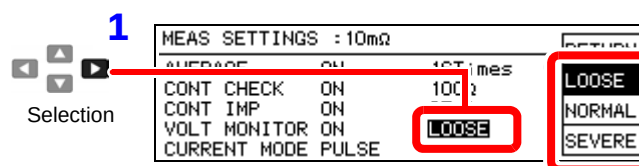

Loose
Normal (default)
Severe

5 Return to the Measurement screen.

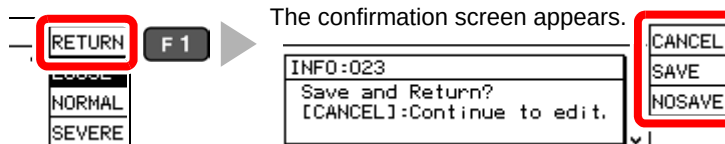

Return to the setting screen.
Save setting and return to previous screen.
Discard setting and return to previous screen.

4.9 Applying Current Only When Measuring (Current Mode Setting)

When the Contact Improver function is set to Pulse or disabled (CONT IMP: PULSE or OFF) and measurement current is set for pulse output, open-circuit voltage when not measuring does not exceed 20 mV.

See: "4.7 Improving Probe Contact (Contact Improver Function)" (p. 50)

NOTE

When the Contact Improver function is enabled (CONT IMP: PULSE or ON setting), the current mode setting is ignored even if set to continuous (CURRENT MODE: CONT setting). The Contact Improver function forces pulse operation with measurement current applied only during measurement.

4

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OVC	MENU	F1
10.01211 mΩ			REF 10.0000 mΩ		
+ 0.121 %			UPP +1.000 %		
			LOW -1.000 %		

The Basic Settings screen appears.

2 Open the Measurement Settings Screen.

Selection 1

INT	10mΩ	FAST	OFF	ON	OFF	MISC	DET/BLK
10.01211 mΩ			REF 10.0000 mΩ			MEAS	
+ 0.121 %			UPP +1.000 %			DATA	
			LOW -1.000 %			SYSTEM	

2

The Measurement Settings Screen appears.
[MEAS SETTINGS]

3 Select whether to apply current when not measuring.

Selection 1

MEAS SETTINGS : 10mΩ			RETURN	2
AVERAGE	ON	16Times	CONT	F2
CONT CHECK	ON	100Ω	PULSE	F3
CONT IMP	ON	35mA		
CURRENT MODE PULSE				

2

Measurement current is applied while awaiting trigger.

Measurement current is applied only while measuring (default).

The setting is specific to the selected range (p. 41)

To apply measurement current continuously (CONT setting) even when waiting for a trigger, confirm that the Contact Improver function is disabled (CONT IMP: OFF, (p. 50)).

4 Return to the Measurement screen.

Selection 1

RETURN	F1	The confirmation screen appears.	
CONT	PULSE	CANCEL	F1
		SAVE	F2
		NOSAVE	F3

INFO:023
Save and Return?
[CANCEL]:Continue to edit.


Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

4.10 Test for Short-Circuited Probe (Probe Short-Circuit Detection Function)

Four-terminal measurements are not possible when a conductive foreign object is present between the POT and CUR probe tips. To detect short-circuited probes, this function measures the resistance between the CUR and POT terminals after a specific time (initially 5 ms) following the end of measurement. Probe short-circuit detection is disabled by default.

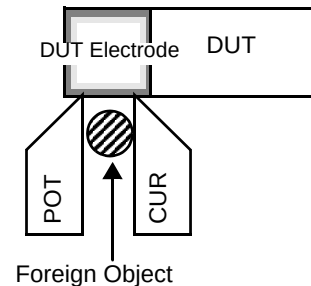

When a probe short-circuit is detected, an error message appears on the measurement screen, and the `PRB_SHORT` and `ERR` signals are output. (**ERR:021 Probe short error**)


Short-circuit detection can also be controlled by asserting the active-low `PRB_CHECK` EXT I/O signal. Asserting the `PRB_CHECK` signal while measuring causes short-circuit detection to be performed after the end of measurement (p. 89).

About Probe Short-Circuit Detection

- If probes are connected to the DUT during probe short-circuit detection, the short circuit is detected. Ensure that the probes have sufficient time to separate from the measurement object.
- Probe short-circuit detection occurs within about 1 ms.
- The threshold for probe short-circuit detection is fixed at 500 Ω , so if the resistance between CUR and POT probes is larger, detection is not possible.

Timing Chart

(Probe Short-Circuit Detection)

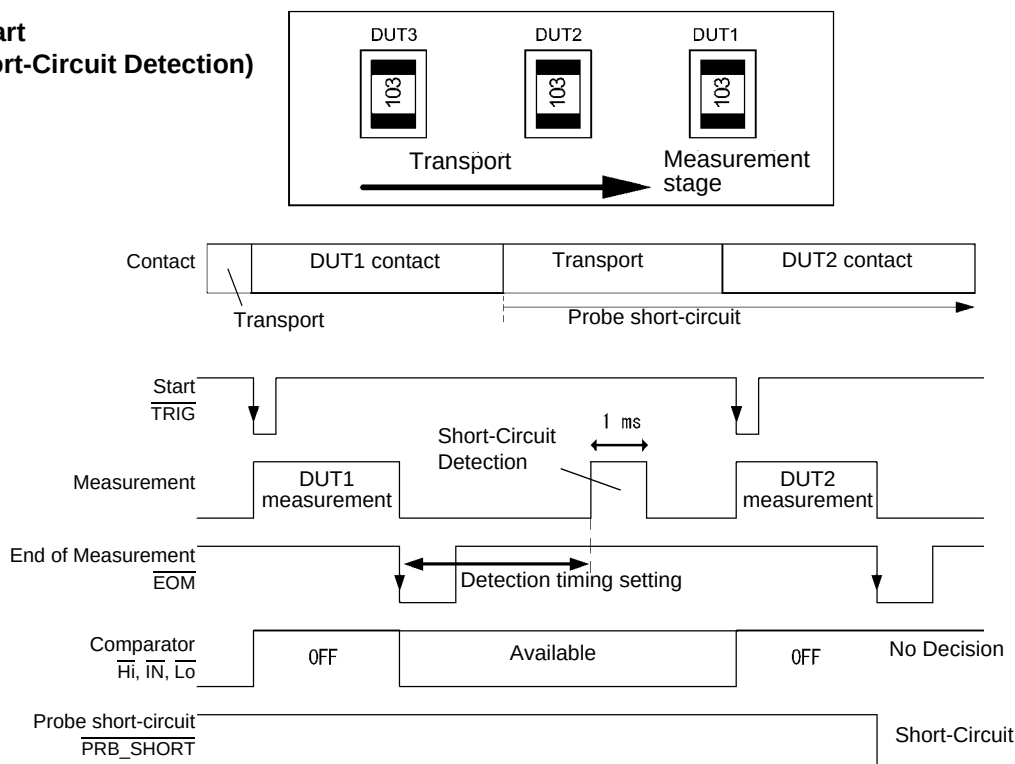

NOTE

- Even while the probe short-circuit detection function is set to be disabled, short-circuit detection is performed when the EXT I/O `PRB_CHECK` signal is asserted.
- When the internal trigger [TRG: INT] source is selected, short-circuit detection is not performed after the end of measurement. However, short-circuit detection can still be executed by asserting the `PRB_CHECK` signal.
- If probe short-circuit detection coincides with the timing of self-calibration processing, short-circuit detection will not be performed. Short-circuit detection using the `PRB_CHECK` signal will be performed after self-calibration processing.

4.10 Test for Short-Circuited Probe (Probe Short-Circuit Detection Function)

Probe Short-Circuit Detection Enable/Disable

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OVC	MENU
10.01211 mΩ		REF	10.0000 mΩ	
+ 0.121 %		UPP	+1.000 %	
		LOW	-1.000 %	

F1

The Basic Settings screen appears.

2 Open the System screen.

Selection 1

FEED BACK	10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ		REF	10.0000 mΩ				
+ 0.121 %		UPP	+1.000 %				
		LOW	-1.000 %			SYSTEM	

2

F4

The System screen appears.
[SYSTEM]

3 Enable or disable the function.

Selection 1

SYSTEM		RETURN
PROBE CHECK OFF		OFF
TRIG EDGE 1:ON EDGE		ON
EOM PULSE 5 ms		

2

F2

Disables the function (default)
(go to step 5)

F3

Enables the function

4 (When enabled (ON selected))

Set the probe detection timing.

Selection 1

SYSTEM		(NUM)	RETURN
SET MONITOR OFF		5 ms	
PROBE CHECK ON			
RETRY ON			
TRIG EDGE 1:ON EDGE			
EOM PULSE 5 ms			

Short-circuit detection is delayed for the specified time following the end of measurement.

2

0 9

Setting range: 1 to 100 ms, 5 ms (default)

3

ENTER

5 Return to the Measurement screen.

Selection

RETURN

F1

The confirmation screen appears

INFO:023
Save and Return?
[CANCEL]:Continue to edit.

CANCEL

SAVE

NOSAVE

F1

Return to the setting screen.

F2

Save setting and return to previous screen.

F3


Discard setting and return to previous screen.

4.11 Comparing the Measurement Settings of Two Instruments (Settings Monitor Function)





This function automatically compares the settings of two instruments to determine whether they are the same. Only those measurement settings affecting the comparator and speed are compared. When the settings differ, an alarm notification appears and subsequent TRIG signal input is prevented from starting measurement.

When the settings of two instruments match, TRIG input is accepted and measurement starts. However, if the range defined by the upper and lower thresholds of the second stage is broader than that of the first stage, measurement still starts despite the different threshold settings.

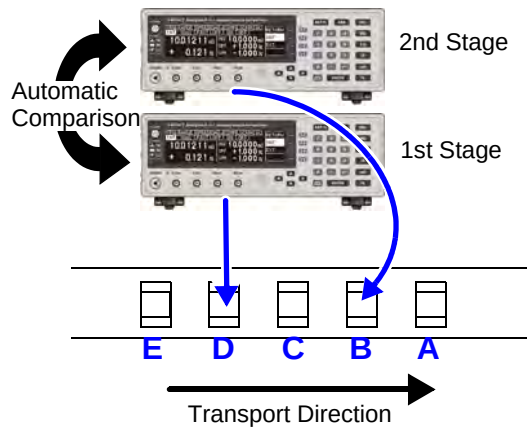


- 1 Connect the two instruments' SET MONITOR connectors together using a Hioki 9637 RS-232C cable.

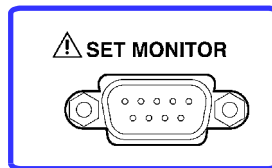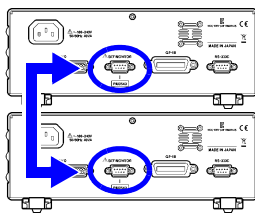


The SET MONITOR connectors are identical to RS-232C connectors. Be careful to avoid connecting the wrong connectors.

- 2 Open the Basic Settings screen.

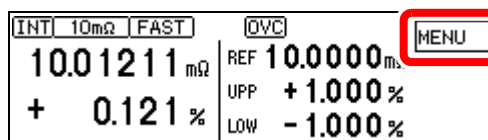


The Basic Settings screen appears.

- 3 Open the System screen.

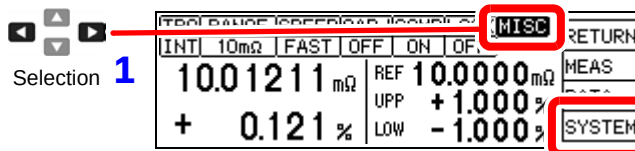

The System screen appears. [SYSTEM]

- 4 Enable the function on both instruments.

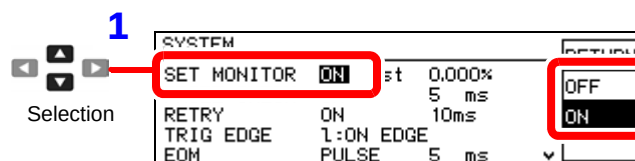

Disables the function (default)
Enables the function

4.11 Comparing the Measurement Settings of Two Instruments (Settings Monitor Function)

5 Select the instrument to serve as the 1st stage, and set its tolerance range.

1 Selection

2 F2 Selects this instrument as the 1st stage
F3 Selects this instrument as the 2nd stage

3 0 ... 9 Enter the difference in tolerance (%) to be allowed at the 2nd stage from the tolerance range set for the 1st stage.
Setting range: 0.000 to 9.999%

4 ENTER

Example: If the 1st stage is set to measure $12\ \Omega \pm 0.800\%$, and the 2nd is to measure $12\ \Omega \pm 1.000\%$, enter the difference in tolerance of 0.300%.

6 Set the instrument to serve as the 2nd stage (another RM3543).

1 Selection

2 F2 Selects this instrument as the 1st stage
F3 Selects this instrument as the 2nd stage

7 Return to the Measurement screen.

1 RETURN F1 The confirmation screen appears.

2 F1 Return to the setting screen.
F2 Save setting and return to previous screen.
F3 Discard setting and return to previous screen.

Tolerance Range Setting Conditions

Permissible tolerance is calculated using floating-point values, so the setting must be at least 0.001% larger than the difference between 2nd and 1st stage ranges. Set the upper and lower comparator thresholds according to the following conditions:

1st stage upper threshold < 2nd stage upper threshold

1st stage lower threshold > 2nd stage lower threshold


REF% setting		ABS setting	
1st stage	2nd stage	1st stage	2nd stage
(upper limit) UPP [%]	(upper limit) UPP [%]	(upper limit) UPP [%]	(upper limit) UPP [%]
REF [%]			
LOW [%]	(lower limit) LOW [%]	LOW [%]	(lower limit) LOW [%]
(lower limit)			
Tolerance range [%] > 2nd upper limit [%] - 1st upper limit [%]		Tolerance range [%] > $\frac{2nd\ upper\ limit - 1st\ upper\ limit}{1st\ upper\ limit} \times 100$	
		Tolerance range [%] > $\frac{1st\ lower\ limit - 2nd\ lower\ limit}{1st\ lower\ limit} \times 100$	

4.11 Comparing the Measurement Settings of Two Instruments (Settings Monitor Function)


Practical Example

SET MONITOR: ON 1st 0.300%
(on the System screen)

SET MONITOR: ON 2nd
(on the System screen)

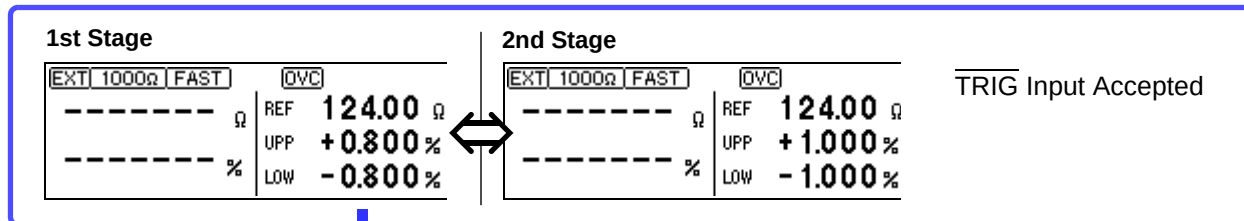


When changing the reference value

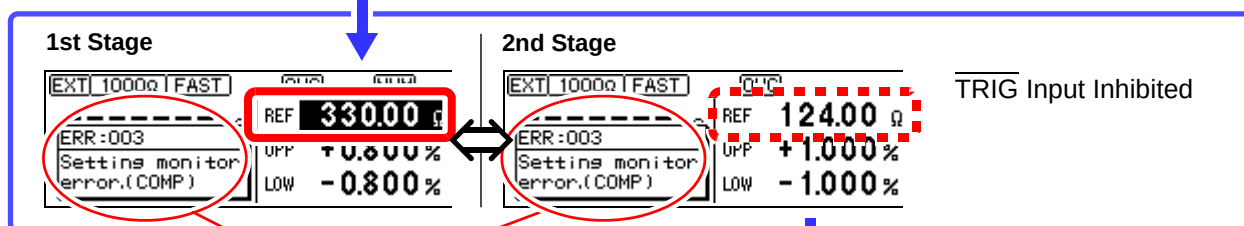

The error message appears when the settings do not match.

Change the reference value to match the 1st stage

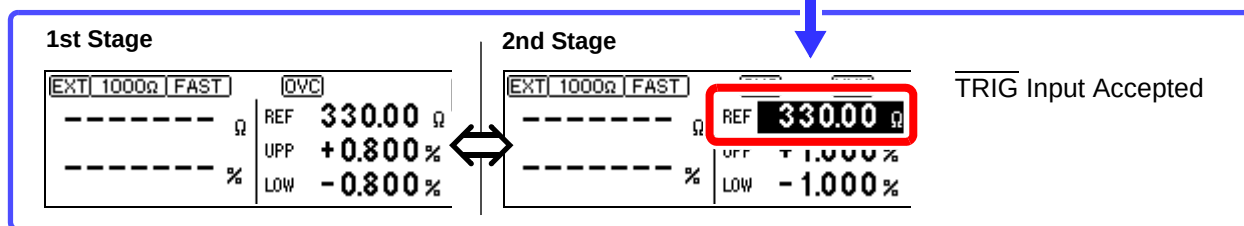

When an error is displayed

ERR:003

Setting monitor error. (COMP)

Comparator settings do not match. Please check.

ERR:004

Setting monitor error. (SPEED)


Measurement speed settings do not match. Please check.

4.12 Retrying Measurement After a Fault (Retry Function)


The Retry function causes measurement to be automatically retried when a measurement fault occurs due to probe chatter.

During Retry, all measurement operations including Contact Improvement and DELAY2 (but excluding DELAY1) are restarted.

If a measurement fault persists after the specified continuous retry interval (e.g., if the DUT is not connected), retrying is aborted and the EOM signal is output. When Retry is enabled, the maximum time to end-of-measurement occurs when recovering from a measurement fault immediately before the retry interval expires, which approaches the sum of the retry interval setting plus normal measurement time. Decreasing test throughput may indicate probe maintenance is required.

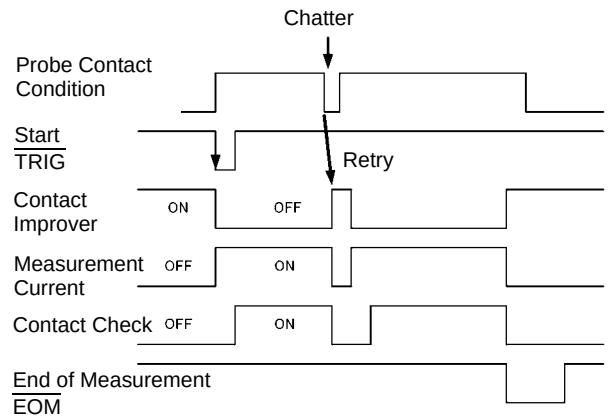


1 Open the Basic Settings screen.

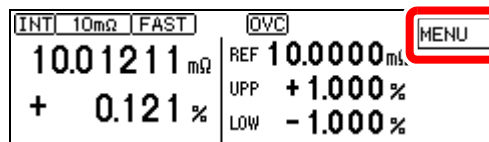


The Basic Settings screen appears.

2 Open the System screen.

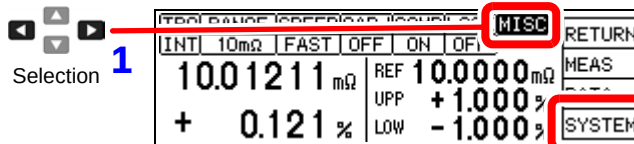

The System screen appears. [SYSTEM]


3 Select whether to enable or disable Retry.

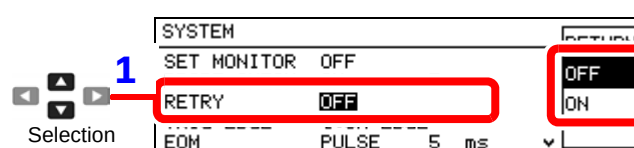

F2 Retry disabled (go to step 5)

F3 Retry enabled (default)


4 (When enabled (ON selected)) Set the continuous retry interval.

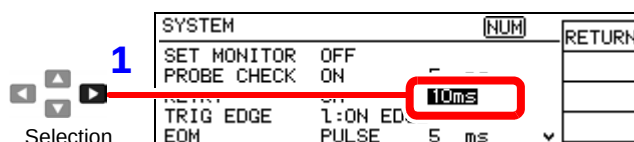


2 0 9 Setting range: 1 to 50 ms (default: 50 ms)

3 ENTER

5 Return to the Measurement screen.

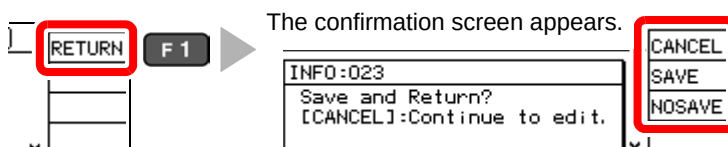

The confirmation screen appears.

 

F1 Return to the setting screen.


F2 Save setting and return to previous screen.

F3 Discard setting and return to previous screen.

4.13 Maintaining Measurement Precision (Self-Calibration)

To maintain measurement precision, the instrument self-calibrates to compensate for internal circuit offset voltage and gain drift. This function cannot be disabled.

You can select between two self-calibration function execution methods.

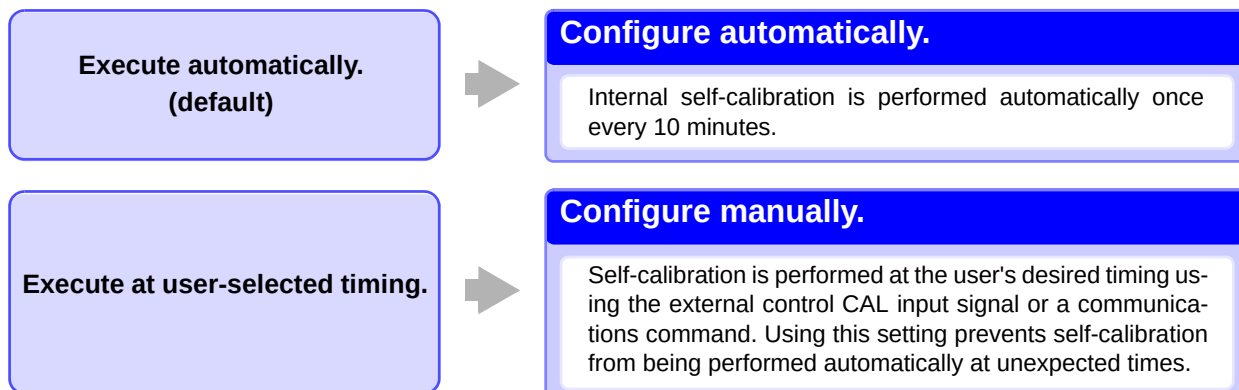

During self-calibration, the subsequent measurement is delayed for about 6PLC + 10 ms (PLC = Power Line Cycles) for internal circuit compensation.

Self-Calibration Timing

Within 130 ms at 50 Hz, or 110 ms at 60 Hz

1 Open the Basic Settings screen.

The screenshot shows the Basic Settings screen with the following fields: INT 10mΩ FAST, OVC, 10.01211 mΩ, REF 10.0000 mΩ, + 0.121 %, UPP +1.000 %, and LOW -1.000 %. The MENU button is highlighted with a red box.

F 1

The Basic Settings screen appears.

2 Open the System screen.

The screenshot shows the System screen with the following fields: INT 10mΩ FAST OFF ON OFF, MISC, RETURN, MEAS, 10.01211 mΩ, REF 10.0000 mΩ, + 0.121 %, UPP +1.000 %, and LOW -1.000 %. The SYSTEM button is highlighted with a red box.

2

F 4

The System screen appears.
[SYSTEM]

3 Configure self-calibration operation.

The screenshot shows the SYSTEM screen with the following fields: TRIG EDGE 1:ON EDGE, EOM PULSE 5 ms, INTERFACE RS232C 9600 bps, CALIBRATION AUTO, and the AUTO button highlighted with a red box.

2

F 2

Configure automatically. (default)

F 3

Configure manually.

4 Return to the Measurement screen.

The screenshot shows the confirmation screen with the following fields: RETURN, ON, and the RETURN button highlighted with a red box.

F 1

The confirmation screen appears.

The screenshot shows the confirmation screen with the following fields: INFO:023, Save and Return?, [CANCEL]:Continue to edit., and the CANCEL button highlighted with a red box.

F 1

Return to the setting screen.

F 2

Save setting and return to previous screen.

F 3

Discard setting and return to previous screen.

NOTE

- When the timing of self-calibration overlaps with a measurement, self-calibration is postponed until the end of measurement.
- When a trigger signal is applied during self-calibration, the start of the triggered measurement is postponed until self-calibration is finished.
- Self-calibration executes automatically after changing comparator or measurement speed settings.
- During self-calibration, measurement current and the Contact Improver current are inhibited.
- When configuring manually, be sure to perform self-calibration if the temperature of the environment in which the instrument is operating changes by 2 degrees or more. (Accuracy cannot be guaranteed if self-calibration is not performed.)

4.14 Compensating for Thermal EMF Offset (Offset Voltage Compensation - OVC)

4

This function automatically compensates for offset voltage resulting from thermal emf or internal instrument bias. (OVC: Offset Voltage Compensation)

See: "Appendix 2 Effect of Thermal emf" (p. A2)

The following value is known to be a true resistance value from R_p (>0), the value measured with current flowing in the positive direction, and R_N (<0), the value measured with current flowing in the negative direction.

$$\frac{R_p - R_N}{2}$$

Offset voltage compensation is automatically enabled for all ranges, and cannot be modified or disabled.

NOTE

Depending on the test object, some delay (DELAY2) is required (p. 42) to allow adequate current flow before starting measurement.

System Settings Chapter 5

5.1 Disabling and Enabling Key Operations

Disabling Key Operations (Key-Lock Function)

Activate the key-lock function to disable the instrument's front panel key operations. Three key-lock levels are available to suit specific purposes.

Only comparator settings are enabled.

Disabling All Except Comparator Settings

Key operations other than comparator settings (REF%, ABS, units and tenkeys) and **F1** [UNLOCK] keys are disabled. To disable key operations: select [MENU] [M.LOCK] is displayed when returning to the measurement screen.

Key operations to change settings are disabled (although key-lock can be canceled).

Disabling All Key Operations Including Comparator Settings


All key operations except **F1** [UNLOCK] are disabled. To disable key operations: select [FULL] [F.LOCK] is displayed when returning to the measurement screen.

All key operations are disabled.

Disabling All Panel Keys


Asserting (Low) the EXT I/O KEY_LOCK signal disables all panel keys, including **F1** [UNLOCK] and **F1** [LOCAL] (disables remote control) (p. 89). To disable the key-lock function and re-enable the keys, de-assert (High) the KEY_LOCK signal.

1 Open the Basic Settings screen.

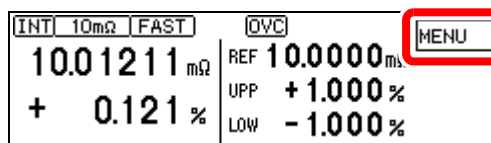


The Basic Settings screen appears.

2 Enable or disable key operations.

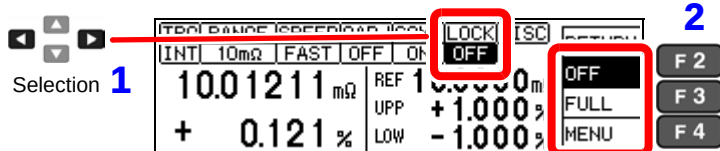

Key operations enabled (default)
Disable all except key-lock cancel
Disable all except key-lock cancel and comparator setting change

3 Return to the Measurement screen.

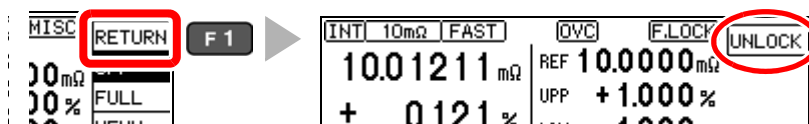


[UNLOCK] is displayed only when key-lock is enabled by front panel key operations.

Re-Enabling Key Operations (Key-Lock Cancel)

Key-lock can be canceled only when [UNLOCK] is displayed.

Press and hold F1 [UNLOCK] for one second.

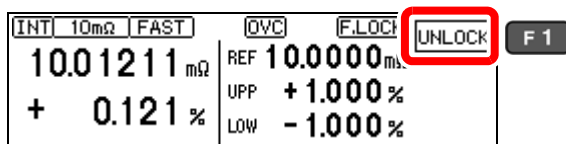

NOTE

If key operations are disabled by the KEY_LOCK signal, de-assert (High) the signal to unlock the keys.

5.2 Setting the Comparator Decision and Key Beepers

Enabling or Disabling the Key Beeper

The key beeper sound can be enabled and disabled.
The key beeper is enabled (ON) by default.

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OV	MENU
10.01211 mΩ			REF	10.0000 mΩ
+ 0.121 %			UPP	+1.000 %
			LOW	-1.000 %

F 1

The Basic Settings screen appears.

2 Open the System screen.

Selection 1

INT	10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ			REF	10.0000 mΩ		MEAS	
+ 0.121 %			UPP	+1.000 %		SYSTEM	
			LOW	-1.000 %			

2

F 4

The System screen appears.
[SYSTEM]

3 Select whether to enable or disable the key beeper.

Selection 1

SYSTEM				2
INTERFACE	RS232C	9600 bps	OFF	
100mΩ CURR	100mA		ON	
CALIBRATION	AUTO			
KEY BEEP	ON	HI/LO		

2

F 2

Disables the beeper

F 3

Enables the beeper (default)

4 Return to the Measurement screen.

Selection

RETURN
ON

F 1

The confirmation screen appears.

INFO:023
Save and Return?
[CANCEL]:Continue to edit.

F 1

F 2

F 3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

Setting the Comparator Decision ("JUDGE") Beeper

The comparator decision beeper can be enabled and disabled.
The decision beeper is disabled (OFF) by default.

1 Open the Basic Settings screen.

INT 10mΩ	FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ		
+ 0.121 %	UPP +1.000 %		
	LOW -1.000 %		

F1

The Basic Settings screen appears.

2 Open the System screen.

Selection 1

INT 10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ	REF 10.0000 mΩ					
+ 0.121 %	UPP +1.000 %					
	LOW -1.000 %				SYSTEM	MEAS

2

F4

The System screen appears.
[SYSTEM]

3 Select whether to enable or disable the decision beeper.

Selection 1

SYSTEM			
EOM	PULSE	5 ms	OFF
INTERFACE	RS232C	9600 bps	ON
100mΩ CURR	100mA		
JUDGE BEEP	ON	HI/LO	

2

F2

Disables the beeper (default)

F3

Enables the beeper

4 (When enabled (ON selected)) Select the decision beep conditions.

Selection 1

SYSTEM			
EOM	PULSE	5 ms	
INTERFACE	RS232C	9600 bps	
100mΩ CURR	100mA		
CALIBRATION	AUTO		
JUDGE BEEP	ON	HI/LO	

2

F2

IN (beep when within range)

F3

HI/LO (beep when out of range)

LOW (beep when below lower threshold)

HIGH (beep when above upper threshold)

5 Return to the Measurement screen.

Selection 1

RETURN	F1
--------	----

The confirmation screen appears

INFO:023	CANCEL	F1
Save and Return?	SAVE	F2
[CANCEL]:Continue to edit.	NOSAVE	F3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

5.3 Power Line Frequency Manual Setting

For proper electrical noise suppression, the instrument needs to be set to match the power line frequency. With the default setting (AUTO), the instrument attempts to automatically detect the line frequency, but manual setting is also available.

Unless the line frequency is set correctly, measured values may be unstable.

An error message appears if line noise is high enough to prevent correct frequency detection (ERR:041(p. 185)). In that case, set the instrument's line frequency manually.

NOTE

When the AUTO setting is selected, the line frequency is automatically set to 50 or 60 Hz when the instrument is turned on or reset.

However, automatic detection is not available when the line frequency changes after turning power on or resetting.

If the actual line frequency deviates from 50 or 60 Hz, select the closest frequency.

Examples:

If the actual line frequency is 50.8 Hz, select the 50 Hz setting.

If the actual line frequency is 59.3 Hz, select the 60 Hz setting.

5

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OVC	MENU
10.01211 mΩ		REF	10.0000 mΩ	
+ 0.121 %		UPP	+1.000 %	
		LOW	-1.000 %	

F1 → The Basic Settings screen appears.

2 Open the System screen.

Selection	1	2					
INT	10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ		REF	10.0000 mΩ	MEAS			
+ 0.121 %		UPP	+1.000 %				
		LOW	-1.000 %			SYSTEM	

F4 → The System screen appears. [SYSTEM]

3 Select the line frequency being used.

1	2
SYSTEM	RETURN
CALIBRATION	AUTO
JUDGE BEEP	ON
KEY BEEP	ON
HI/LO	
18:28:59	
LINE FREQ	AUTO
	AUTO
	50Hz
	60Hz

F2 → Automatically detect local line frequency (default)

F3 → When the line frequency is 50 Hz

F4 → When the line frequency is 60 Hz

4 Return to the Measurement screen.

RETURN	F1	CANCEL	F1
50Hz		SAVE	F2
60Hz		NOSAVE	F3

The confirmation screen appears.

F1 → Return to the setting screen.

F2 → Save setting and return to previous screen.

F3 → Discard setting and return to previous screen.

5.4 Setting the Clock

To record and print the correct time when using statistical calculations (p. 78), the clock needs to be set correctly. The time of printing is also output when printing statistical calculation results.

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OVC	MENU
10.01211 mΩ			REF	10.0000 mΩ
+ 0.121 %			UPP	+1.000 %
			LOW	-1.000 %

F 1

The Basic Settings screen appears.

2 Open the System screen.

Selection 1

INT	10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ			REF	10.0000 mΩ		MEAS	
+ 0.121 %			UPP	+1.000 %		SYSTEM	
			LOW	-1.000 %			

2

F 4

The System screen appears.
[SYSTEM]

3 Set the date and time.

Selection 1

SYSTEM			NUM	RETURN
100mΩ	CURR	100mA		
CALIBRATION	AUTO			
JUDGE BEEP	OFF			
CLOCK(Y-M-D)			11-07-22	18:23:07

2

0 9

Enter the last two digits of the year, and the month, day, hour, minutes and seconds in that order (the cursor moves automatically).
Enter two digits for all values (e.g., 09).

4 Return to the Measurement screen.


NUM	RETURN	F 1
3:07		

Clock settings cannot be canceled.

5.5 Adjusting Screen Contrast

The screen may become hard to see when ambient temperature changes. In this case, adjust the contrast.


1 Open the Basic Settings screen.

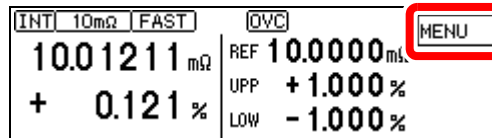

F 1

The Basic Settings screen appears.

2 Open the System screen.

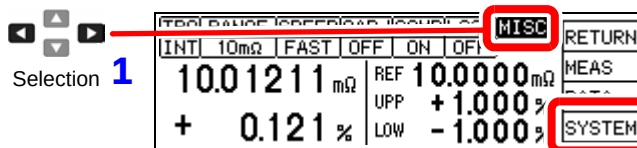


2

F 4

The System screen appears.
[SYSTEM]

3 Adjust the contrast.

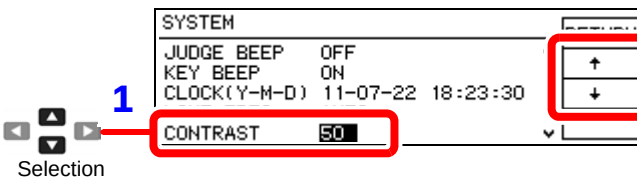


2

F 2

0 to 100%, 5% step
(default: 50%)

F 3

4 Return to the Measurement screen.

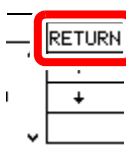

F 1

The confirmation screen appears.



F 1

Return to the setting screen.

F 2

Save setting and return to previous screen.

F 3

Discard setting and return to previous screen.


5.6 Adjusting the Backlight

Adjust backlight brightness to suit ambient illumination.

NOTE

- When external (EXT) triggering is selected, backlight brightness is automatically reduced after non-operation for one minute.
- Be aware that the display may be hard to see when brightness is set too low (near 0%).


1 Open the Basic Settings screen.

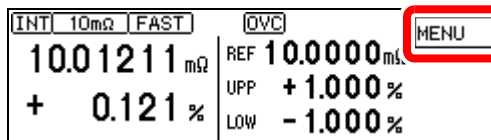

F 1

▶ The Basic Settings screen appears.

2 Open the System screen.

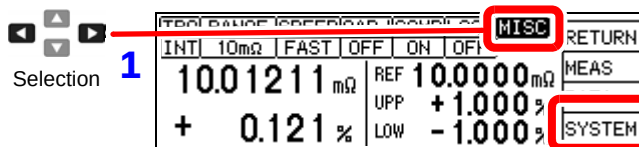


Selection

2

F 4

▶ The System screen appears.
[SYSTEM]

3 Adjust the backlight.

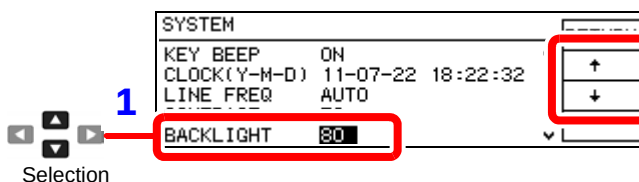

Selection


2

F 2

F 3

0 to 100%, 5% step, (default: 80%)

4 Return to the Measurement screen.

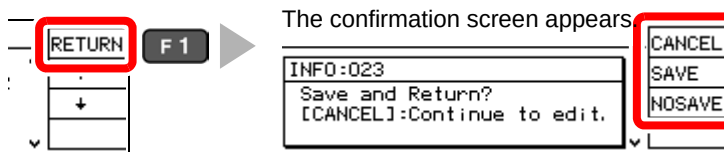

RETURN

F 1

▶ The confirmation screen appears

CANCEL

SAVE

NOSAVE

F 1

F 2

F 3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

5.7 Initializing (Reset)

The instrument can be reset by three methods.

- System reset from the System screen: Returns all settings (except the clock) to factory defaults.
- Turn the instrument on while simultaneously holding the **REF%** and **ABS** keys: Returns all settings (except the clock) to factory defaults.
- Reset by remote control command: returns all settings (except communication and clock settings) to their factory defaults.
 - *RST command (non-backup, (p. 127))
 - :SYSTem:RESEt command (p. 141)

This procedure describes system reset from the System screen.

1 Open the Basic Settings screen.

INT	10mΩ	FAST	OVC	MENU
10.01211 mΩ			REF 10.0000 mΩ	
+ 0.121 %			UPP +1.000 %	
			LOW -1.000 %	

F 1

The Basic Settings screen appears.

5

2 Open the System screen.

Selection	1	INT	10mΩ	FAST	OFF	ON	OF	MISC	RETURN
		10.01211 mΩ			REF 10.0000 mΩ		MEAS		2
		+ 0.121 %			UPP +1.000 %		SYSTEM		
					LOW -1.000 %				

F 4

The System screen appears.
[SYSTEM]

3 Select RESET.

Selection	1	SYSTEM	2
		CLOCK(Y-M-D)	11-07-22 18:30:37
		LINE FREQ	AUTO
		CONTRAST	50
			80
		RESET	

F 2

Returns all settings to their factory defaults

4 Select whether to cancel or proceed to execute system reset.

SYSTEM	CANCEL	F 1
CLC INFO:024		
LIN System Reset?		
COM		
BAC		
RES	YES	F 4

Cancel the operation

Execute

The Measurement screen is displayed when system reset finishes.

Default Settings

Display		Setting value	Default Settings	Setting Description
MENU	TRG	INT/ EXT/ MANU	EXT	Trigger source selection (p. 30)
	RANGE	10mΩ/ 100mΩ/ 1000mΩ/ 10Ω/ 100Ω/ 1000Ω	1000 Ω	Range selection (p. 31)
	SPEED	SLOW/ MED/ FAST	FAST	Measurement speed (p. 29)
	0ADJ	OFF/ ON	OFF	Zero adjustment (p. 32)
	COMP	OFF/ ON	ON	Comparator function(p. 34)
	LOCK	OFF/ FULL / MENU	OFF	Key-Lock function (p. 63)
	MISC	MEAS/ DATA/ SYSTEM		(Miscellaneous settings)
MISC				
MEAS	DELAY1	0 to 100 ms (all ranges)	0 ms	Probe delay setting (p. 42)
	DELAY2	0 to 100 ms	0 ms	DUT response setting (p. 42)
	SCALING	OFF/ ON Coefficient A Offset B	OFF A: 1 B: 0	Scaling function (p. 44)
	INT (FAST)	0.1 ms to 100 ms	Depends on measurement range	Integration time (p. 46)
	INT (MED)	1PLC to 6PLC (60 Hz)		
	INT (SLOW)	1PLC to 5PLC (50 Hz)		
	AVERAGE	OFF/ ON 2 to 32 times	OFF, 16Times	Averaging function (p. 48)
	CONT CHECK	OFF/ ON 50 Ω/ 100 Ω/ 150 Ω/ 200 Ω/ 300 Ω/ 400 Ω/ 500 Ω	ON, 100 Ω	Contact-check (p. 49)
	CONT IMP	OFF/ ON/ PULSE 17 mA/ 25 mA/ 35 mA/ 50 mA	ON, 35 mA	Contact Improvement (p. 50)
	VOLT MONITOR	OFF/ ON LOOSE/ NORMAL/ SEVERE	ON, NORMAL	Voltage level monitor (p. 52)
	CURRENT MODE	CONT/ PULSE	PULSE	Current mode setting (p. 53)
DATA	AUTO MEMO- RY	OFF/ ON	OFF	Auto-Memory function (p. 75)
	STATISTICS	OFF/ ON	OFF	Statistical calculation function (p. 78)
	DATA OUT	OFF/ ON	OFF	Data output function (p. 81)
SYS- TEM	SET MONITOR	OFF/ ON, 1st/ 2nd, 0.000% to 9.999%	OFF, 1st, 0.000%	Settings Monitor function (p. 56)
	PROBE CHECK	OFF/ ON, 0 to 100 ms	OFF, 5 ms	Probe short-circuit detection (p. 54)
	RETRY	OFF/ ON, 1 to 50 ms	ON, 50 ms	Retry function (p. 59)
	TRIG EDGE	OFF EDGE/ ON EDGE	ON EDGE	Start Logic Setting (p. 98)
	EOM	PULSE/ HOLD 1 to 100 ms	PULSE, 5 ms	End-of-measurement pulse width (p. 97)
	INTERFACE	GP-IB/ RS232C/ PRINT	RS232C, 9600bps GP-IB, ADR01, LF	Interface setting (p. 105)
	100mΩ CURR	100mA/ 1A	100mA	Switching 100 mΩ range measurement currents (p. 28)
	CALIBRATION	AUTO/ MANU	AUTO	Self-calibration operation settings (p. 60)
	JUDGE BEEP	OFF/ ON IN/ HI/LO/ LOW/ HIGH	OFF, HI/LO	Comparator decision beeper (p. 65)
	KEY BEEP	OFF/ ON	ON	Key beeper (p. 63)
	CLOCK			Clock setting (p. 68)
	LINE FREQ	AUTO/ 50 Hz/ 60 Hz	AUTO	Line frequency (detection) (p. 67)
	CONTRAST	0 to 100	50	Screen contrast adjustment (p. 69)
	BACK LIGHT	0 to 100	80	Screen backlight adjustment (p. 70)
	RESET	-	-	Reset (p. 71)

Storing and Exporting Data

Chapter 6

Measured values can be stored or automatically exported, according to application. Stored data can be output to a printer, RS-232C or GP-IB. Also, statistical calculations can be applied to internally stored data.

Stored measurements are lost when the instrument is turned off.
Therefore, be sure to print out or export important data to a PC.

Store measured values at specific times.
This is convenient for batch exporting data to a controller while switching reels.



Data Memory Function (p. 74)

Store up to 30,000 measured values using the EXT I/O TRIG signal or by pressing F4 [MANU] on the Basic Settings screen.

Store data after measured value has stabilized.
This is convenient for sample inspection after printing (vapor deposition) resistors on a board.



Auto-Memory Function (p. 75)

Measured values are automatically stored as they become stable.
When the specified number of data points (up to 99) is acquired, the beeper sounds and auto-storing halts.

Automatically output (export) measurements at the end of measurement.



Data Output Function (p. 81)

Minimizes transfer time by eliminating the need for transmit requests from the remote controller. (RS-232C interface only)

NOTE

The data memory and auto-memory functions cannot be enabled at the same time.

6.1 Storing Data at Specific Times (Data Memory Function)

Measured values are stored in the instrument's internal memory according to the following timings. (up to 30,000 points)

- Every time a measurement is performed by external (EXT) triggering
- When a trigger is applied during internally (INT) triggered measurement

The following three storage methods are available:

- Store upon receiving an EXT I/O $\overline{\text{TRIG}}$ signal (p. 89)
- Store upon receiving a *TRG command (p. 130)
- Store by pressing the **F4** [MANU] key on the [MENU] – [TRG] setting screen.

NOTE

- This function can only be enabled by remote control. The data memory function should be enabled by remote control beforehand. This setting is not available from the front panel.
- Stored memory data cannot be viewed on the instrument's screen. Use remote control commands to export stored data.

Data Memory Function Operating Procedure

1

Enable data memory mode.

Send this remote command to enable the data memory function:

:MEMory:MODE MEMory (p. 146)

2

Store measured values.

Execute external trigger measurement, or apply a trigger during internally triggered measurement.

3

Export the stored data.

Send this remote command to export the measured values stored in the instrument:

:MEMory:DATA? (p. 147)

4

Clear measurement data from instrument memory.

Send this remote command to erase the data from instrument memory:

:MEMory:CLEar (p. 146)

Stored data is automatically erased at the following times:

- when the memory function setting (including auto-memory) is changed (p. 146)
- when the range is changed (p. 31)
- when changing comparator settings (p. 34)
- when the scaling setting for the current range is changed (p. 44)
- when printing the statistical calculations (p. 86)
- when the DUT is changed (p. 28)
- upon system reset (p. 71)
- when the instrument is turned off


6.2 Store as soon as Measurement is Stable (Auto-Memory Function)

This function automatically stores the value measured each time the probes contact the sample with internal triggering. When the specified number of values has been acquired, auto-storage operation stops.

Statistical calculations are applied to the stored data, with results output to the screen or printer (RS-232C).

See: "6.3 Performing Statistical Calculations on Measured Values" (p. 78)
"Chapter 7 Printing" (p. 83)

Data storage and printing can be automatically controlled by the Auto-Memory function.

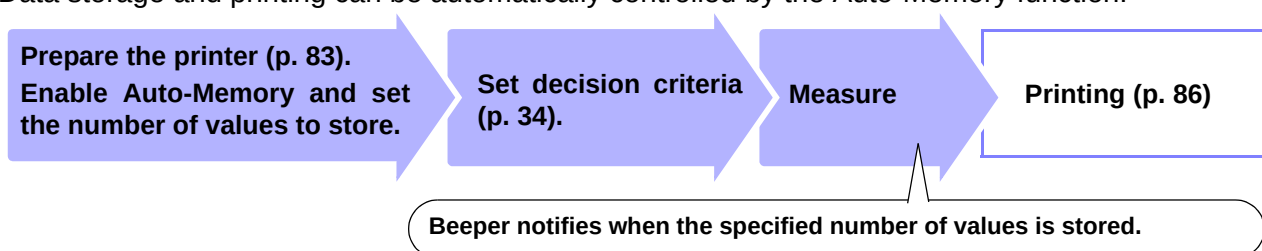

The Auto-Memory function is disabled by default.

Enable the Auto-Memory function before setting the number of values to store.

Enabling the Auto-Memory function affects other functions as follows:

- Statistical calculation is forced on.
- The voltage level monitor function is forced off (although the setting itself is not set to OFF, the function is actually disabled).
- The trigger source setting is forced to internal (INT).

NOTE

When the trigger source is set to external (EXT), the Auto-Memory function is disabled by force.

Deleting Stored Data

Stored data is automatically erased at the following times:

- when the memory function setting (including auto-memory) is changed (p. 146)
- when the range is changed (p. 31)
- when changing comparator settings (p. 34)
- when the instrument is turned off
- when the scaling setting for the current range is changed (p. 44)
- when printing the statistical calculations (p. 86)
- when the DUT is changed (p. 28)
- upon system reset (p. 71)
- upon setting the auto-memory number of values to store (p. 77)
- when the instrument is turned off

6.2 Store as soon as Measurement is Stable (Auto-Memory Function)

Enabling the Auto-Memory Function

1 Open the Basic Settings screen.

INT 10mΩ	FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ	UPP +1.000 %	
+ 0.121 %	LOW -1.000 %		

F1



The Basic Settings screen appears.

2 Open the Data Memory Settings screen.

Selection 1

INT 10mΩ	FAST	OFF	ON	OF.	MISC	RETURN
10.01211 mΩ	REF 10.0000 mΩ	UPP +1.000 %				
+ 0.121 %	LOW -1.000 %					

2

F3

The Data Settings screen appears.
[DATA SETTINGS]

3 Enable the function.

Selection 1

DATA SETTINGS			
AUTO MEMORY	OFF		
DATA OUT	OFF		

2

F2



Disable the function (default)

F3



Enable the function

4 Return to the Measurement screen.

RETURN

ON



The confirmation screen appears.

INFO:023
Save and Return?
[CANCEL]:Continue to edit.

CANCEL
SAVE
NOSAVE

F1

F2

F3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.


When the function is enabled

INT 10mΩ	FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ	UPP +1.000 %	
+ 0.121 %	LOW -1.000 %		
COUNT PASS FAIL			
0/10 0/10 0/10			NUMBER


6.2 Store as soon as Measurement is Stable (Auto-Memory Function)

Setting the Number of Values to Store

- 1 Open the Auto-Memory Settings screen.

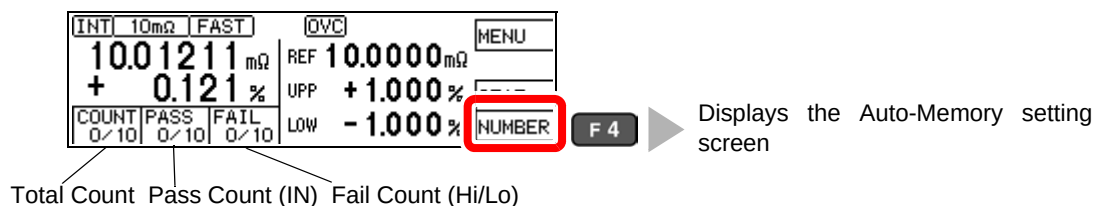


- 2 Enter the number of values to store.

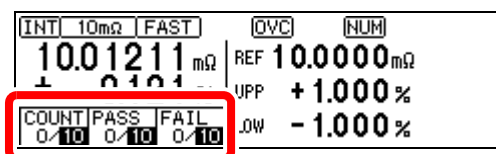

0 9 Setting range: 1 to 99

To abort the setting process, press **ESC**. Settings are abandoned and the display returns to the previous screen.

- 3 Accept the settings and return to the Measurement screen.

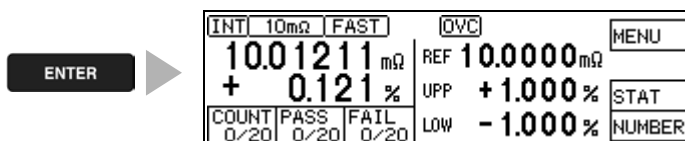


(Example: 20 values set to be stored)

Acquiring Measured Values Automatically

- 1 Momentarily disconnect (open-circuit) the probes.

- 2 Connect the probes to the DUT.

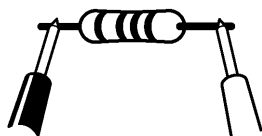

When the measurement is stable, the value is automatically stored and the count is incremented. When the count reaches the specified number of values, a long beep sounds, and subsequent measurements are not stored. The (one) last acquired value can be deleted (Undo function (p. 80)).

6.3 Performing Statistical Calculations on Measured Values

Statistical calculations can be performed on up to 30,000 measured values, with results displayed. Printing is also available (p. 86).

Calculation types: average, maximum and minimum values, population standard deviation, sample standard deviation, process compatibility indices

Maximum value	$X_{max} = MAX(x_1, \dots, x_n)$
Minimum value	$X_{min} = MIN(x_1, \dots, x_n)$
Average	$\bar{x} = \frac{\sum x}{n}$
Population standard deviation	$\sigma_n = \sqrt{\frac{\sum x^2 - n\bar{x}^2}{n}}$
Standard deviation of sample	$\sigma_{n-1} = \sqrt{\frac{\sum x^2 - n\bar{x}^2}{n-1}}$
Process capability index (dispersion)*	$Cp = \frac{ Hi - Lo }{6\sigma_{n-1}}$
Process capability index (bias)*	$CpK = \frac{ Hi - Lo - Hi + Lo - 2\bar{x} }{6\sigma_{n-1}}$

In these formulas, n represents the number of valid data samples.

Hi and Lo are the upper and lower thresholds of the comparator.

*. The process capability indices represent the quality achievement capability created by a process, which is the breadth of the dispersion and bias of the process' quality. Generally, depending on the values of Cp and CpK, process capability is evaluated as follows:

Cp, CpK > 1.33 Process capability is ideal
 1.33 ≥ Cp, CpK > 1.00 Process capability is adequate
 1.00 ≥ Cp, CpK Process capability is inadequate

- When only one valid data sample exists, standard deviation of sample and process capability indices are not displayed.
- When $\sigma_{n-1} = 0$, Cp and CpK are 99.99.
- The upper limit of Cp and CpK is 99.99. If Cp or CpK exceeds 99.99, the value 99.99 is displayed
- Negative values of CpK are handled as CpK = 0.
- If statistical calculation is turned off and then back on again without first clearing calculation results, calculation resumes from the point when it was turned off.
- Measurement speed is restricted when statistical calculation is enabled.
- When Auto-Memory is enabled (ON), statistical calculation is enabled (ON) by force.
- When statistical calculation is disabled (OFF), Auto-Memory is disabled (OFF) by force.

Deleting Statistical Calculation Results

Stored data is automatically erased at the following times:

- when the memory function setting (including data-memory) is changed (p. 146)
- when the range is changed (p. 31)
- when changing comparator settings (p. 34)
- when the scaling setting for the current range is changed (p. 44)
- when printing the statistical calculations (p. 86)
- when the DUT is changed (p. 28)
- upon system reset (p. 71)
- upon setting the auto-memory number of values to store (p. 77)
- when the instrument is turned off

Using Statistical Calculations

When statistical calculation is enabled and an EXT I/O trigger signal is applied, operation is as follows depending on the trigger source setting:

- With external (EXT) triggering: One measurement is performed and subjected to statistical calculation.
- With internal (INT) triggering: The next measured value after the trigger signal is subjected to statistical calculation.

Operation is the same in the following cases:


(Key Operations)

- when pressing the **F4** [MANU] key on the [MENU] - [TRG] selection screen
- when pressing the **F2** [PRINT] key on the Measurement screen (with internal triggering and Auto-Memory disabled. Appears only when the interface is set for the printer.)
- when acquiring measured values by the Auto-Memory function (p. 75)

(Remote Control)


- when a TRG remote control command is received
- when an EXT I/O print signal is applied on the Measurement screen (with internal triggering and Auto-Memory disabled)

1 Open the Basic Settings screen.

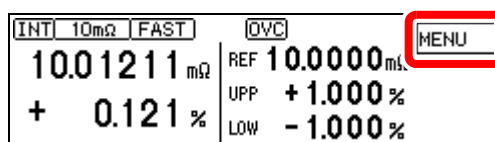


F1 ► The Basic Settings screen appears.

2 Open the Data Memory Settings screen.

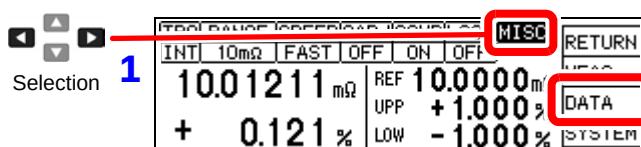


F3 ► The Data Settings screen appears. [DATA SETTINGS]

3 Enable or disable statistical calculation.

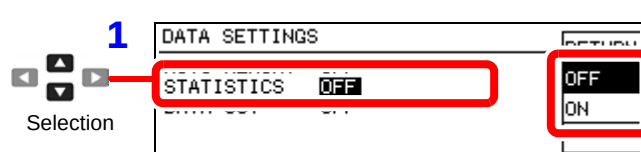


F2 Disable statistical calculation (default)
F3 Enable statistical calculation

4 Return to the Measurement screen.

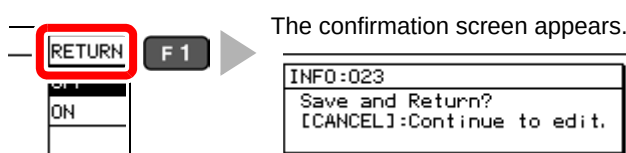

F1 Return to the setting screen.
F2 Save setting and return to previous screen.
F3 Discard setting and return to previous screen.

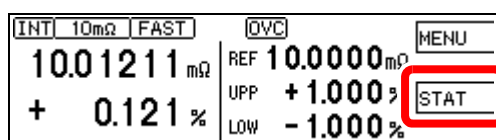

When statistical calculation is enabled, **F3** [STAT] appears on the Measurement screen. Confirm calculation results (p. 80)

Confirming, Printing, and Erasing Calculation Results

Statistical calculation results are displayed on the screen.

Printing is also available with the commercially available printer with a serial interface. Calculation results are automatically erased after printing. Before printing, select the [PRINT] interface setting.

See: "7.2 Instrument Settings" (p. 85)

The number of valid samples can be confirmed on the Calculation Results screen.

- When the number of valid samples is zero, no calculation results are displayed.
- When only one valid data sample exists, no standard deviation or process capability indices are displayed.

1 Display the Calculation Results screen.

INT 10mΩ FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ	STAT
+ 0.121 %	UPP +1.000 %	
	LOW -1.000 %	

F 3

Displays the Calculation Results screen (if statistical calculation is enabled).

STATISTICS		RETURN
Num 19	Val 17	PRINT UNDO ALLCLR
Ave 99.5153Ω	Sn 0.0015Ω	
Max 99.5183Ω	Sn1 0.0015Ω	
(No:00015)	Cp 1.00	
Min 99.5113Ω	Cpk 1.00	
(No:00001)		

Num Total data count

Ave Mean

Max Maximum

Min Minimum

Val Number of valid measured values (error-free data)

Sn Population standard deviation

Sn1 Standard deviation of sample

Cp Process capability index (dispersion)

Cpk Process capability index (bias)

2 To print

To print, select the printer as the interface setting on the System screen (p. 85)

STATISTICS		RETURN
Num 19	Val 17	PRINT
Ave 99.5153Ω	Sn 0.0015Ω	
Max 99.5183Ω	Sn1 0.0015Ω	
(No:00015)	Cp 1.00	
Min 99.5113Ω	Cpk 1.00	
(No:00001)		

F 2

Output to the printer.
"Example Printouts" (p. 87)

Statistical calculation results and stored data are erased when printing finishes.

To erase

STATISTICS		RETURN
Num 19	Val 17	UNDO
Ave 99.5153Ω	Sn 0.0015Ω	
Max 99.5183Ω	Sn1 0.0015Ω	
(No:00015)	Cp 1.00	
Min 99.5113Ω	Cpk 1.00	
(No:00001)		

F 3

Erases the last measurement and calculation result (executes only once).

F 4

Erases all measured values and statistical calculation results.

After selecting, a confirmation screen appears.

6.4 Auto-Exporting Measured Values (at End of Measurement) (Data Output Function)

At the end of measurement, the measured value is exported to a computer via RS-232C.

See: "Chapter 9 Communications (RS-232C/ GP-IB Interface)" (p. 101)

NOTE

- Set the interface to [RS232C] beforehand. This function is not applicable to the GP-IB Interface.
See: "9.4 Configuring the Communications Protocol" (p. 105)
- When internal (INT) triggering is selected, data is exported only when a $\overline{\text{TRIG}}$ signal is applied.
- Executing a :READ? query command exports duplicate measured values.
- For other queries, be careful to avoid overlapping query response timing with auto-exporting measured values.
- The data format for measured values can be selected as ASCII (default) or BINARY. Transfer time is minimized when BINARY is selected.

See: ":SYSTem:FORMat <ASCIi/ BINary>" (p. 141)

1 Open the Basic Settings screen.

The Basic Settings screen appears.

2 Open the Data Memory Settings screen.

The Data Settings screen appears.
[DATA SETTINGS]

3 Enable or disable auto-exporting (DATA OUT)

Disable auto-exporting (default)

Enable auto-exporting

4 Return to the Measurement screen.

The confirmation screen appears.

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

Printing

Chapter 7

Connecting the printer to the instrument

Make instrument settings (p. 85)

Make printer settings

Printing (p. 86)

- Measurement values and comparator decisions
- Statistical calculation results

7.1 Connecting the Printer

Before connecting the printer

WARNING

Because electric shock and instrument damage hazards are present, always follow the steps below when connecting the printer.

- Always turn off the instrument and the printer before connecting.
- A serious hazard can occur if a wire becomes dislocated and contacts another conductor during operation. Make certain connections are secure.

NOTE

- As much as possible, avoid printing in hot and humid environments. Otherwise, printer life may be severely shortened.
- Use only compatible recording paper in the printer. Using non-specified paper may not only result in faulty printing, but printing may become impossible.
- If the recording paper is skewed on the roller, paper jams may result.

Recommended printer


The requirements for a printer to be connected to the instrument are as follows. Confirm compatibility and make the appropriate settings on the printer before connecting it to the instrument.

See: "7.2 Instrument Settings" (p. 85)

- Interface RS-232C
- Characters per line At least 45
- Communication speed..... 9600 bps
- Data bits 8
- Parity none
- Stop bits..... 1
- Flow control none
- Control codes Capable of directly printing plain text



Connecting the Printer to the Instrument

Connection Methods

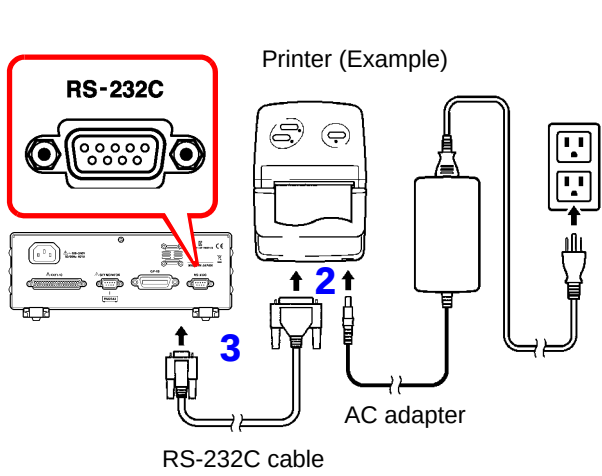


- 1 Confirm that the instrument and printer are turned off.
- 2 Connect the AC adapter to the printer, and insert the power plug into an outlet.
- 3 Connect the RS-232C cable to the RS-232C connectors on the instrument and printer.
- 4 Turn the instrument and printer on.

Connector Pinouts

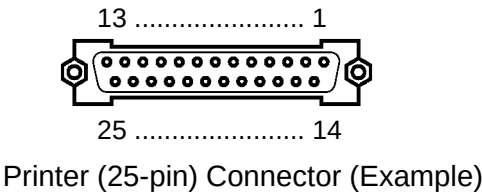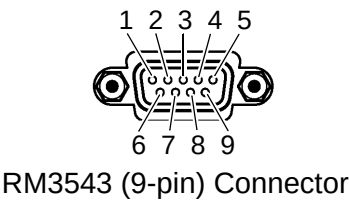

Function	Signal Name	Pin
Receive Data	RxD	2
Transmit Data	TxD	3
Signal or Common Ground	GND	5

 

Pin	Signal Name	Function
2	TxD	Transmit Data
3	RxD	Receive Data
7	GND	Signal or Common Ground
4	RTS	Request to Send
5	CTS	Clear to Send

7.2 Instrument Settings

1 Open the Basic Settings screen.

INT 10mΩ FAST	QVC	MENU
10.01211 mΩ	REF 10.0000 mΩ	
+ 0.121 %	UPP +1.000 %	
	LOW -1.000 %	

F 1

The Basic Settings screen appears.

2 Open the System screen.

Selection 1

INT 10mΩ FAST OFF ON OFF	MISC	RETURN
10.01211 mΩ	REF 10.0000 mΩ	MEAS
+ 0.121 %	UPP +1.000 %	
	LOW -1.000 %	SYSTEM

2

F 4

The System screen appears.
[SYSTEM]

3 Select PRINT as the interface type.

Selection 1

SYSTEM	RETURN
PROBE CHECK OFF	GP-IB
RETRY ON 50ms	
TRIG EDGE 1:ON EDGE	
INTERFACE PRINT	PRINT

2

F 4

To use the printer

4 Return to the Measurement screen.

Selection

RETURN
RS232C
PRINT

F 1

The confirmation screen appears.

INFO:023
Save and Return?
[CANCEL]:Continue to edit.

CANCEL
SAVE
NOSAVE

F 1

F 2

F 3

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

7.3 Printing


Before Printing

Verify that the instrument and printer settings (p. 85) are correct.

Printing Measured Values and Comparator Decisions

Printing by key operation

Press the **PRINT** key to print the measured value currently displayed on the Measurement screen.

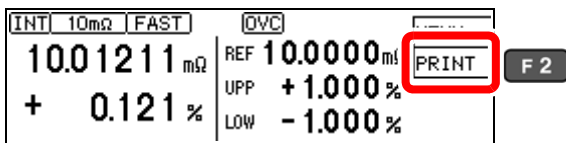

Printing by external control

Measured values and comparator decisions print when the (active-low) $\overline{\text{PRINT}}$ signal (EXT I/O connector) is connected to ISO_GND.*

* ISO_GND is a pin in the instrument's EXT I/O connector.

NOTE

When statistical calculation is enabled [STATISTIC: ON] and internal triggering [TRG: INT] is selected, statistical calculations are performed and measured values are printed. When external (EXT) triggering is selected, only measured values are printed. Use the TRIG signal to perform statistical calculations with external triggering.

Printing Statistical Calculation Results

Statistical calculation results can be printed when auto-memory or statistical calculation is enabled (ON). To print, select PRINT on the screen or connect the (active-low) $\overline{\text{PRINT}}$ signal on the EXT I/O connector to ISO_GND.


To enable auto-memory:

See: "6.2 Store as soon as Measurement is Stable (Auto-Memory Function)" (p. 75)

To enable statistical calculation:

See: "6.3 Performing Statistical Calculations on Measured Values" (p. 78)

(When statistical calculation is enabled)

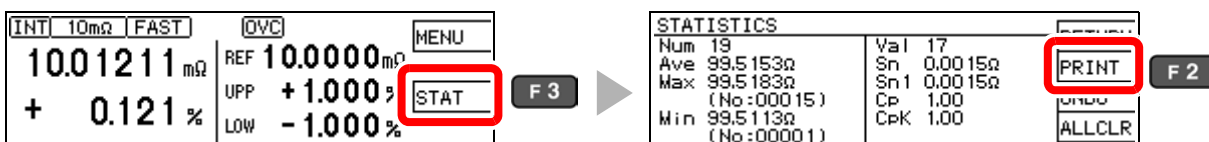

If no valid data exists, only the data count is printed. When only one valid data sample exists, standard deviation of sample and process capability indices cannot be printed.

Example Printouts**Resistance measurements**

```

1    0.8725mOhm Lo
2    0.484mOhm Lo
3   10.99998 Ohm IN
4   -10.0026 Ohm Lo
27    9.9986 Ohm Hi
28    9.996 Ohm Hi
29    0.01003 Ohm Hi
30    0.00012 Ohm Hi

```

Measurement fault values

```

1    OvrRng      Hi
2   -OvrRng      Lo
3    C.E.Hi      --
4    C.E.Lo      --
5    C.E.Volt     --
6    -----     --

```

Auto-memory data and statistical calculation results

```

Date: 11-02-01   Time: 06:18:00
Ref: 1000.000 Ohm Upp: +1.000% Low: -1.500%
1    999.885 Ohm  -0.011% IN
2   1001.885 Ohm  +0.189% IN
3   1002.394 Ohm  +0.239% IN
4   1002.892 Ohm  +0.289% IN
5   1012.894 Ohm  +1.289% Hi
6   1000.897 Ohm  +0.090% IN
7    998.902 Ohm  -0.110% IN
8    994.888 Ohm  -0.511% IN
9   1000.391 Ohm  +0.039% IN
10   979.892 Ohm  -2.011% Lo
Hi:    1  IN:    8  Lo:    1  OR:    0
Number: 10  Valid: 10
Max   1012.894 Ohm  +1.289% (    5)
Min    979.892 Ohm  -2.011% (   10)
Avg    999.492 Ohm  -0.051%
Sn      7.83568 Ohm
Sn-1    8.25953 Ohm
Cp        0.50
CpK       0.42

```

- The "Valid" statistical calculation result indicates the number (count) of data samples not subject to errors such as measurement faults.
- Among the comparator decision result counts (Hi, IN, Lo, and OR), "OR" indicates the number (count) of out-of-range measurements.


External Control Chapter 8

The EXT I/O connector on the rear of the instrument supports external control by providing output of the end-of-measurement and comparator decision signals, and accepting input of measurement trigger and key-lock signals. All signals are isolated by optocouplers (inputs and outputs share a common signal ground).

Confirm input and output ratings, understand the safety precautions for connecting a control system, and use accordingly.

Connect the instrument's EXT I/O connector to the signal output or input device.

Make instrument settings (p. 97)

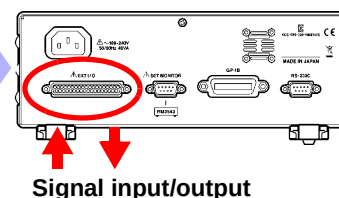

8.1 External Input/Output Connector and Signals



WARNING

To avoid electric shock or damage to the equipment, always observe the following precautions when connecting to the EXT I/O terminals.

- Always turn off the power to the instrument and to any devices to be connected before making connections.
- Be careful to avoid exceeding the ratings of external terminals (p. 95).
- During operation, a wire becoming dislocated and contacting another conductive object can be serious hazard. Use screws to secure the external connectors.
- Ensure that devices and systems to be connected to the EXT I/O terminals are properly isolated.
- The ISO_5V pin of the EXT I/O connector is a 5 V power output, and the ISO_12V pin is a 12 V power output. Do not apply external power to this pin.


CAUTION

To avoid damage to the instrument, observe the following cautions:

- Do not apply voltage or current to the EXT I/O terminals that exceeds their ratings.
- When driving relays, be sure to install diodes to absorb counter-electromotive force.
- Be careful not to short-circuit ISO_5V to ISO_COM.
- Be careful not to short-circuit ISO_12V to ISO_COM.
- Do not draw loads from ISO_5V and ISO_12V at the same time.


See: "Connector Type and Signal Pinouts" (p. 90)

Connector Type and Signal Pinouts

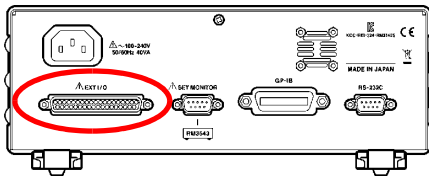

Connector: (Instrument Side)
37-pin D-sub female with #4-40 screws

Mating Connectors:
DC-37P-ULR (solder type) /
DCSP-JB37PR (pressure weld type)
Japan Aviation Electronics Industry Ltd.

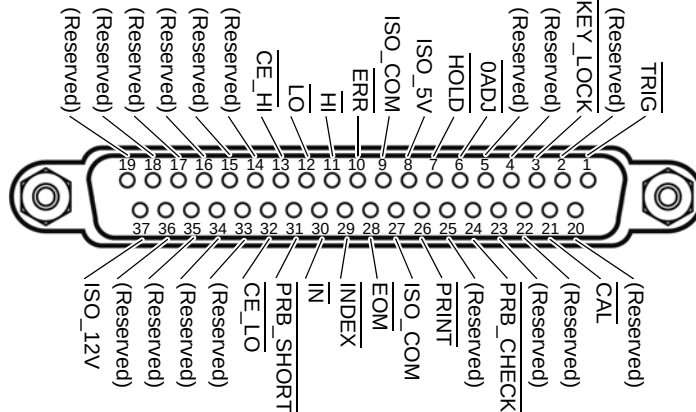

EXT I/O Connector (Instrument Side)

Pos: positive, Neg: negative, -: not applicable

Pin	Signal name	I/O	Function	Logic
1	TRIG	IN	External trigger	Pos/ Neg Edge
2	(Reserved)	—	—	— —
3	KEY_LOCK	IN	Key-Lock	Neg Level
4	(Reserved)	—	—	— —
5	(Reserved)	—	—	— —
6	OADJ	IN	Execute zero-adjust	Neg Edge
7	HOLD	IN	Enable external triggering	Neg Level
8	ISO_5V	—	Isolated 5 V power output	— —
9	ISO_COM	—	Isolated common signal ground	— —
10	ERR	OUT	Measurement fault	Neg Level
11	HI	OUT	HI comparator decision	Neg Level
12	LO	OUT	LO comparator decision	Neg Level
13	CE_HI	OUT	Probe (HI side) contact error	Neg Level
14	(Reserved)	—	—	— —
15	(Reserved)	—	—	— —
16	(Reserved)	—	—	— —
17	(Reserved)	—	—	— —
18	(Reserved)	—	—	— —
19	(Reserved)	—	—	— —

Pin	Signal name	I/O	Function	Logic
20	(Reserved)	—	—	— —
21	CAL	IN	Execute self-calibration	Neg Edge
22	(Reserved)	—	—	— —
23	(Reserved)	—	—	— —
24	PRB_CHECK	IN	Execute probe short-circuit detection	Neg Edge
25	(Reserved)	—	—	— —
26	PRINT	IN	Print measured value	Neg Edge
27	ISO_COM	—	Isolated common signal ground	— —
28	EOM	OUT	End of measurement	Neg Edge
29	INDEX	OUT	Analog measurement finished	Neg Edge
30	IN	OUT	IN comparator decision	Neg Level
31	PRB_SHORT	OUT	Probe short-circuit error	Neg Level
32	CE_LO	OUT	Probe (LO side) contact error	Neg Level
33	(Reserved)	—	—	— —
34	(Reserved)	—	—	— —
35	(Reserved)	—	—	— —
36	(Reserved)	—	—	— —
37	ISO_12V	—	Isolated 12 V power output	— —

Reserved pins are not connected inside the instrument.
Do not connect to reserved pins.

NOTE

- The OADJ signal should be asserted (Low) for at least 10 ms.
- The connector shell is conductively connected to the metal instrument chassis and the protective earth pin

Signal Descriptions

Input Signals

TRIG	When external triggering (EXT) is enabled, one measurement is performed at the falling (ON) or rising (OFF) edge of the TRIG signal. Falling (ON) or rising (OFF) edge triggering can be selected on the Settings screen (default: falling (ON) edge). When internal triggering (INT) is enabled, external triggering is disabled. Also, when the Settings Monitor function is enabled and an error occurs, triggering is disabled (p. 56). The TRIG signal performs the following operations in addition external triggering: - Stores statistical calculation data (when statistical calculation is enabled) - Stores measured data to internal memory (when the data memory function is enabled) (also operates with internal triggering)	(p. 98)
0ADJ	Asserting the 0ADJ signal executes zero adjustment once. To avoid malfunction, this signal should be asserted (Low) for at least 10 ms.	(p. 32)
PRINT	Asserting the PRINT signal prints the current measurement value.	(p. 86)
CAL	Asserting the CAL signal executes self calibration. The time required for self calibration is as follows: Approximately 130 ms (with 60-Hz line frequency setting), or 110 ms (with 50-Hz setting) If asserted during measurement, executes after the end of measurement.	(p. 60)
HOLD	Holding the HOLD signal low enables external triggering. When the HOLD signal is high, the settings made on the Settings screen or by commands are re-enabled.	
PRB_CHECK	Asserting the PRB_CHECK signal executes probe short-circuit adjustment one time. If asserted during measurement, executes after the specified time from the end of measurement.	(p. 54)
KEY_LOCK	While the KEY_LOCK signal is held low, all front panel keys (except POWER button) are disabled (key unlock and remote control cancellation operations are also disabled).	(p. 63)

Output Signals


ERR	This signal indicates that a measurement fault has occurred (except out-of-range detection). It is updated simultaneously with the EOM signal. At this time, comparator decision outputs are all de-asserted (high).	(p. 38)
CE_HI	This signal indicates that a contact check error has occurred between H _{CUR} and H _{POT} contacts. It is updated simultaneously with the EOM signal. At this time, comparator decision outputs are all de-asserted (high).	(p. 49)
CE_LO	This signal indicates that a contact check error has occurred between L _{CUR} and L _{POT} contacts. It is updated simultaneously with the EOM signal. At this time, comparator decision outputs are all de-asserted (high).	(p. 49)
PRB_SHORT	This signal indicates that a foreign object is shorting the POT and CUR contacts in a four-terminal probe tip. At this time, comparator decision outputs are all de-asserted (high).	(p. 54)
INDEX	This signal indicates that A/D conversion in the measurement circuit is finished. When the asserted (low) state occurs, the measurement sample can be removed.	
EOM	This signal indicates the end of a measurement. At this time, the states of the comparator decision outputs and ERR, CE_HI, CE_LO, and PRB_SHORT are all determined.	(p. 97)
HI, IN, LO	These are the comparator decision output signals.	

NOTE

- Input signals are ignored when the following are displayed: Basic, Detailed, and Comparator Settings screens; Statistical Calculation Results screen (except for the print signal); and error messages (except Setting Monitor errors).
- EXT I/O input and output signals are not usable while changing measurement settings.

8.2 Timing Chart

Each signal level indicates a corresponding voltage level.

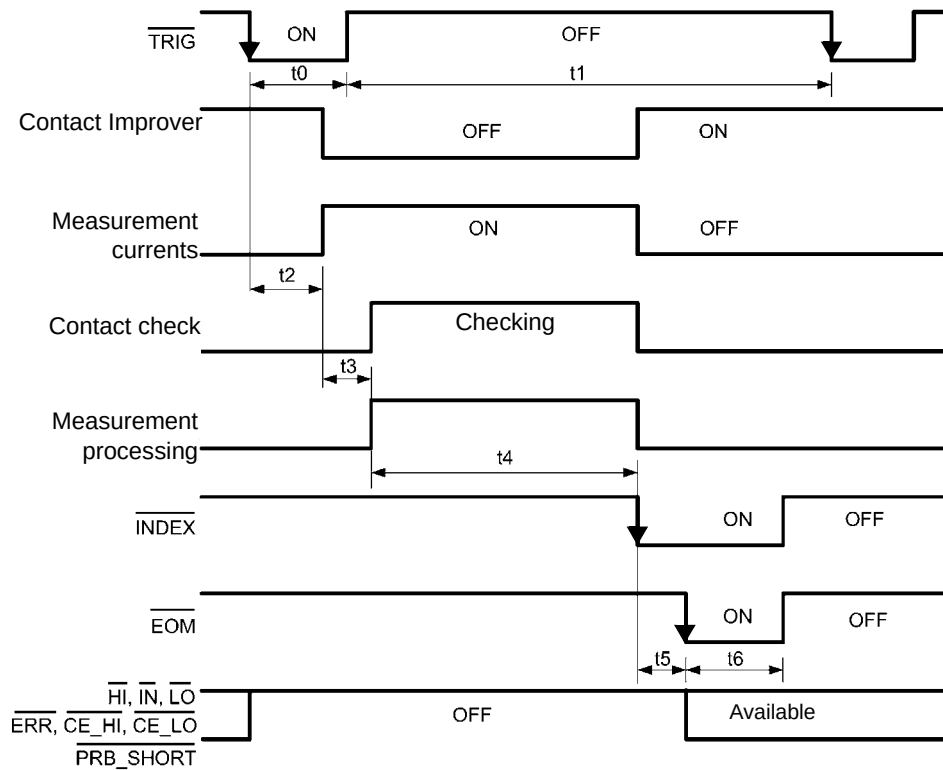


NOTE

- The $\overline{\text{EOM}}$ signal is operational when the trigger source setting is EXT and the EOM output setting is Pulse.
- A self-calibration measurement (approximately 130 ms) is automatically performed every 10 minutes (between measurements). $\overline{\text{TRIG}}$ signal input is accepted during that time, but the corresponding measurement is delayed until self-calibration is finished.
- Do not apply a $\overline{\text{TRIG}}$ signal while measuring using external triggering (the signal is ignored).
- When changing settings such as measurement range, allow about 150 ms processing time before applying a $\overline{\text{TRIG}}$ signal.
- Input signals are ignored when the following are displayed: Basic, Detailed, and Comparator Settings screens; Statistical Calculation Results screen (except for the print signal); and error messages (except Setting Monitor errors).
- The $\overline{\text{INDEX}}$ and $\overline{\text{EOM}}$ signals are de-asserted simultaneously.
- Output of comparator decisions and error signals are determined before the $\overline{\text{EOM}}$ signal is asserted.
- With internal (INT) triggering, the $\overline{\text{EOM}}$ signal is fixed High (OFF). Also, comparator decisions and error signals are not de-asserted (OFF) when measurement starts.
- When using the internal trigger [INT], the setting for the DELAY1 (t2) time is increased by 100 ms.

EOM operation when the $\overline{\text{EOM}}$ Output setting is Hold

The $\overline{\text{EOM}}$ signal is asserted (ON) at the end of measurement.

The $\overline{\text{EOM}}$ signal continues to be asserted until measurement starts again with the next $\overline{\text{TRIG}}$ signal input.

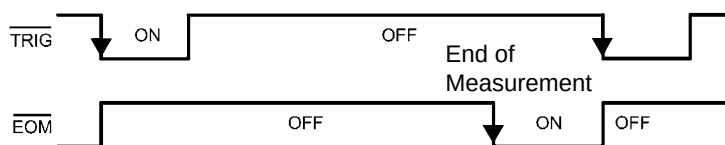


See: "Setting End-of-Measurement Signal Output (EOM Signal Setting)" (p. 97)

NOTE

Output Signal State at Power-On

All signals are low (asserted active-low) when power is turned on.

All output signals become high (de-asserted active-low) when changing from the initial screen to the Measurement screen.

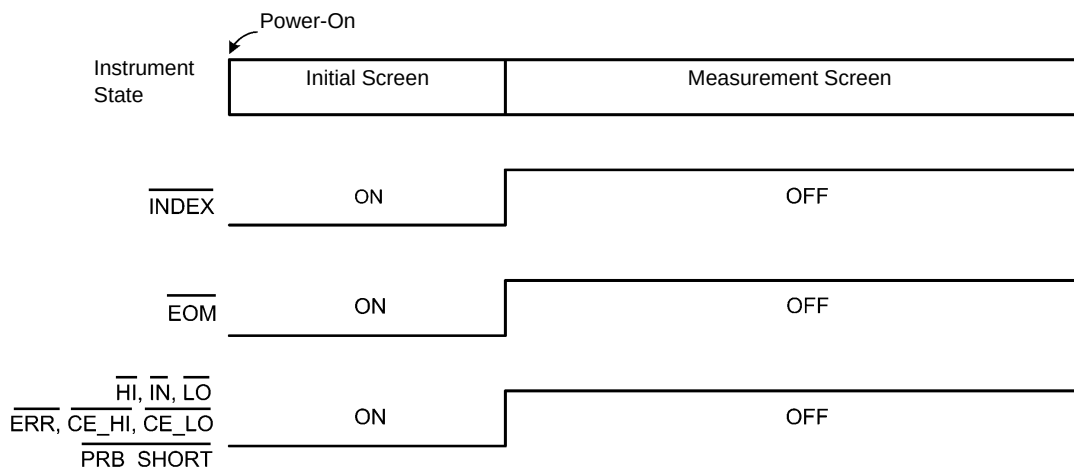

Operation is shown when the trigger source is set to external triggering (EXT).

Timing Chart Interval Descriptions

Interval	Description	Duration	Remarks
t0	Trigger Pulse Asserted (ON)	0.1 ms or more	Falling (ON)-/rising (OFF)-edge selectable
t1	Trigger Pulse De-asserted (OFF)	0.1 ms or more	
t2	Delay 1	0 to 100 ms	Setting-dependent (when using the internal trigger, increased by 100 ms)
t3	Delay 2	0 to 100 ms	Setting-dependent (When the Contact Improver function is set to Pulse, 0.1 ms is added.)
t4 *1	Measurement time	0.1 to 100 ms	OVC OFF: Integration Time + Internal Delay (see following table) OVC ON: (Integration Time + Internal Delay) × 2 + Delay2
t5	Calculation time	0.1 ms	Calculation time is longer when memory storage is enabled.
t6	EOM pulse width	1 to 100 ms	Setting-dependent


*1: When the averaging function is on, the processing (t3 + t4) (time) is repeated the set number of times.

Internal Delay


Range	Internal Delay [ms]
10mΩ	3.5
100mΩ (1A)	1.6
100mΩ (100mA)	1.4
1000mΩ	0.7
10Ω	0.5
100Ω	0.5
1000Ω	0.5

8.3 Internal Circuitry

Input Circuit

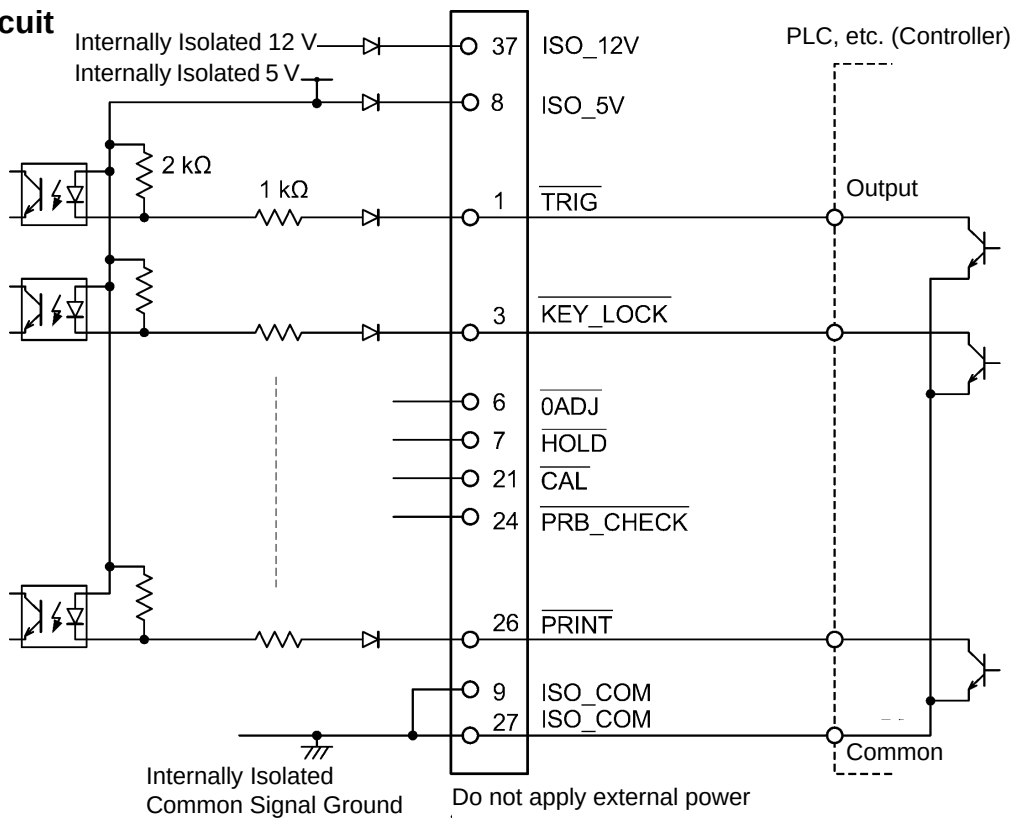

Output Circuit




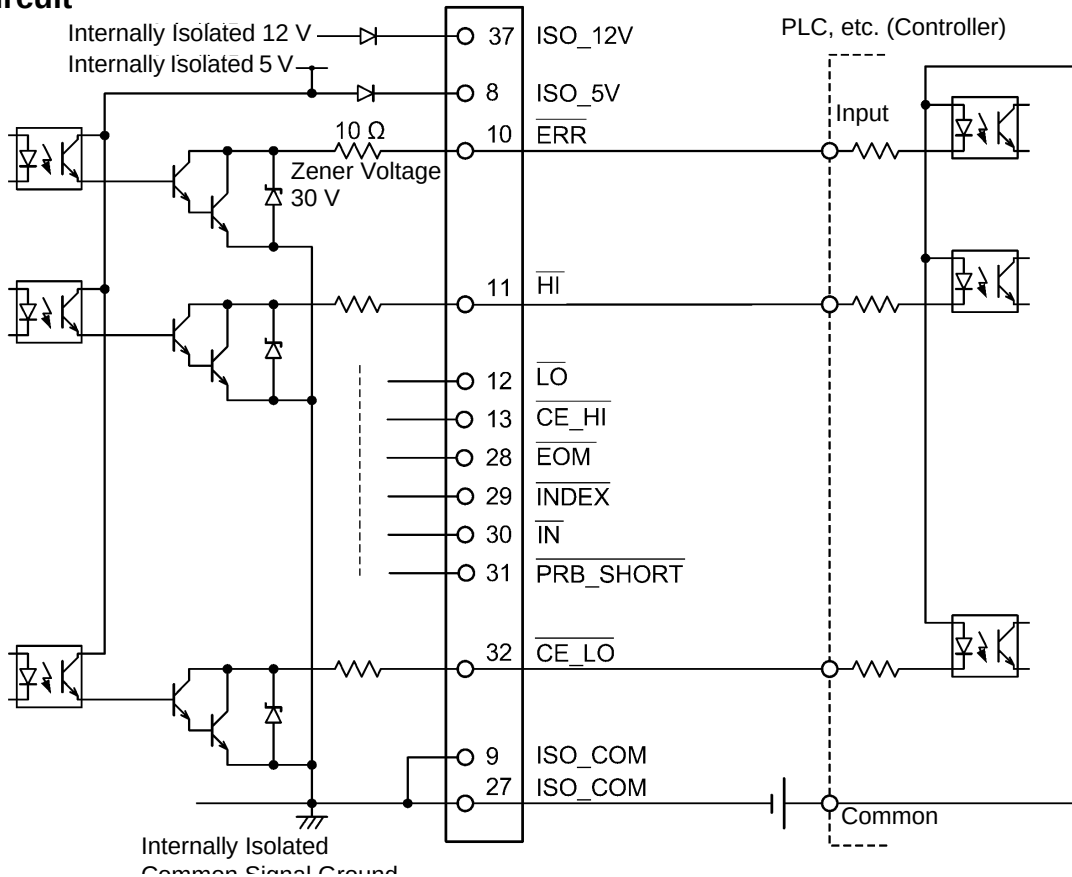


Electrical Specifications







Input Signals	Input type	Optocoupler-isolated, non-voltage contact inputs (source input, active-low)
	Input asserted (ON) voltage	1 V or less
	Input de-asserted (OFF) voltage	Open or 5 to 30 V
	Input asserted (ON) current	3 mA/ch
	Maximum applied voltage	30 V
Output Signals	Output type	Optocoupler-isolated npn open-collector outputs (current sink, active-low)
	Maximum load voltage	30 V
	Maximum output current	50 mA/ch
	Residual voltage	1 V (10 mA), 1.5 V (50 mA)
Internally Isolated Power Output	+5 V power output	
	Output Voltage	4.5 to 5.0 V
	Maximum output current	100 mA
	+12 V power output	
	Output Voltage	11.0 to 13.0 V
	Maximum output current	20 mA
	External power input	none
	The maximum output current figures for the +5 V and +12 V power outputs assume standalone use. Do not draw loads from the power supplies at the same time.	

Connection Examples

Input Circuit Connection Examples

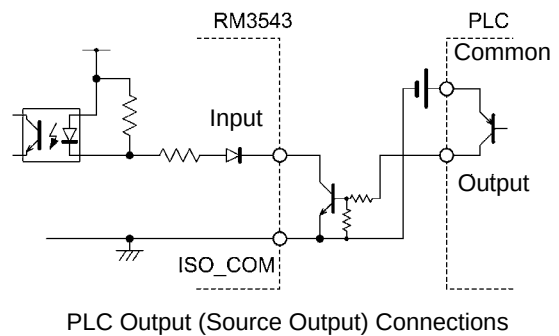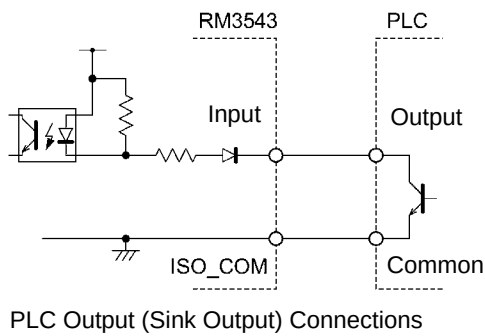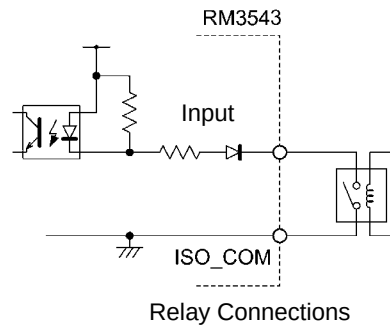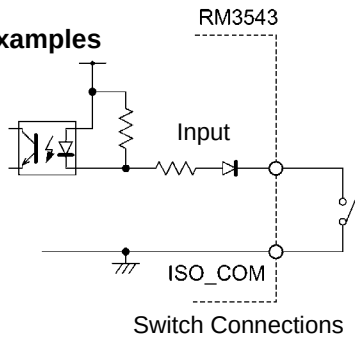

Output Circuit Connection Examples

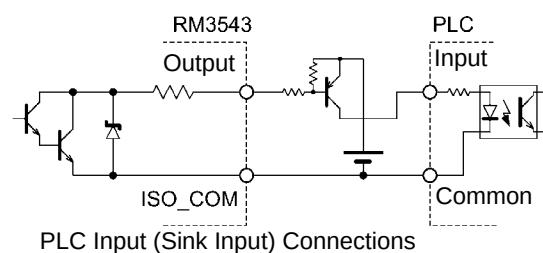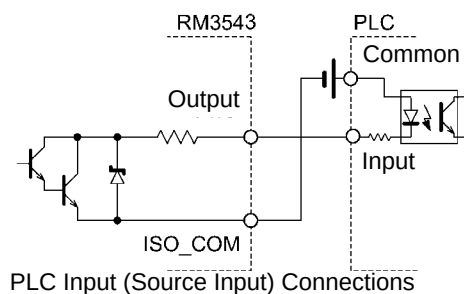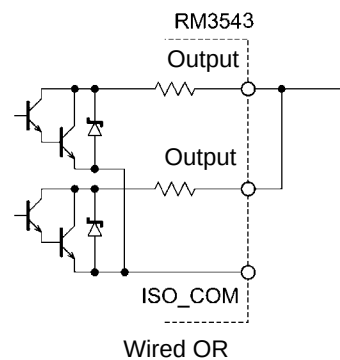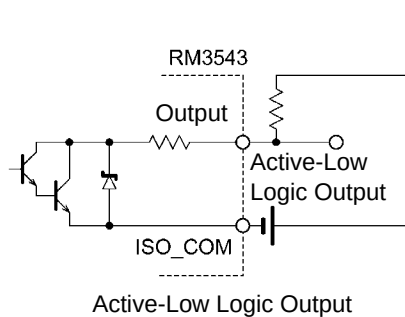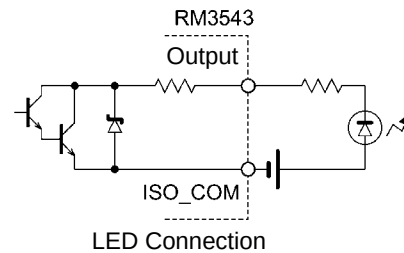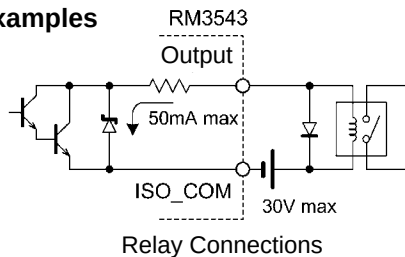

8.4 External I/O Settings

These settings affect the logic of the end-of-measurement and trigger signals.

Setting End-of-Measurement Signal Output (EOM Signal Setting)

The selected EOM output level is retained until the next trigger input, or for the specified pulse width.

1 Open the Basic Settings screen.

INT	10mΩ	FAST	QVC	MENU
10.01211 mΩ		REF 10.0000 mΩ		F1
+ 0.121 %		UPP +1.000 %		
		LOW -1.000 %		

The Basic Settings screen appears.

2 Open the System screen.

Selection	1	INT	10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
		10.01211 mΩ	REF	10.0000 mΩ	MEAS				
		+ 0.121 %	UPP	+1.000 %					
			LOW	-1.000 %				SYSTEM	F4

The System screen appears.
[SYSTEM]

3 Select the EOM signal output type.

Selection	1	SYSTEM		2
		SET MONITOR	OFF	PULSE
		PROBE CHECK	OFF	HOLD
		RETRY	ON	
		RETRY	ON	
		TRIG EDGE	50ms	
		EOM	PULSE	5 ms

The specified pulse is output after end-of-measurement (default).

The EOM signal remains asserted after end-of-measurement (to step 5).

4 (When PULSE is selected) Select the pulse width.

Selection	1	SYSTEM	(NUM)	RETURN
		SET MONITOR	OFF	
		PROBE CHECK	OFF	
		RETRY	ON	50ms
		TRIG EDGE	1:ON ED	
		EOM	PULSE	5 ms

2 0 9 Setting range: 1 ms to 100 ms (default: 5 ms)

3 ENTER

5 Return to the Measurement screen.

RETURN	F1	INFO:023	CANCEL	F1
		Save and Return?	SAVE	F2
		[CANCEL]:Continue to edit.	NOSAVE	F3

The confirmation screen appears

Return to the setting screen.

Save setting and return to previous screen.

Discard setting and return to previous screen.

8


Setting the Trigger (TRIG) Signal Logic

Select whether triggering occurs on the falling (ON) or rising (OFF) edge.


1 Open the Basic Settings screen.




2 Open the System screen.

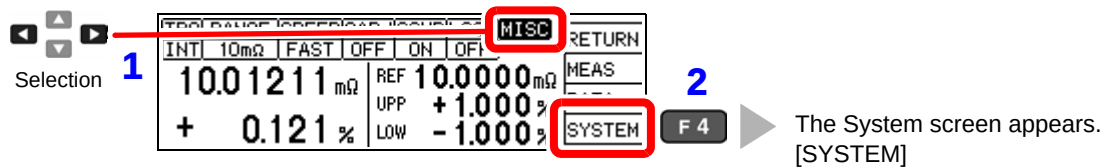

3 Select the triggering logic edge.

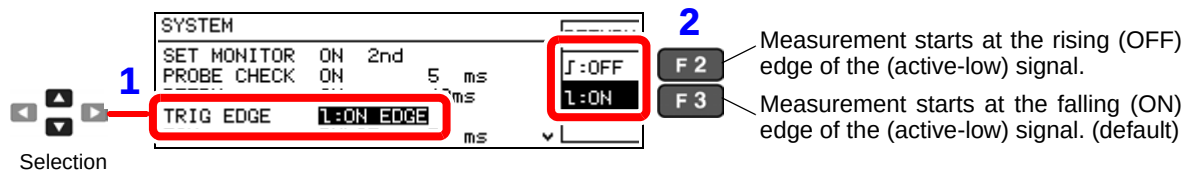

4 Return to the Measurement screen.

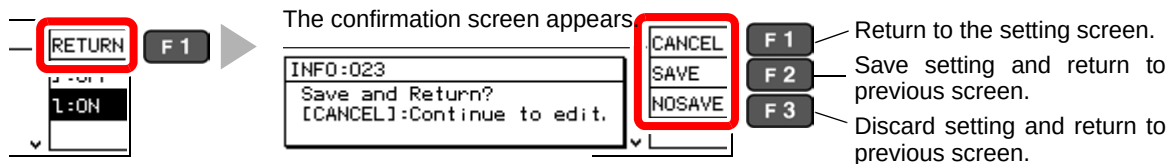

8.5 External Control Q&A

Common Questions	Answers
How do I connect external trigger input?	Connect the (active low) $\overline{\text{TRIG}}$ input pin to an ISO_COM pin using a switch or open-collector output.
Which pins are common ground for input and output signals?	The ISO_COM pins.
Are the common (signal ground) pins shared by both inputs and outputs?	Both common ground pins can be shared by inputs and outputs.
How do I confirm output signals?	Confirm voltage waveforms with an oscilloscope. To do this, the output pins such as $\overline{\text{EOM}}$ and comparator decision outputs need to be pulled up (through several k Ω).
How do I troubleshoot input (control) signal issues?	For example, if triggering does not operate properly, bypass the PLC and short the TRIG pin directly to an ISO_COM pin. Be careful to avoid power shorts.
Are the comparator decision signals retained during measurement (or can they be off)?	The state is determined at the end of measurement, and is off once at the start of measurement.
Why would the $\overline{\text{EOM}}$ signal not be detected?	Try using the Pulse setting for $\overline{\text{EOM}}$ output. When the measurement time is short and $\overline{\text{EOM}}$ output is set to Hold, the time to de-assert may be too short to be detected by the PLC. When the $\overline{\text{EOM}}$ output is set to Pulse, the signal is asserted (ON) for the specified pulse width before turning off.
What situations cause measurement faults to occur?	An error is displayed in the following cases: • A probe is not connected • A contact is unstable • A probe or measurement object is dirty or corroded • Measurement object resistance is much higher than the measurement range
Is a connector or flat cable for connection provided?	A solder-type connector is supplied. The cable must be prepared at the user's side.
Is direct connection to a PLC possible?	Direct connection is supported for relay or open-collector outputs and positive-ground optocoupler inputs. (Before connecting, confirm that voltage and current ratings will not be exceeded.)
Can external I/O be used at the same time as RS-232C or other communications?	After setting up communications, it is possible to control measurement with the TRIG signal while acquiring measurement data via a communications interface.
How should external power be connected?	The instrument's external I/O input and output signals all operate from an internal isolated power source, so power must not be supplied from the PLC side.
Can free-running measured values be acquired using a footswitch?	Please use the free software for acquiring measured values available for download from our website.

8.6 Supplied Connector Assembly

The EXT I/O connector and shell are supplied with the instrument. Assemble as shown below.

NOTE


- Use shielded cables to connect a PLC to the EXT I/O connector. Using non-shielded conductors may result in system errors from electrical noise.
- Connect the shield to the ISO_COM pin of the EXT I/O connector.

Required tools:

- Screwdriver
- Shielded cable
- Soldering iron

Accessories

- **A** Cover.....2
- **B** Screws (+/-) #4-40UNC (16.9 mm overall length)2
- **C** Screws (+/-) #4-40UNC (12.6 mm overall length)2
- **D** Screws (-) #4-40UNC (15.0 mm overall length)2
- **E** Nuts #4-40UNC2
- **F** Cable Clamps.....2
- **G** Saddle Washers (shell protection).....2
- **H** Connector1

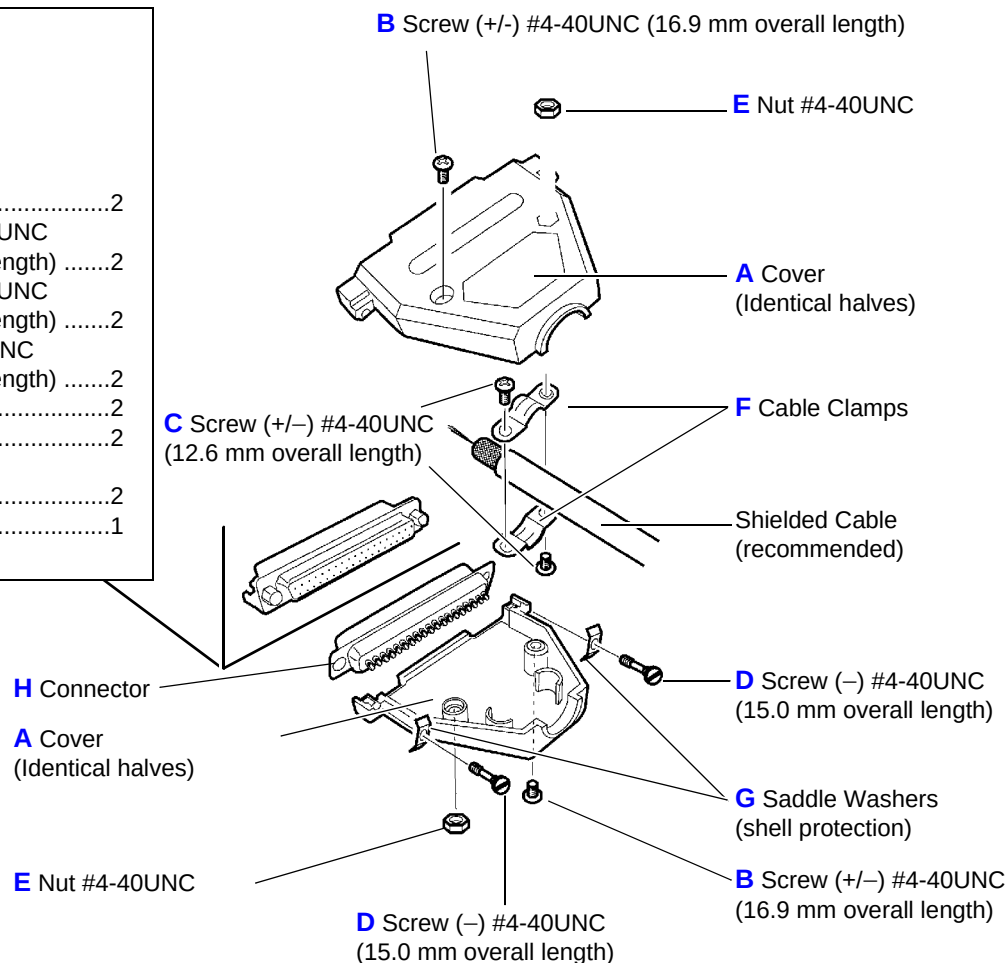

Assembly Sequence

1. Solder the (shielded) cable wires to the supplied EXT I/O connector (H) pins.
 2. Affix the cable clamps (F) on the cable with screws (C).
 3. Position the cable clamps (F) to fit properly inside the cover (A).
 4. Insert screws (D) through the saddle washers (G).
 5. In one half of cover (A), place connector (H), clamps (F), saddle washers (G) and screws (D).
 6. Place the other half of cover (A) on top.
 7. Affix the halves of the cover (A) together with screws (B) and nuts (E).
- Be careful not to overtighten the screws, which could damage the covers.**

Communications (RS-232C/ GP-IB Interface)

Chapter 9

The symbols shown below indicate that the following instructions are specific to the RS-232C or the GP-IB interface. Instructions without these symbols are for both the RS-232C and the GP-IB interface.

RS-232C : RS-232C only/ **GP-IB** : GP-IB only

Before Use


- Always make use of the connector screws to affix the GP-IB or RS-232C connectors.
- When issuing commands that contain data, make certain that the data is provided in the specified format.
- External command operation is undetermined when the Printer is selected as the interface type. In this case, commands should not be sent.

Wiring Diagram (p. 103)

Connect the Instrument and Controller with a GP-IB or RS-232C Interface Cable

Communications Protocol Settings (p. 105)

- GP-IB** Entering an address
- RS-232C** Set the instrument to the same communications protocol as the controller
- Select the transmission format

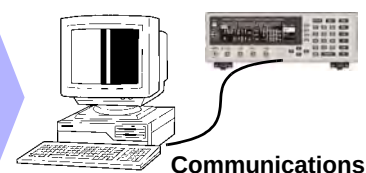

9.1 Overview and Features

The instrument can be controlled by GP-IB or RS-232C. Instrument settings can also be reset.

RS-232C Using the RS-232C, the measurement values can be printed out by connecting the instrument to the commercially available printer with a serial interface (p. 83).

GP-IB IEEE 488.2-1987 standard (essential) commands can be used.

- Applicable standard IEEE 488.1-1987^{*1}
- Reference standard IEEE 488.2-1987^{*2}

If the output queue becomes full, a query error is generated and the output queue is cleared. Therefore, clearing the output queue and query error output from the deadlocked condition^{*3} as defined in IEEE 488.2 is not supported.

For details about the communications commands, see "Message Format" (p. 109) and "Message Reference Interpretation" (p. 126)

^{*1}. ANSI/IEEE Standard 488.1-1987, IEEE Standard Digital Interface for Programmable Instrumentation

^{*2}. ANSI/IEEE Standard 488.2-1987, IEEE Standard Codes, Formats, Protocols, and Common Commands

9.2 Specifications

RS-232C and GP-IB communications cannot be used simultaneously.

RS-232C Specifications

Transfer method	Communications: Full duplex Synchronization: Start-stop synchronization
Baud rate	9,600 bps/ 19,200 bps/ 38,400 bps
Data length	8 bits
Parity	none
Stop bit	1 bit
Message terminator (delimiter)	Receiving: CR or CR+LF Transmitting: CR+LF
Flow control	none
Electrical specification	Input voltage levels 5 to 15 V: ON, -15 to -5 V: OFF Output voltage levels 5 to 9 V: ON, -9 to -5 V: OFF
Connector	RS-232C Interface Connector Pinout (Male 9-pin D-sub, with #4-40 attachment screws) The I/O connector is a DTE (Data Terminal Equipment) configuration Recommended cables: Model 9637 RS-232C Cable (for PC) Model 9638 RS-232C Cable (for D-sub25pin connector)

Operating Code: ASCII codes

GP-IB Specifications (Interface Functions) (RM3543-01 only)

SH1	All Source Handshake functions	●
AH1	All Acceptor Handshake functions	●
T6	Basic talker functions	●
	Serial poll function	●
	Talk-only mode	—
	The talker cancel function with MLA (My Listen Address)	●
L4	Basic listener functions	●
	Listen-only mode	—
	The listener cancel function with MTA (My Talk Address)	●
SR1	All Service Request functions	●
RL1	All Remote/Local functions	●
PP0	Parallel Poll function	—
DC1	All Device Clear functions	●
DT1	All Device Trigger functions	●
C0	No Controller functions	—

Operating Code: ASCII codes

9.3 Connecting



WARNING

Always turn both devices OFF when connecting and disconnecting an interface connector. Otherwise, an electric shock accident may occur.




CAUTION


- To avoid damage to the instrument, do not short-circuit the terminal and do not input voltage to the terminal.
- If the connectors are not securely mated, operation may fail to meet specifications, and damage could result.

Using the RS-232C Interface

Connect the RS-232C cable to the RS-232C connector.

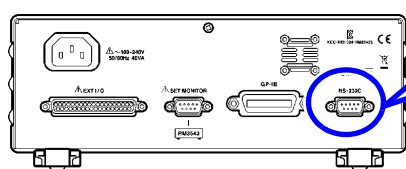

Rear Panel

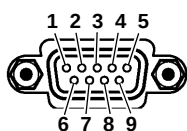

Male 9-pin D-sub
#4-40 attaching screws

To connect the instrument to a controller (DTE), use a crossover cable compatible with the connectors on both the instrument and the controller.


The I/O connector is a DTE (Data Terminal Equipment) configuration. This instrument uses only pins 2, 3, and 5. The other pins are unconnected.

Pin No	Signal Name	Code Addr.		Mutual connection circuit name	Remarks
		EIA	JIS		
1	DCD	CF	CD	Carrier Detect	Not used
2	RxD	BB	RD	Receive Data	
3	TxD	BA	SD	Transmit Data	
4	DTR	CD	ER	Data Terminal Ready	Active (ON) level is +5 to +9 V (constant)
5	GND	AB	SG	Signal Ground	
6	DSR	CC	DR	Data Set Ready	Not used
7	RTS	CA	RS	Request to Send	Active (ON) level is +5 to +9 V (constant)
8	CTS	CB	CS	Clear to Send	Not used
9	RI	CE	CI	Ring Indicator	Not used

9.3 Connecting

Connecting a controller with a 9-pin D-sub male port


Use a crossover cable with female 9-pin D-sub connectors.

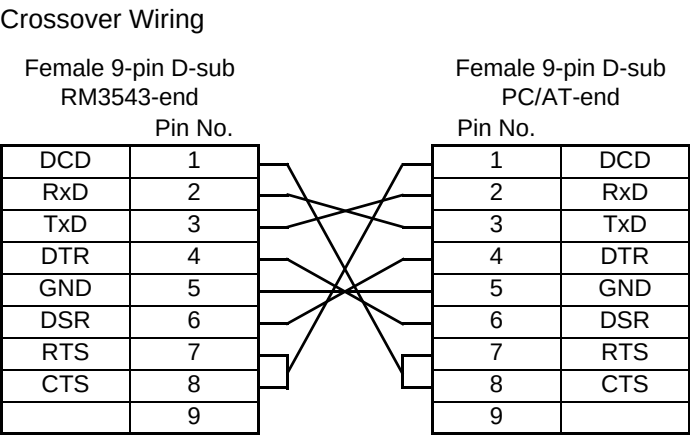

Recommended cable: HIOKI Model 9637 RS-232C Cable (1.8 m)

Connecting a controller with a 25-pin D-sub female port

Use a crossover cable with a female 9-pin D-sub and a male 25-pin D-sub connector.
As the figure shows, RTS and CTS pins are shorted together and crossed to DCD in the other connector.

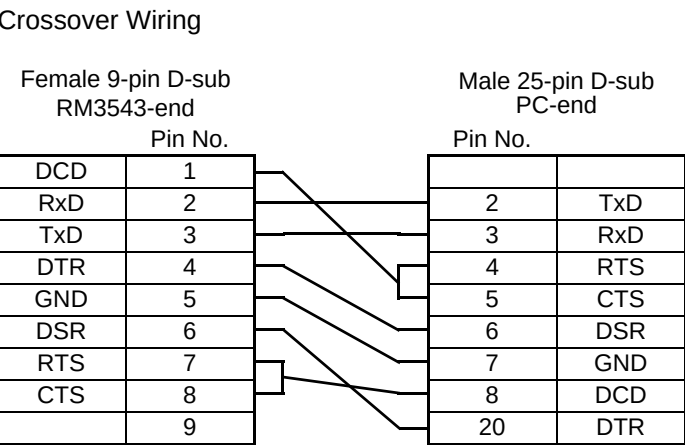


Note that the combination of a dual male 25-pin D-sub cable and a 9- to 25-pin adapter cannot be used.

Recommended cable: HIOKI Model 9638 RS-232C Cable

Using the GP-IB Interface (RM3543-01 only)

Connect the GP-IB cable to the GP-IB connector.

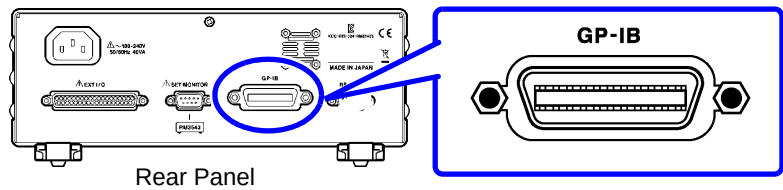

Recommended cable:
HIOKI Model 9151-02 GP-IB Connector
Cable (2 m)

9.4 Configuring the Communications Protocol

Configuring RS-232C Interface Communications

Configure the interface on the System screen.


External command operation is undetermined when the Printer is selected as the interface type. In this case, commands should not be sent.

Make these instrument settings.


1 Open the Basic Settings screen.




2 Open the System screen.

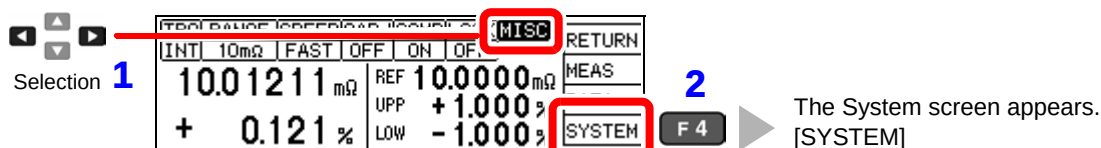


3 Select the interface type.

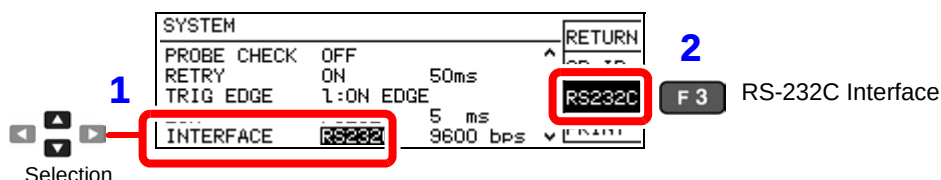

4 Select the interface transfer rate.

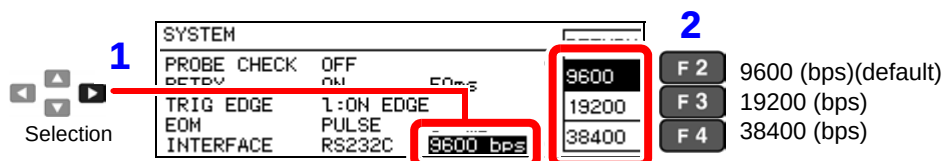

5 Return to the Measurement screen.

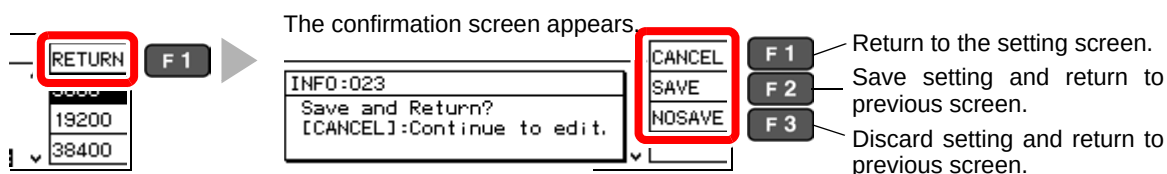

Configure the controller (PC or PLC).

Be sure to make set up the controller as shown below.

- Asynchronous communication
- Transfer rate: 9600bps/ 19200bps/ 38400bps (set to match the instrument setting)
- Stop bit: 1
- Data length: 8
- Parity check: None

Configuring GP-IB Interface Communications (RM3543-01 only)

Set the GP-IB address and message terminator on the System screen.

1 Open the Basic Settings screen.

INT 10mΩ	FAST	OVC	MENU
10.01211 mΩ	REF 10.0000 mΩ		
+ 0.121 %	UPP +1.000 %		
	LOW -1.000 %		

F1

The Basic Settings screen appears.

2 Open the System screen.

INT 10mΩ	FAST	OFF	ON	OFF	MISC	RETURN
10.01211 mΩ	REF 10.0000 mΩ					
+ 0.121 %	UPP +1.000 %					
	LOW -1.000 %				SYSTEM	

F4

The System screen appears.
[SYSTEM]

3 Select the interface type.

SYSTEM					
PROBE CHECK	OFF				
RETRY	ON	50ms			
TRIG EDGE	1:ON EDGE				
EOM	PULSE	5 ms			
INTERFACE	GP-IB				

F2

GP-IB Interface

4 Select the instrument's address.

SYSTEM					
PROBE CHECK	OFF				
RETRY	ON	50ms			
TRIG EDGE	1:ON EDGE				
EOM	PULSE	5 ms			
INTERFACE	GP-IB				

0 ... 9 0 to 30 (default: 1)

ENTER

5 Select the interface message terminator.

SYSTEM					
PROBE CHECK	OFF				
RETRY	ON	50ms			
TRIG EDGE	1:ON EDGE				
EOM	PULSE	5 ms			
INTERFACE	GP-IB				

F2

LF (default)

F3

CRLF

6 Return to the Measurement screen.

RETURN			
CRLF			

The confirmation screen appears

CANCEL
SAVE
NOSAVE

F1

Return to the setting screen.

F2

Save setting and return to previous screen.

F3

Discard setting and return to previous screen.

NOTE

"GP-IB" is only displayed on model RM3543-01 (equipped with GP-IB).

Select the Measurement Data Transmission Format (both RS-232C and GP-IB)

Use communications commands to set the measurement data transmission format to ASCII or binary.

See: ":SYSTem:FORMat <ASCIi/ BINary>" (p. 141)


This setting applies only to data sent in response to the following query messages:

- **:FETCh?**
- **:READ?**
- **:MEMory:DATA?**

It also applies to data output sent by the measurement output functions.

Binary Data Format

Binary data is IEEE format single-precision (32-bit) floating-point values.

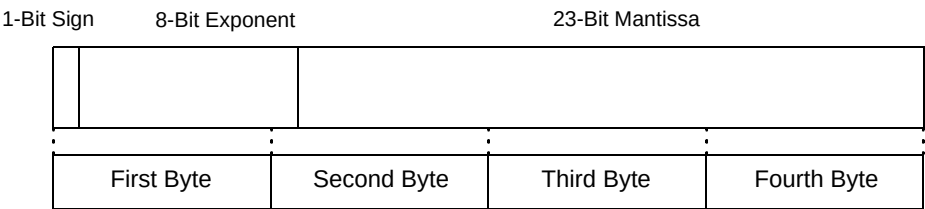

Binary data is sent in four-byte sequences beginning with the first byte (which includes the sign bit). Responses to queries that return a single value, such as :FETCh?, consist of a measured value as four-byte floating-point binary data. The delimiter is not sent.


Example
Transmit **:FETCh?** + (terminator)
Receive (4-byte floating-point data)

Responses containing multiple values such as memory data consist of a continuous stream of binary data values with no punctuation or other separator between values.

Example
Transmit **:MEMory:DATA?** + (terminator)
Receive (4-byte floating-point data) + (4-byte floating-point data) +.... + (4-byte floating-point data)

9.5 Communication Methods

Various messages are supported for controlling the instrument through the interfaces. Messages can be either program messages, sent from the controller such as PC to the instrument, or response messages, sent from the instrument to the controller.

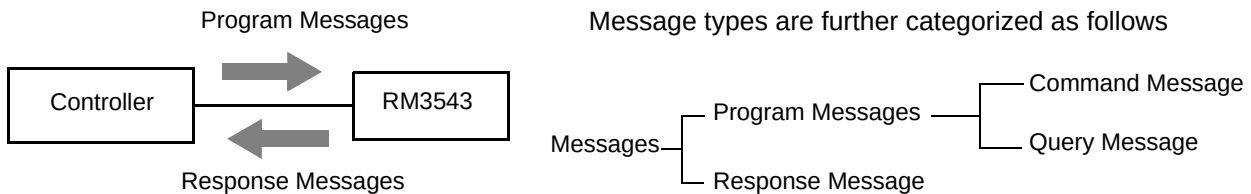


When issuing commands that contain data, make certain that the data is provided in the specified format.

To cancel the Remote state (enter the local state)

During remote control operation, RMT appears on the Measurement screen, and all except the **F1** key are disabled.

Pressing the **F1** [LOCAL] key disables remote control and re-enables the operating keys.

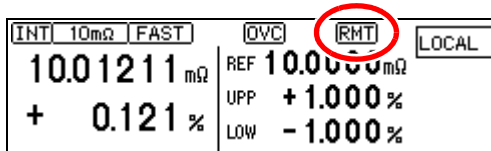

In the local lockout state (GP-IB command LLO: Local Lock Out, (p. 118)) selecting [LOCAL] on the screen has no effect. In this state, send the GTL command, or turn the instrument off and back on to re-establish local control. If the Setting screen was displayed when remote control was enabled, the instrument returns to the Measurement screen automatically.

Message Format

■ Program Messages

Program messages can be either Command Messages or Query Messages.

(1) Command Messages

Instructions to control the instrument, such as to change settings or reset

Example: (instruction to set the measurement range)

:RESISTANCE:RANGE 100E-3

↑ ↑ ↑
Header portion Space Data portion

(2) Query Messages

Requests for responses relating to results of operation or measurement, or the state of instrument settings.

Example: (request for the current measurement range)

:RESISTANCE:RANGE?

↑ ↑
Header portion Question Mark

For details:

See: "Headers" (p. 110), "Separators" (p. 111), "Data Formats" (p. 111)

■ Response Messages

When a query message is received, its syntax is checked and a response message is generated. The **":SYSTEM:HEADER"** command determines whether headers are prefixed to response messages.

Header ON **:RESISTANCE:RANGE 100.0000E-03**
Header OFF **100.0000E-03**

(the current resistance measurement range is 100 mΩ)

At power-on, Header OFF is selected.

If an error occurs when a query message is received, no response message is generated for that query.

No header is applied to commands used only for queries, such as **:FETCH?** and **:CALCulate:LIMit:RESult?**.

■ Command Syntax

Command names are chosen to mnemonically represent their function, and can be abbreviated. The full command name is called the "long form", and the abbreviated name is called the "short form".

The command references in this manual indicate the short form in upper-case letters, extended to the long form in lower case letters, although the commands are not case-sensitive in actual usage.

FUNCTION OK (long form)

FUNC OK (short form)

FUNCT Error

FUN Error

Response messages generated by the instrument are in long form and in upper case letters.

■ Headers

Headers must always be prefixed to program messages.

(1) Command Program Headers

There are three types of commands: Simple, Compound and Standard.

- **Headers for Simple Commands**

This header type is a sequence of letters and digits

:ESE 0

- **Headers for Compound Commands**

These headers consist of multiple simple command type headers separated by colons “.”

:SAMPle:RESet

- **Headers for Standard Commands**

This header type begins with an asterisk “*”, indicating that it is a standard command defined by IEEE 488.2.

***RST**

(2) Query Program Header

These commands are used to interrogate the instrument about the results of operations, measured values and the current states of instrument settings.

As shown by the following examples, a query is formed by appending a question mark “?” after a program header.

:FETCh?

:CALCulate:LIMit:REFerence?

NOTE

Characters within square brackets [] may be omitted.

[:SENSe:]FUNCTION → **:SENSe:FUNCTION**
:FUNCTION

Either form is valid

■ Message Terminators

This instrument recognizes the following message terminators:

GP-IB

- LF
- CR+LF
- EOI
- LF with EOI

RS-232C

- CR
- CR+LF

From the instrument's interface settings, the following can be selected as the terminator for response messages.

GP-IB

- LF with EOI (initial setting)
- CR+LF with EOI

RS-232C

- CR+LF

See: "Delimiter Setting" (p. 139)

■ Separators

(1) Message Unit Separator

Multiple message can be written in one line by separating them with semicolons “;”

:SYSTEM:LFREQUENCY 60;*IDN?

- When messages are combined in this way and if one command contains an error, all subsequent messages up to the next terminator will be ignored.
- A query error occurs if a query command is combined with an immediately following semicolon and subsequent command.

(2) Header Separator

In a message consisting of both a header and data, the header is separated from the data by a space “ ” (ASCII code 20H).

:SYSTEM:HEADER OFF

(3) Data Separator

In a message containing multiple data items, commas are required to separate the data items from one another.

:CALCULATE:LIMIT:ABS 1.00035,0.99965

■ Data Formats

The instrument uses character data and decimal numeric data, depending on the command.

(1) Character Data

Character data always begins with an alphabetic character, and subsequent characters may be either alphabetic or numeric. Character data is not case-sensitive, although response messages from the instrument are only upper case.

:SYSTEM:HEADER OFF

(2) Decimal Numeric Data

Three formats are used for numeric data, identified as NR1, NR2 and NR3. Numeric values may be signed or unsigned. Unsigned numeric values are handled as positive values. Values exceeding the precision handled by the instrument are rounded to the nearest valid digit.

- NR1 Integer data (e.g.: +12, -23, 34)
- NR2 Fixed-point data (e.g.: +1.23, -23.45, 3.456)
- NR3 Floating-point exponential representation data (e.g.: +1.0E-2, -2.3E+4)

The term “NRf format” includes all three of the above numeric decimal formats.

The instrument accepts NRf format data.

The format of response data is specified for each command, and the data is sent in that format.

:ESE0 106

:FETCH?

+106.571



The instrument does not fully support IEEE 488.2. As much as possible, please use the data formats shown in the Reference section.

Also, be careful to avoid constructing single commands that could overflow the input buffer or output queue.

■ Compound Command Header Omission

When several commands having a common header are combined to form a compound command (e.g., **:CALCulate:LIMit:REFeRence** and **:CALCulate:LIMit:PERCent**), if they are written together in sequence, the common portion (here, **:CALCulate:LIMit:**) can be omitted after its initial occurrence.

This common portion is called the “current path” (analogous to the path concept in computer file storage), and until it is cleared, the interpretation of subsequent commands presumes that they share the same common portion.

This usage of the current path is shown in the following example:

Full expression

:CALCulate:LIMit:REFeRence
1.0E+3;:CALCulate:LIMit:PERCent 1.0, -1.5

Compacted expression

:CALCulate:LIMit:REFeRence 1.0E+3;PERCent 1.0, -1.5

↑
This portion becomes the current path, and can be omitted from the messages immediately following.

The current path is cleared when the power is turned on, when reset by key input, by a colon “:” at the start of a command, and when a message terminator is detected.

Standard command messages can be executed regardless of the current path.

They have no effect upon the current path.

A colon “:” is not required at the start of the header of a Simple or Compound command. However, to avoid confusion with abbreviated forms and operating mistakes, we recommend always placing a colon at the start of a header.

Output Queue and Input Buffer

■ Output Queue

Response messages are stored in the output queue until read by the controller. The output queue is also cleared in the following circumstances:

- Power on
- Device clear 
- Query Error

The output queue capacity of the instrument is 64 bytes. If response messages overflow the buffer, a query error is generated and the output queue is cleared.

Also, with GP-IB, if a new message is received while data remains in the output queue, the output queue is cleared and a query error is generated.

■ Input Buffer

The input buffer capacity of the instrument is 256 bytes.

If 256 bytes are allowed to accumulate in this buffer so that it becomes full, the GP-IB interface bus enters the waiting state until space is cleared in the buffer.

The RS-232C interface will not accept data beyond 256 bytes.


NOTE

Ensure that the no command ever exceeds 256 bytes.

Status Byte Register

GP-IB

This instrument implements the status model defined by IEEE 488.2 with regard to the serial poll function using the service request line.
The term “event” refers to any occurrence that generates a service request.

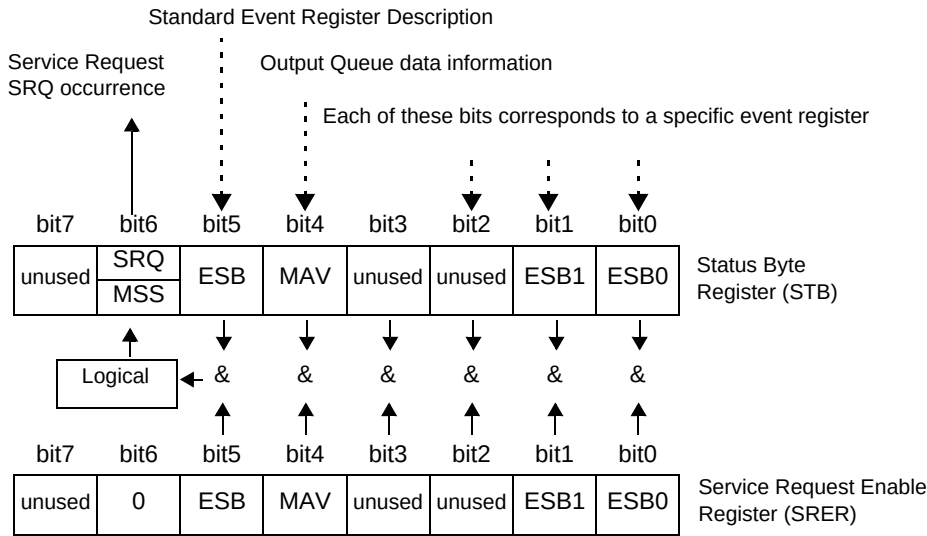

Overview of Service Request Occurrence

The Status Byte Register contains information about the event registers and the output queue. Required items are selected from this information by masking with the Service Request Enable Register. When any bit selected by the mask is set, bit 6 (MSS; the Master Summary Status) of the Status Byte Register is also set, which generates an SRQ (Service Request) message and dispatches a service request.

NOTE

SRQ (Service Request) is a GP-IB function only. However, STB (Status Byte Register) information can be acquired with RS-232C using the *STB? command.

RS-232C

RS-232C does not provide a function for issuing service requests. Still, SRER setup and STB reading are available.

■ Status Byte Register (STB)

During serial polling, the contents of the 8-bit Status Byte Register are sent from the instrument to the controller.

When any Status Byte Register bit enabled by the Service Request Enable Register has switched from 0 to 1, the MSS bit becomes 1. Consequently, the SRQ bit is set to 1, and a service request is dispatched.

The SRQ bit is always synchronous with service requests, and is read and simultaneously cleared during serial polling. Although the MSS bit is only read by an ***STB?** query, it is not cleared until a clear event is initiated by the ***CLS** command.

Bit 7		unused
Bit 6	SRQ	Set to 1 when a service request is dispatched.
	MSS	This is the logical sum of the other bits of the Status Byte Register.
Bit 5	ESB	Standard Event Status (logical sum) bit This is logical sum of the Standard Event Status Register.
Bit 4	MAV	Message available Indicates that a message is present in the output queue.
Bit 3		unused
Bit 2		unused
Bit 1	ESB1	Event Status (logical sum) bit 1 This is the logical sum of Event Status Register 1.
Bit 0	ESB0	Event Status (logical sum) bit 0 This is the logical sum of Event Status Register 0.

■ Service Request Enable Register (SRER)

This register masks the Status Byte Register. Setting a bit of this register to 1 enables the corresponding bit of the Status Byte Register to be used.

Event Registers

■ Standard Event Status Register (SESR)

The Standard Event Status Register is an 8-bit register.

If any bit in the Standard Event Status Register is set to 1 (after masking by the Standard Event Status Enable Register), bit 5 (ESB) of the Status Byte Register is set to 1.

See: "Standard Event Status Register (SESR) and Standard Event Status Enable Register (SESER)" (p. 116)

The Standard Event Status Register is cleared in the following situations:


- When a ***CLS** command is executed
- When an event register query (***ESR?**) is executed
- When the instrument is powered on

Bit 7	PON	Power-On Flag Set to 1 when the power is turned on, or upon recovery from an outage.
Bit 6	URQ	User Request unused
Bit 5	CME	Command error (The command to the message terminator is ignored.) This bit is set to 1 when a received command contains a syntactic or semantic error: • Program header error • Incorrect number of data parameters • Invalid parameter format • Received a command not supported by the instrument
Bit 4	EXE	Execution Error This bit is set to 1 when a received command cannot be executed for some reason. • The specified data value is outside of the set range • The specified setting data cannot be set • Execution is prevented by some other operation being performed
Bit 3	(unused) DDE	Not used by this instrument Device-Dependent Error This bit is set to 1 when a command cannot be executed due to some reason other than a command error, a query error or an execution error.
Bit 2	QYE	Query Error (the output queue is cleared) This bit is set to 1 when a query error is detected by the output queue control. • When an attempt has been made to read an empty output queue (GP-IB only) • When the data overflows the output queue • When data in the output queue has been lost • When the next command is received while there is data in the output queue
Bit 1	RQC (unused)	Request Control
Bit 0	OPC	Operation Complete This bit is set to 1 in response to an *OPC command. • It indicates the completion of operations of all messages up to the *OPC command

■ Standard Event Status Enable Register (SESER)

Setting any bit of the Standard Event Status Enable Register to 1 enables access to the corresponding bit of the Standard Event Status Register.

Standard Event Status Register (SESER) and Standard Event Status Enable Register (SESER)

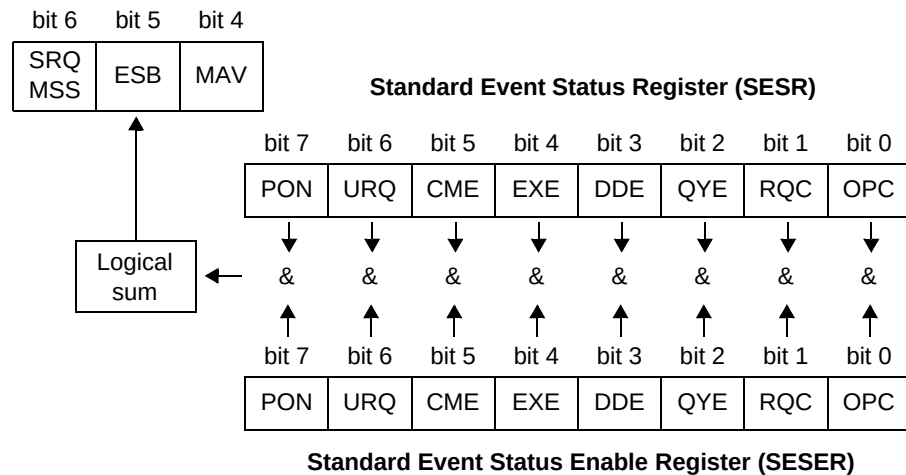

■ Device-Specific Event Status Registers (ESR0 and ESR1)

This instrument provides two event status registers for controlling events. Each event register is an 8-bit register.

When any bit in one of these event status registers enabled by its corresponding event status enable register is set to 1, the following happens:

- For Event Status Register 0, bit 0 (ESB0) of the Status Byte Register is set to 1.
- For Event Status Register 1, bit 1 (ESB1) of the Status Byte Register is set to 1.

Event Status Registers 0 and 1 are cleared in the following situations:

- When a ***CLS** command is executed
- When an Event Status Register query (**:ESR0?** or **:ESR1?**) is executed
- When the instrument is powered on


Event Status Register 0 (ESR0)

Bit 7	–	Unused
Bit 6	OvrRng	Out-of-Range Detection Fault
Bit 5	ERR	Measurement Fault
Bit 4	Hi	High Comparator Result
Bit 3	IN	IN Comparator Result
Bit 2	Lo	Low Comparator Result
Bit 1	INDEX	A/D Conversion Finished
Bit 0	EOM	End of Measurement

Event Status Register 1 (ESR1)

Bit 7	–	Unused
Bit 6	–	Unused
Bit 5	–	Unused
Bit 4	–	Unused
Bit 3	VOLT	Voltage Level Monitor Fault
Bit 2	CURR	Current Monitor Fault
Bit 1	CE Hi	Contact Check – Hi side Fault
Bit 0	CE Lo	Contact Check – Lo side Fault

Event Status Registers 0 (ESR0) and 1 (ESR1), and Event Status Enable Registers 0 (ESER0) and 1 (ESER1)

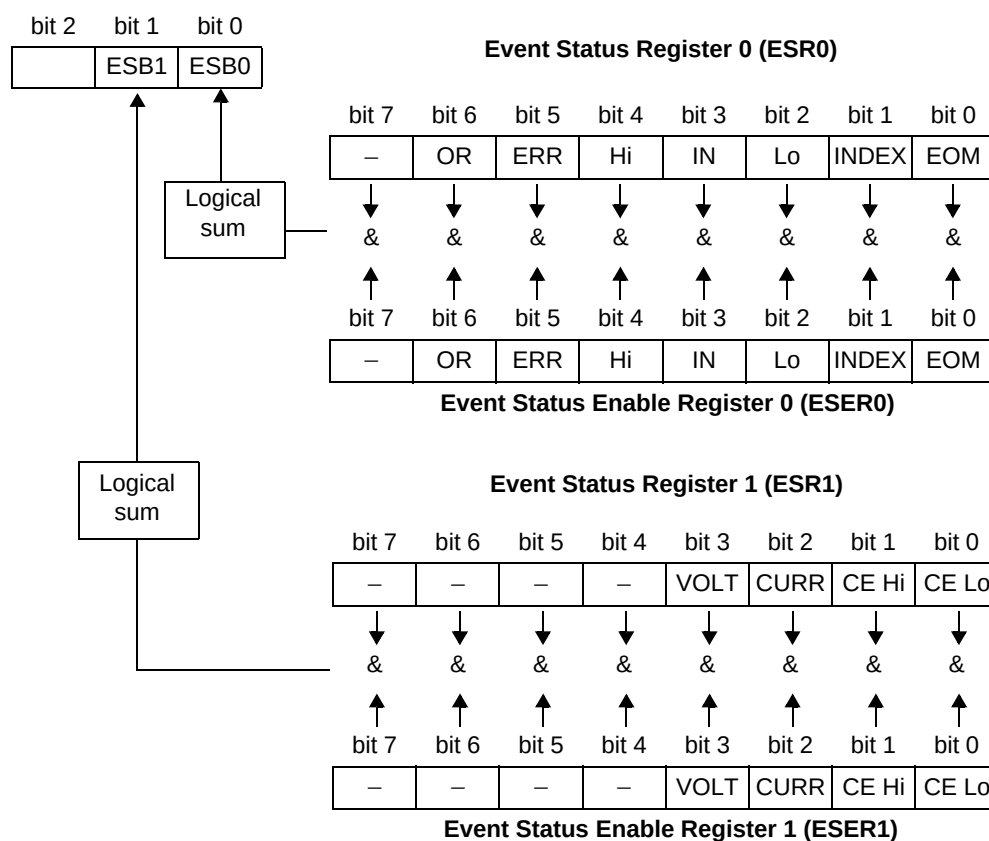Status Byte Register (STB)

■ Register Reading and Writing

Register	Read	Write
Status Byte Register	*STB?	-
Service Request Enable Register	*SRE?	*SRE
Standard Event Status Register	*ESR?	-
Standard Event Status Enable Register	*ESE?	*ESE
Event Status Register 0	:ESR0?	-
Event Status Enable Register 0	:ESE0?	:ESE0
Event Status Register 1	:ESR1?	-
Event Status Enable Register 1	:ESE1?	:ESE1

■ GP-IB Commands

The following commands can be used for performing interface functions.

Command	Description
GTL	Go To Local Cancels the Remote state and enters the Local state.
LLO	Local Lock Out Disables all keys, including the Local (F1) key.
DCL	Device CLear Clears the input buffer and the output queue.
SDC	Selected Device Clear Clears the input buffer and the output queue.
GET	Group Execute Trigger When an external trigger occurs, processes one sample.

Initialization Items

Item	Initialization Method	At Power-on	Key reset	*RST Command	Device Clear (GP-IB only)	*CLS Command	Factory Default
GP-IB Address		—	1	—	—	—	1
RS-232C setting (fixed)		—	9600	—	—	—	9600
Device-specific functions (Range, etc.)		—	●	●	—	—	●
Output Queue		●	●	—	●	—	●
Input buffer		●	●	—	●	—	●
Status Byte Register		●	●	—	— *1	● *2	●
Event registers		● *3	●	—	—	●	●
Enable register		●	●	—	—	—	●
Current path		●	●	—	●	—	●
Headers on/off		OFF	OFF	OFF	—	—	OFF
Response message terminator (GP-IB)		LF+EOI	LF+EOI	—	—	—	LF+EOI
Response message separator		;	;	;	—	—	;

*1. Only the MAV bit (bit 4) is cleared.

*2. All bits except the MAV bit are cleared.

*3. Except the PON bit (bit 7).

Command Execution Time

Command execution time indicates the time for analyzing and processing long form commands.

However, the command execution time for commands with data is the time described according to the data format specified in the <data portion>, and for query commands it is the time when the header is ON.

- Display delays may occur depending on the frequency of communication processes and process contents.
- All commands except *TRG and :INT are processed sequentially.
- In communications with the controller, time must be added for data transmission. GP-IB transfer time depends on the controller.
The time for RS-232C transfers involving a total of 10 bits (the start bit is 1, data length is 8, no parity, stop bit is 1) is shown below.
9600 bps: approximately 960 characters/s
- Wait until measurements stabilize after a change before using a setting command.

Command	Execution time (except communication time)
*RST	200 ms or less
:FUNction :RESistance:RANGe :SPEED :SYSTem:CALibration :RESistance:APERture :RESistance:NPLCycles	150 ms or less
:ADJust?	2 s or less
:FETCh?	3 ms or less
:READ?	Measurement time + 3 ms or less
:SYSTem:BACKup	200 ms or less
*TST?	1s or less
Commands other than those above	10 ms or less

Errors During Communications

An error occurs when messages are executed in the following cases:

- **Command Error**
When message syntax (spelling) is invalid. When the data format in a command or query is invalid.
- **Query Error**
When the response message exceeds 64 bytes
- **Execution Error**
When invalid character or numeric data is present

9.6 Message List

Commands specific to RS-232C or GP-IB are identified by  or  , respectively.

Standard Commands

Message	Data Formats	Description	Ref page
*CLS		Clears the event registers and the Status Byte Register.	128
*ESE	0 to 255	Sets the contents of the Standard Event Status Enable Register.	129
*ESE?	[0 to 255]	Queries the Standard Event Status Enable Register.	129
*ESR?	[0 to 255]	Queries the Standard Event Status Register.	129
*IDN?	[<Manufacturer's name>,<Model name>,0,<Software version>]	Queries the Device ID.	127
*OPC		Requests an SRQ after execution completion.	128
*OPC?	1	Queries execution completion.	128
*RST		Initializes the device.	127
*SRE	0 to 255	Sets the Service Request Enable Register.	130
*SRE?	[0 to 255]	Queries the contents of the Service Request Enable Register.	130
*STB?	[0 to 255]	Queries the Status Byte Register.	130
*TRG		Executes one sampling.	130
*TST?	[0 to 7]	Initiates a self-test and queries the result.	127
*WAI		Wait for operations to finish.	128

Notes:

- < >: contents of the data portion.
- []: Response data

Device-Specific Commands

Message	Data Contents	Description	Ref page
Event registers			
:ESE0	0 to 255	Sets and queries Event Status Enable Register 0.	131
:ESE0?	[0 to 255]		
:ESR0?	[0 to 255]	Queries Event Status Register 0.	131
:ESE1	0 to 255	Sets and queries Event Status Enable Register 1.	131
:ESE1?	[0 to 255]		
:ESR1?	[0 to 255]	Queries Event Status Register 1.	131
Resistance Measurement			
[:SENSe:]FUNCTION	RESistance	Sets and queries the resistance measurement method.	132
[:SENSe:]FUNCTION?	[RESISTANCE]		
Measurement Range			
[:SENSe:]RESistance:RANGE	0 to 1200	Sets and queries resistance measurement range.	132
[:SENSe:]RESistance:RANGE?	[10.00000E-3 to 1000.000E+0]		
Zero-adjust			
:ADJust?	[0/ 1]	Execute zero-adjustment.	133
:ADJust:CLEar		Cancels zero-adjustment.	133
Measurement Speed			
:SPEEd	FAST/ MEdium/ SLOW	Sets and queries measurement speed.	133
:SPEEd?	[FAST/ MEDIUM/ SLOW]		
Statistical functions			
:CALCulate:STATistics:STATE	1/ 0/ ON/ OFF	Sets and queries statistical calculation function execution.	134
:CALCulate:STATistics:STATE?	[ON/ OFF]		
:CALCulate:STATistics:CLEar		Clears statistical calculation results.	134
:CALCulate:STATistics:NUMBer?	[<Total data count>,<Valid data count>]	Queries the data count.	134
:CALCulate:STATistics:MEAN?	[<Mean>]	Queries the mean value.	134
:CALCulate:STATistics:MAXimum?	[<Maximum value>,<Data no.>]	Queries the maximum value.	134
:CALCulate:STATistics:MINimum?	[<Minimum value>,<Data no.>]	Queries the minimum value.	134
:CALCulate:STATistics:LIMit?	[<Hi count>,<IN count>,<Lo count>,<Measurement fault count>,<Out-of-range count>]	Queries comparator results.	135
:CALCulate:STATistics:DEVIation?	[< σ_n >,< σ_{n-1} >]	Queries standard deviation.	135
:CALCulate:STATistics:CP?	[<Cp>,<CpK>]	Queries the process capability indices.	135

Notes:

- < >: contents of the data portion.
- []: Response data

Message	Data Contents	Description	Ref page
Comparator			
:CALCulate:LIMit:STATe	1/ 0/ ON/ OFF	Sets and queries the comparator operating state.	135
:CALCulate:LIMit:STATe?	[ON/ OFF]		
:CALCulate:LIMit:BEEPer	OFF/ HI/ LO/ HL/ IN	Sets and queries the beep sound.	135
:CALCulate:LIMit:BEEPer?	[OFF/ HI/ LO/ HL/ IN]		
:CALCulate:LIMit:MODE	ABS/ REF	Sets and queries the decision mode.	136
:CALCulate:LIMit:MODE?	[ABS/ REF]		
:CALCulate:LIMit:ABS	<Upper threshold>, <Lower threshold>	Sets and queries ABS mode upper/ lower comparator threshold values.	136
:CALCulate:LIMit:ABS?	[<Upper threshold>, <Lower threshold>]		
:CALCulate:LIMit:REFerence	<reference resistance>	Sets and queries REF% mode reference resistance.	136
:CALCulate:LIMit:REFerence?	[<reference resistance>]		
:CALCulate:LIMit:PERCent	<Upper threshold (%)>, <Lower threshold (%)>	Sets and queries REF% mode upper/ lower comparator threshold percentages.	136
:CALCulate:LIMit:PERCent?	[<Upper threshold (%)>, <Lower threshold (%)>]		
:CALCulate:LIMit:RESult?	[HI/ IN/ LO/ OFF/ ERR]	Queries the comparator result.	136
Self-Calibration			
:SYSTem:CALibration		Execute self-calibration.	137
:SYSTem:CALibration:AUTO	1/ 0/ ON/ OFF	Sets and queries the automatic self-calibration.	137
:SYSTem:CALibration:AUTO?	[ON/ OFF]		
100 mΩ range Measurement Current			
:SYSTem:CURREnt	0.1A/ 1A	Sets and queries the 100 mΩ range measurement current	137
:SYSTem:CURREnt?	[0.1A/ 1A]		
Key Beeper			
:SYSTem:BEEPer:STATe	1/ 0/ ON/ OFF	Sets and queries the key beeper.	137
:SYSTem:BEEPer:STATe?	[ON/ OFF]		
Line Frequency			
:SYSTem:LFRequency	AUTO/ 50/ 60	Sets and queries the AC line frequency.	138
:SYSTem:LFRequency?	[AUTO/ 50/ 60]		
Key-Lock			
:SYSTem:KLOCK	1/ 0/ ON/ OFF	Sets and queries the key-lock.	138
:SYSTem:KLOCK?	[ON/ OFF]		
Header Present			
:SYSTem:HEADer	1/ 0/ ON/ OFF	Sets and queries header present.	138
:SYSTem:HEADer?	[ON/ OFF]		
EOM Output			
:SYSTem:EOM:MODE	HOLD/ PULSe	Sets and queries the EOM output mode.	138
:SYSTem:EOM:MODE?	[HOLD/ PULSE]		
:SYSTem:EOM:PULSe	0.001 to 0.100	Sets and queries the EOM pulse width.	138
:SYSTem:EOM:PULSe?	[0.001 to 0.100]		

Notes:

- < >: contents of the data portion.
- []: Response data

Message	Data Contents		Description	Ref page
Delimiter (Terminator)				
:SYSTem:TERMinator		0/ 1	Sets and queries the GP-IB command delimiter.	139
:SYSTem:TERMinator?		[0/ 1]		
System Function				
:SYSTem:DATE		<Year>,<Month>,<Day>	Sets and queries the system date.	139
:SYSTem:DATE?		[<Year>,<Month>,<Day>]		
:SYSTem:TIME		<Hours>,<Minutes>,<Sec- onds>	Sets and queries the system time.	139
:SYSTem:TIME?		[<Hours>,<Minutes>,<Sec- onds>]		
:SYSTem:BACKup			Backs up measurement settings.	139
:SYSTem:SETMonitor		1/ 0/ ON/ OFF	Sets and queries the Settings Monitor function.	140
:SYSTem:SETMonitor?		[ON/ OFF]		
:SYSTem:SETMonitor:ORDer		1/ 2	Sets and queries the 1st/2nd stage setting conditions (Settings Monitor function)	140
:SYSTem:SETMonitor:ORDer?		[1/ 2]		
:SYSTem:SETMonitor:ALLowance		0 to 9.999 (%)	Sets and queries the tolerance range (Settings Monitor function).	140
:SYSTem:SETMonitor:ALLowance?		[0 to 9.999]		
:SYSTem:LOCa l			Enables the local control state.	140
:SYSTem:DATAout		1/ 0/ ON/ OFF	Sets and queries measurement-syn- chronized data output.	140
:SYSTem:DATAout?		[ON/ OFF]		
:SYSTem:FORMat		ASCIi/ BINary	Sets and queries the measurement data format.	141
:SYSTem:FORMat?		[ASCIi/ BINARY]		
:SYSTem:4WChEck		1/ 0/ ON/ OFF	Sets and queries probe short-circuit detection.	141
:SYSTem:4WChEck?		[ON/ OFF]		
:SYSTem:4WChEck:TIME		0.001 to 0.1	Sets and queries probe short-circuit detection time.	141
:SYSTem:4WChEck:TIME?		[0.001 to 0.1]		
:SYSTem:RETRy		1/ 0/ ON/ OFF	Enables the measurement retry func- tion.	141
:SYSTem:RETRy?		[ON/ OFF]		
:SYSTem:RETRy:TIME		0.001 to 0.05 (seconds)	Sets and queries the retry interval.	141
:SYSTem:RETRy:TIME?		[0.001 to 0.05]		
:SYSTem:RESet			Executes a system reset.	141
Trigger				
:INITiate:CONTInuous		1/ 0/ ON/ OFF	Sets and queries continuous measure- ment.	143
:INITiate:CONTInuous?		[ON/ OFF]		
:INITiate[:IMMediate]			Initiates the trigger wait state.	143
:TRIGger:SOURce		IMMediate/ EXTernal	Sets and queries the trigger source.	143
:TRIGger:SOURce?		[IMMEDIATE/ EXTERNAL]		
:TRIGger:DELay1		0 to 0.100	Sets and queries Trigger Delay 1 time.	144
:TRIGger:DELay1?		[0 to 0.100]		
:TRIGger:EDGE		RISE/ FALL	Sets and queries trigger (falling (ON)/ rising (OFF)) edge logic.	144
:TRIGger:EDGE?				

Notes:

- < >: contents of the data portion.
- []: Response data

Message	Data Contents	Description	Ref page
Reading Measured Values			
: FETCh?	[<measurement value>]	Reads the most recent measurement.	145
: READ?	[<measurement value>]	Waits for trigger and reads the measured value.	145
Memory Function			
: MEMory: MODE	OFF/ MEMory/ AUTO	Sets and queries the memory mode.	146
: MEMory: MODE?	[OFF/ MEMORY/ AUTO]		
: MEMory: CLEar		Clears memory data.	146
: MEMory: COUNT?	[0 to 30000]	Queries the number of measurements stored in memory.	146
: MEMory: DATA?	[<Measurement value>, <measurement value>, ..., <measurement value>]	Reads the measurements stored in memory.	147
: MEMory: POINt	1 to 30000	Sets and queries the number of measurement points to store.	147
: MEMory: POINt?	[1 to 30000]		
Range-Specific Resistance Measurement Settings			
: RESistance: DELay2	<Range>, <Delay 2 time>	Sets and queries Delay 2.	148
: RESistance: DELay2?	<Range> [0 to 0.100]		
: RESistance: NPLCycles	<Range>, <Speed>, <Integration time (NPLC)>	Sets and queries integration time (no. of power line cycles).	148
: RESistance: NPLCycles?	<Range>, <Speed> [0.01 to 6]		
: RESistance: APERTure	<Range>, <Speed>, <Integration time (s)>	Sets and queries integration time (in seconds).	148
: RESistance: APERTure?	<Range>, <Speed> [0.0001 to 0.1]		
: RESistance: CIMProve	<Range>, <OFF/ HOLD/ PULSE>	Sets and queries Contact Improver operating mode.	149
: RESistance: CIMProve?	<Range> [OFF/ HOLD/ PULSE]		
: RESistance: CIMProve: LEVe l	<Range>, <Level>	Sets and queries Contact Improver level.	149
: RESistance: CIMProve: LEVe l?	<Range> [L1/ L2/ L3/ L4]		
: RESistance: CURRent	<Range>, <PULSE/ CON-Tinuous>	Sets and queries measurement current mode.	149
: RESistance: CURRent?	<Range> [PULSE/ CONTINUOUS]		
: RESistance: CONTactcheck	<Range>, <1/ 0/ ON/ OFF>	Sets and queries contact check operation.	150
: RESistance: CONTactcheck?	<Range> [ON/ OFF]		
: RESistance: CONTactcheck: LEVe l	<Range>, <Level>	Sets and queries contact check threshold.	150
: RESistance: CONTactcheck: LEVe l?	<Range> [L1/ L2/ L3/ L4/ L5/ L6/ L7]		
: RESistance: VMONitor	<Range>, <1/ 0/ ON/ OFF>	Sets and queries voltage level monitor operation.	150
: RESistance: VMONitor?	<Range> [ON/ OFF]		
: RESistance: VMONitor: LEVe l	<Range>, <Level>	Sets and queries voltage level monitor level.	150
: RESistance: VMONitor: LEVe l?	<Range> [L1/ L2/ L3]		

Notes:

- < >: contents of the data portion.
- []: Response data
- <Range>: RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

Message	Data Contents	Description	Ref page
:RESistance:AVERage	<Range>,<1/ 0/ ON/ OFF>	Sets and queries the averaging function.	151
:RESistance:AVERage?	<Range> [ON/ OFF]		
:RESistance:AVERage:NUMBer	<Range>,<Averaging iterations>	Sets and queries the averaging iterations.	151
:RESistance:AVERage:NUMBer?	<Range> [2 to 32]		
:RESistance:SCALing	<Range>,<1/ 0/ ON/ OFF>	Sets and queries scaling function.	151
:RESistance:SCALing?	<Range> [ON/ OFF]		
:RESistance:SCALing:PARAmeterA	<Range>,<Compensation coefficient>	Sets and queries the scaling function's compensation coefficient.	151
:RESistance:SCALing:PARAmeterA?	<Range> [0.5 to 2.0]		
:RESistance:SCALing:PARAmeterB	<Range>,<Offset>	Sets and queries the scaling function's offset.	151
:RESistance:SCALing:PARAmeterB?	<Range> [-10% of range measurement range to 10% of range measurement range]		

Notes:

- < >: contents of the data portion.
- []: Response data
- <Range>: RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

9.7 Message Reference

Messages specific to the RS-232C or GP-IB interface are identified by their corresponding symbols (**RS-232C** / **GP-IB**).

Message Reference Interpretation

< >: Indicates the contents (character or numeric parameters) of the data portion of a message.
Character parameters are returned as all capital letters.

Numeric Parameters:

- NRf Number format may be any of NR1, NR2 and NR3
- NR1 Integer data(e.g.: +12, -23, 34)
- NR2 Fixed-point data(e.g.: +1.23, -23.45, 3.456)
- NR3 Floating-point exponential representation data (e.g.: +1.0E-2, -2.3E+4)

Shows the command description.

Shows the message syntax.
Explains the command data or response message.

Describes the message.

Shows an example of an actual command application.
(Normally described with HEADER ON,
(except the HEADER command itself)).

Read/Write the Standard Event Status Enable Register (\$ESER)

Syntax

Command *ESE <0 to 255 (NR1)>
Query *ESE?
Response <0 to 255 (NR1)>

Description

Command

The SESER mask is set to the numerical value 0 to 255.
The initial value (at power-on) is 0.

Query

The contents of the SESER, as set by the *ESE command, are returned as an NR1 value (0 to 255).

128 64 32 16 8 4 2 1

bit 7 bit 6 bit 5 bit 4 bit 3 bit 2 bit 1 bit 0

PON URQ CME EXE DDE QYE RQC OPC

Example

*ESE 36

(Sets bits 5 and 2 of SESER)

1.888.610.7664

 www.calcert.com

sales@calcert.com

Standard Commands

Messages specific to the RS-232C or GP-IB interface are identified by their corresponding symbols (**RS-232C** / **GP-IB**).

(1) System Data Command

Queries device ID

Syntax	Query	* IDN?
	Response	<Manufacturer's name>,<Model name>,0,<Software version>
Example	HIOKI, RM3543, 0, V1.00	
	The Device ID is HIOKI RM3543, 0, software version 1.00.	
	For model RM3543-01, the <Model name> is RM3543-01.	
Note	The response message has no header.	

(2) Internal Operation Command

Initialize Device

Syntax	Command	* RST
Description	Command	Resets the instrument to its initial state.
Note	• The communications state is not initialized.	
	• Initialized settings are not backed up.	
	• The following methods are available if backup is needed:	
	Method 1. Use the :SYSTEM:BACKup command	
	Method 2. Use the :SYSTEM:RESet command	

Execute Self-Test and Query the Result

Syntax

Query

*TST?

Response

<0 to 7 (NR1)>

128

64

32

16

8

4

2

1

bit 7

bit 6

bit 5

bit 4

bit 3

bit 2

bit 1

bit 0

unused

unused

unused

unused

unused

non-volatile memory

RAM

ROM

Description

Perform instrument self-test and return the result as numerical value 0 to 7. Returns zero when no error occurs.

Example

*TST?

4

A non-volatile memory error occurred. Correct measurement may not be possible. Obtain repair before further use.



(3) Synchronization Commands

Set the OPC bit of SESR When Finished All Pending Operations

Syntax	Command	*OPC
Description	Sets OPC bit 0 of the Standard Event Status Register (SESR) when all prior commands have finished processing.	

Respond with ASCII "1" When Finished All Pending Operations

Syntax	Query	*OPC?
	Response	1
Description	Responds with ASCII "1" when all prior commands have finished processing.	

Wait for Pending Commands to Finish

Syntax	Command	*WAI
Description	The instrument waits until all prior commands finish before executing any subsequent commands.	
Note	The *WAI command is supported because it is defined in IEEE 488.2-1987, but because all Model RM3543 device-specific commands are sequential types, this command has no actual affect.	

(4) Status and Event Control Commands

Clear the Status Byte and Related Queues (Except the Output Queue)

Syntax	Command	*CLS
Description	Clears the event status registers. The Status Byte Register bits corresponding to the event status registers are also cleared. (SESR, SR0, ESR1)	
Note	 The output queue is unaffected.  The output queue, the various enable registers and MAV bit 4 of the Status Byte Register are unaffected.	

Read/Write the Standard Event Status Enable Register (SESER)

Syntax

Command *ESE <0 to 255 (NR1)>
Query *ESE?
Response <0 to 255 (NR1)>

Description

Command The SESER mask is set to the numerical value 0 to 255.
 The initial value (at power-on) is 0. ("Default Settings" (p. 72))
Query The contents of the SESER, as set by the *ESE command, are returned as an NR1
 value (0 to 255).

128	64	32	16	8	4	2	1
bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
PON	URQ	CME	EXE	DDE	QYE	RQC	OPC

Example

*ESE 36
(Sets bits 5 and 2 of SESER)

Read and Clear the Standard Event Status Register (SESR)

Syntax

Query *ESR?
Response <0 to 255 (NR1)>

Description

Returns the contents of the SESR as an NR1 value from 0 to 255, then clears register contents.
The response message has no header.

RS-232C

128	64	32	16	8	4	2	1
bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
PON	unused	CME	EXE	DDE	QYE	unused	unused

GP-IB

128	64	32	16	8	4	2	1
bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
PON	URQ	CME	EXE	DDE	QYE	RQC	OPC

Example

*ESR?
32
Bit 5 of the SESR was set to 1.

Write and Read the Service Request Enable Register (SRER)

Syntax Command ***SRE** <0 to 255 (NR1)>
 Query ***SRE?**
 Response <0 to 255 (NR1)>

Description Command The SRER mask is set to the numerical value 0 to 255. Although NRf numerical values are accepted, values to the right of the decimal are rounded to the nearest integer. Bit 6 and unused bits 2, 3 and 7 are ignored. The data is initialized to zero at power-on.

 Query The contents of the SRER, as set by the ***SRE** command, are returned as an NR1 value (0 to 255). Bit 6 and unused bits 2, 3 and 7 always return as zero.

128	64	32	16	8	4	2	1
bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
unused	0	ESB	MAV	unused	unused	ESE1	ESE0

Example ***SRE 33**
 Set SRER bits 0 and 5 to 1.
 ***SRE?**
 33
 SRER bits 0 and 5 have been set to 1.

Read the Status Byte and MSS Bit

Syntax Query ***STB?**
 Response <0 to 255 (NR1)>

Description The contents of the STB are returned as an NR1 value (0 to 255). The response message has no header.

128	64	32	16	8	4	2	1
bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
unused	MSS	ESB	MAV	unused	unused	ESE1	ESE0

Example ***STB?**
 16
 STB bit 4 has been set to 1.

Request a Sample

Syntax Command ***TRG**

Description Performs one measurement when external triggering is enabled. When Statistical Calculation is ON, imports calculation data. When the memory function is enabled, the measured value is stored.

Example **:TRIGger:SOURce EXternal;*TRG**

Note When an error occurs with the Settings Monitor function enabled, triggering is disabled (p. 56).

Device-Specific Commands

(1) Event Status Register

Set and Query Device-Specific Event Status Enable Register ESER0

Syntax	Command	: ESE0 <0 to 255 (NR1)>							
	Query	: ESE0?							
	Response	<0 to 255 (NR1)>							
Description	Command	Sets the mask pattern in Event Status Enable Register 0 (ESER0) for the Event Status Register.							
		128	64	32	16	8	4	2	1
		bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
		unused	OR	ERR	Hi	IN	Lo	INDEX	EOM
Note	Data initializes to zero at power-on.								

Read Device-Specific Event Status Register ESR0

Syntax	Query	: ESR0?
	Response	<0 to 255 (NR1)>
Note	Executing ESR0? clears the contents of ESR0.	

Set and Query Device-Specific Event Status Enable Register ESER1

Syntax	Command	: ESE1 <0 to 255 (NR1)>							
	Query	: ESE1?							
	Response	<0 to 255 (NR1)>							
Description	Command	Sets the mask pattern in Event Status Enable Register 1 (ESER1) for the Event Status Register.							
		128	64	32	16	8	4	2	1
		bit 7	bit 6	bit 5	bit 4	bit 3	bit 2	bit 1	bit 0
		unused	unused	unused	unused	VOLT	CURR	CE Hi	CE Lo
Note	Data initializes to zero at power-on.								

Read Device-Specific Event Status Registers ESR1

Syntax	Query	: ESR1?
	Response	<0 to 255 (NR1)>
Note	Executing ESR1? clears the contents of ESR1.	

(2) Measurement-Related

Set and Query the Resistance Measurement Method ---

Syntax Command **[:SENSe:]FUNction <RESistance>**
 Query **[:SENSe:]FUNction?**
 Response **<RESISTANCE>**
 <RESISTANCE> = Resistance measurement

Example **FUNC RES**
 Selects the Resistance measurement.
 FUNC?
 RESISTANCE
 The Resistance measurement has been selected.

Note [:SENSe:] may be omitted.

Set and Query the Range Setting ---

Resistance Measurement Range

Syntax Command **[:SENSe:]RESistance:RANGe <Expected measurement value>**
 Query **[:SENSe:]RESistance:RANGe?**
 Response **<Measurement Range (NR3)>**
 <Expected measurement value> = 0 to 1200
 <Measurement Range (NR3)> = 10.00000E-3/ 100.0000E-3/ 1000.000E-3/ 10.00000E+0/
 100.0000E+0/ 1000.000E+0

Description Command Enter the expected measurement value. The instrument is set to the most suitable range for measuring the given numerical value data.

 Query Queries the measurement range setting.

Example **RES:RANG 95**
 Sets the Resistance measurement to the 100Ω range.

Execute and Clear Zero-Adjustment

Clear Zero-Adjustment

Syntax	Command	:ADJust :CLEar
Description	Command	Clears any zero-adjustment offset.

Execute Zero-Adjustment

Syntax	Query	:ADJust?
	Response	<0/ 1>
		0 = Indicates zero-adjustment succeeded.
		1 = Indicates the offset resistance exceeded 10 Ω during zero-adjustment.

(3) Sampling

Set and Query Measurement Speed

Syntax	Command	:SPEEd <FAST/ MEDium/ SLOW>
	Query	:SPEEd?
	Response	<FAST/ MEDIUM/ SLOW>
Example		:SPEE MED :SPEE? MEDIUM

(4) Calculation

Clear and Query the Statistical Calculation State

- A data sample can be taken by the following methods:
 1. Press the **F4** [MANU] key on the [MENU]-[TRG] selection screen (p. 74)
 2. Apply a TRIG signal to the external I/O connector.
 3. Send a *TRG command.
- The **:CALCulate:STATistics:STATE** command does not clear calculation results.
- When the valid data count is 0, σ_{n-1} returns 0.
- When cleared, the Statistical Calculation function is not turned OFF.
- The upper limit of Cp and CpK is 99.99. If Cp or CpK exceeds 99.99, the value 99.99 is returned.
- The value 0 will be returned if the Cp and Cpk data is not valid.

Statistical Calculation Execution State

Syntax	Command	:CALCulate:STATistics:STATE <1/ 0/ ON/ OFF>
	Query	:CALCulate:STATistics:STATE?
	Response	<ON/ OFF>

Example	:CALC:STAT:STAT ON :CALC:STAT:STAT? ON
---------	---

Clear Statistical Calculation Results

Syntax	Command	:CALCulate:STATistics:CLEAR
--------	---------	------------------------------------

Queries the data count

Syntax	Query	:CALCulate:STATistics:NUMBER?
	Response	<Total data count (NR1)>,<Valid data count (NR1)>
		Data count = 0 to 30000

Example	:CALC:STAT:NUMB? 23456, 23449
---------	--

Query the Mean value

Syntax	Query	:CALCulate:STATistics:MEAN?
	Response	<Mean (NR3)>

Query the Maximum value

Syntax	Query	:CALCulate:STATistics:MAXimum?
	Response	<Maximum value (NR3)>,<Data No. of Maximum value (NR1)>

Example	:CALC:STAT:MAX? 12.4859E+0, 1124
---------	---

Query the Minimum value

Syntax	Query	:CALCulate:STATistics:MINimum?
	Response	<Minimum value (NR3)>,<Data No. of Minimum value (NR1)>

Query Comparator results

Syntax	Query	:CALCulate:STATistics:LIMit?
	Response	<Hi count (NR1)>,<IN count (NR1)>,<Lo count (NR1)>,<Measurement fault count (NR1)>,<Out-of-range count (NR1)>

Example **:CALC:STAT:LIM?**
 1516, 9310, 737, 16, 5

Query Standard Deviation

Syntax	Query	:CALCulate:STATistics:DEViation?
	Response	< σ_n (NR3)>,< σ_{n-1} (NR3)>

Example **:CALC:STAT:DEV?**
 0.0159E-3, 0.0161E-3

Query the Process Capability Indices

Syntax	Query	:CALCulate:STATistics:CP?
	Response	<Cp (NR2)>,<CpK (NR2)>

Example **:CALC:STAT:CP?**
 0.86, 0.14

(5) Comparator**Set and Query Comparator Settings**

When making comparator settings by commands, the measurement range is not automatically selected.

Comparator State

Syntax	Command	:CALCulate:LIMit:STATE <1/ 0/ ON/ OFF>
	Query	:CALCulate:LIMit:STATE?
	Response	<ON/ OFF>

Example **:CALC:LIM:STAT ON**

Beeper State

Syntax	Command	:CALCulate:LIMit:BEEPer <OFF/ HI/ LO/ HL/ IN>
	Query	:CALCulate:LIMit:BEEPer?
	Response	<OFF/ HI/ LO/ HL/ IN>

Example **:CALC:LIM:BEEP HL**

Decision Mode Setting

Syntax Command **:CALCulate:LIMit:MODE** <ABS/ REF>
 Query **:CALCulate:LIMit:MODE?**
 Response <ABS/ REF>

<ABS> = Upper threshold/Lower threshold comparison

<REF> = Reference percentage/tolerance comparison

Example **:CALC:LIM:MODE REF**

Set and Query ABS Mode Upper/Lower Comparator Threshold Values

Syntax Command **:CALCulate:LIMit:ABS** <Upper threshold>, <Lower threshold>
 Query **:CALCulate:LIMit:ABS?**
 Response <Upper threshold>, <Lower threshold>

<Upper threshold> = 0 to 1200.000E+0 (NRf)

<Lower threshold> = 0 to 1200.000E+0 (NRf)

Example **:CALC:LIM:ABS 1.00035, 0.99965**

Set and Query REF% Mode Reference Resistance

Syntax Command **:CALCulate:LIMit:REference** <Reference Resistance>
 Query **:CALCulate:LIMit:REference?**
 Response <Reference Resistance>

<Reference Resistance> = 0 to 1200.000E+0 (NRf)

Example **:CALC:LIM:REF 1.2E-3**

Set and Query REF% Mode Upper/Lower Comparator Threshold Percentages

Syntax Command **:CALCulate:LIMit:PERCent** <Upper threshold (%)>, <Lower threshold (%)>
 Query **:CALCulate:LIMit:PERCent?**
 Response <Upper threshold (%)>, <Lower threshold (%)>

<Upper threshold (%)> = -99.990 to 99.990 (NR2)

<Lower threshold (%)> = -99.990 to 99.990 (NR2)

Note Setting resolution is 0.01% for $\pm 10.00\%$ or more.

Example **:CALC:LIM:PERC 1.505, -2.005**

Queries the comparator result

Syntax Query **:CALCulate:LIMit:RESult?**
 Response <HI/ IN/ LO/ OFF/ ERR>

Example **:CALC:LIM:RES?**
HI

(6) System

Self-Calibration State and Setting

Execute Self-Calibration

Syntax Command **:SYSTem:CALibration**

Description Executes self-calibration.

Note If this command is received while measuring, self-calibration executes after measurement is finished.

Set and Query Self-Calibration Execution State

Syntax Command **:SYSTem:CALibration:AUTO** <1/ 0/ ON/ OFF>

Query **:SYSTem:CALibration:AUTO?**

Response <ON/ OFF>

<ON> = AUTO Self-Calibration selected

<OFF> = MANUAL Self-Calibration selected

Example **:SYST:CAL:AUTO OFF**
:SYST:CAL:AUTO?
OFF

Note Even when AUTO is selected, Self-Calibration can be manually performed at any time by sending the **:SYSTem:CALibration** command.

Set and Query the 100mΩ range Measurement Current

Syntax Command **:SYSTem:CURREnt** <0.1A/ 1A>

Query **:SYSTem:CURREnt?**

Response <0.1A/ 1A>

Example **:SYST:CURREnt 0.1A**
:SYST:CURREnt?
0.1A

Note The 100 mΩ range measurement condition settings are configured separately for each measurement current. Consequently, the 100 mΩ range measurement condition settings should be configured after first setting the measurement current.

Set and Query the Key Beeper Setting

Syntax Command **:SYSTem:BEEPer:STATE** <1/ 0/ ON/ OFF>

Query **:SYSTem:BEEPer:STATE?**

Response <ON/ OFF>

Example **:SYST:BEEP:STAT ON**
:SYST:BEEP:STAT?
ON

Select and Query the Line Frequency Setting

Syntax	Command	:SYSTem:LFRequency <AUTO/ 50/ 60>
	Query	:SYSTem:LFRequency?
	Response	<AUTO/ 50/ 60>
Example		:SYST:LFR 50
		:SYST:LFR?
		50

Set and Query the Key-Lock State

Syntax	Command	:SYSTem:KLOck <1/ 0/ ON/ OFF>
	Query	:SYSTem:KLOck?
	Response	<ON/ OFF>
Description	Sets and queries the full key-lock state (panel key access to all settings, including comparator settings, is disabled).	
Example		:SYST:KLOC ON
		:SYST:KLOC?
		OFF

Set and Query the Header Present Setting

Syntax	Command	:SYSTem:HEADer <1/ 0/ ON/ OFF>
	Query	:SYSTem:HEADer?
	Response	<ON/ OFF>
Example		:SYST:HEAD ON
		:SYST:HEAD?
		:SYSTEM:HEADER ON
Note	When turning the power on and after the *RST command, this is initialized to OFF (no header).	

Select the EOM Output Setting

Two modes of EOM (external I/O End-of-Measurement signal) output are available (EOM is asserted at the end of measurement, and de-asserted according to the selected output mode).

See: "8.2 Timing Chart" (p. 92)

EOM Output Mode Setting

Syntax	Command	:SYSTem:EOM:MODE <HOLD/PULSE>
	Query	:SYSTem:EOM:MODE?
	Response	<HOLD/ PULSE>
Example		:SYST:EOM:MODE PULS

<HOLD> = Holds the $\overline{\text{EOM}}$ signal until measurement starts by the next trigger signal.

<PULSE> = Sets EOM=OFF according to the specified pulse width.

EOM Pulse Width Setting

Syntax	Command	:SYSTem:EOM:PULSe <Pulse width>
	Query	:SYSTem:EOM:PULSe?
	Response	<Pulse width>
	<Pulse width> = 0.001 to 0.100 (NR2) (seconds)	

Delimiter Setting

Syntax Command **:SYSTem:TERMinator** <0/ 1>
 Query **:SYSTem:TERMinator?**
 Response <0/ 1>
 <0> = LF+EOI
 <1> = CR+LF with EOI

Example **:SYST:TERM 1**
:SYST:TERM?
0

Note

- At power-on, this is set to 0 (LF+EOI).
- The RS-232C terminator is fixed as CR+LF.

Set and Query the System Date

Syntax Command **:SYSTem:DATE** <Year>, <Month>, <Day>
 Query **:SYSTem:DATE?**
 Response <Year>,<Month>,<Day>
 <Year> = 00 to 99
 <Month> = 01 to 12
 <Day> = 01 to 31

Description Sets and queries the date of the real-time system clock.

Error Attempting to set an out-of-range numerical value returns an execution error.
 Attempting to set a non-existent date (such as 09,06,31) returns an execution error.

Example **:SYST:DATE 9,10,5**
:SYST:DATE?
09,12,03

Set and Query the System Time

Syntax Command **:SYSTem:TIME** <Hours>, <Minutes>, <Seconds>
 Query **:SYSTem:TIME?**
 Response <Hours>,<Minutes>,<Seconds>
 <Hours> = 00 to 23
 <Minutes> = 00 to 59
 <Seconds> = 00 to 59

Description Sets and queries the time of the real-time system clock.

Example **:SYST:TIME 08,25,00**
:SYST:TIME?
23,09,53

Measurement Settings Backup

Syntax Command **:SYSTem:BACKup**

Description Stores current measurement settings in non-volatile memory. Changes to measurement settings by communications commands are not backed up (and are lost when power is turned off).
 Use this command to store the settings as occasion demands.

**Compare and Query Measurement Settings on Two Instruments
(Settings Monitor Function)**

Set and Query Settings Comparison

Syntax Command **:SYSTem:SETMonitor** <1/ 0/ ON/ OFF>
 Query **:SYSTem:SETMonitor?**
 Response <ON/ OFF>

Description When using two instruments, this function checks that comparator and other settings are the same on both.

See: "4.11 Comparing the Measurement Settings of Two Instruments (Settings Monitor Function)" (p. 56)

Example **:SYST:SETM ON**

Set and Query Settings Monitor Order (1st and 2nd Stages)

Syntax Command **:SYSTem:SETMonitor:ORDER** <1/ 2>
 Query **:SYSTem:SETMonitor:ORDER?**
 Response <1/ 2 (NR1)>

Example **:SYST:SETM:ORD 1**

Set and Query Settings Monitor Tolerance

Syntax Command **:SYSTem:SETMonitor:ALLOWance** <0 to 9.999 (%)>
 Query **:SYSTem:SETMonitor:ALLOWance?**
 Response <0 to 9.999 (NR1)>[%]

Example **:SYST:SETM:ALL 0.5**

Return to Local Control

Syntax Command **:SYSTem:LOCaL**

Description Disables communications remote control and re-enables local control. The panel keys are re-enabled.

Example **:SYST:LOC**

Set and Query Measurement-Synchronized Data Output

Syntax Command **:SYSTem:DATAout** <1/ 0/ ON/ OFF>
 Query **:SYSTem:DATAout?**
 Response <ON/ OFF>

Description ON: The measured value is automatically sent each time an externally triggered measurement is finished. During internal triggering, measured values are sent automatically whenever the TRIG signal is applied.
 OFF: Measured values are not automatically sent.
 This command is not applicable to the GP-IB Interface.

Set and Query the Measurement Data Format

Syntax	Command	:SYSTem:FORMat <ASCIi/ BINary>
	Query	:SYSTem:FORMat?
	Response	<ASCIi/ BINARY>
Description	The data format for sending measurement values can be set to ASCII strings or binary data.	
Note	Binary format supports high-speed transfers, but requires binary data support at the receiving end (p. 107). When set in binary data format, the delimiter is not sent from this instrument.	

Select and Query the Probe Short-Circuit Detection

Probe Short-Circuit Detection Enable/Disable

Syntax	Command	:SYSTem:4WCheck <1/ 0/ ON/ OFF>
	Query	:SYSTem:4WCheck?
	Response	<ON/ OFF>

Probe Short-Circuit Detection Timing

Syntax	Command	:SYSTem:4WCheck:TIME <Time for Detection>
	Query	:SYSTem:4WCheck:TIME?
	Response	<Time for Detection> <Time for Detection> = 0.001 to 0.1 (seconds)

Description Probe short-circuit detection is performed after the specified time for detection following end-of-measurement. At the end of measurement, remove the probes from the measurement object within the time specified for detection.

Example **:SYST:4WCH:TIME 0.01**

Select and Query the Retry Function

Measurement Retry Function Enable/Disable

Syntax	Command	:SYSTem:RETRy <1/ 0/ ON/ OFF>
	Query	:SYSTem:RETRy?
	Response	<ON/ OFF>

Example **:SYST:RETR ON**

Set and Query the Retry Interval

Syntax	Command	:SYSTem:RETRy:TIME <0.001 to 0.05 (seconds)>
	Query	:SYSTem:RETRy:TIME?
	Response	<0.001 to 0.05 (NR1)> (seconds)

Example **:SYST:RETR:TIME 0.02**

System Reset


Syntax	Command	:SYSTem:RESet
Description	Initializes all except communications and clock settings. After initialization, settings are stored in non-volatile memory for backup.	

(7) Triggering

Relationship Between Trigger Source and Continuous Measurement Operation

Operation depends on the continuous measurement setting (`:INITIATE:CONTINUOUS`, (p. 143)) and the trigger source setting (`:TRIGGER:SOURCE`, (p. 143)), as follows.

See: "9.8 Data Exporting Methods" (p. 152)

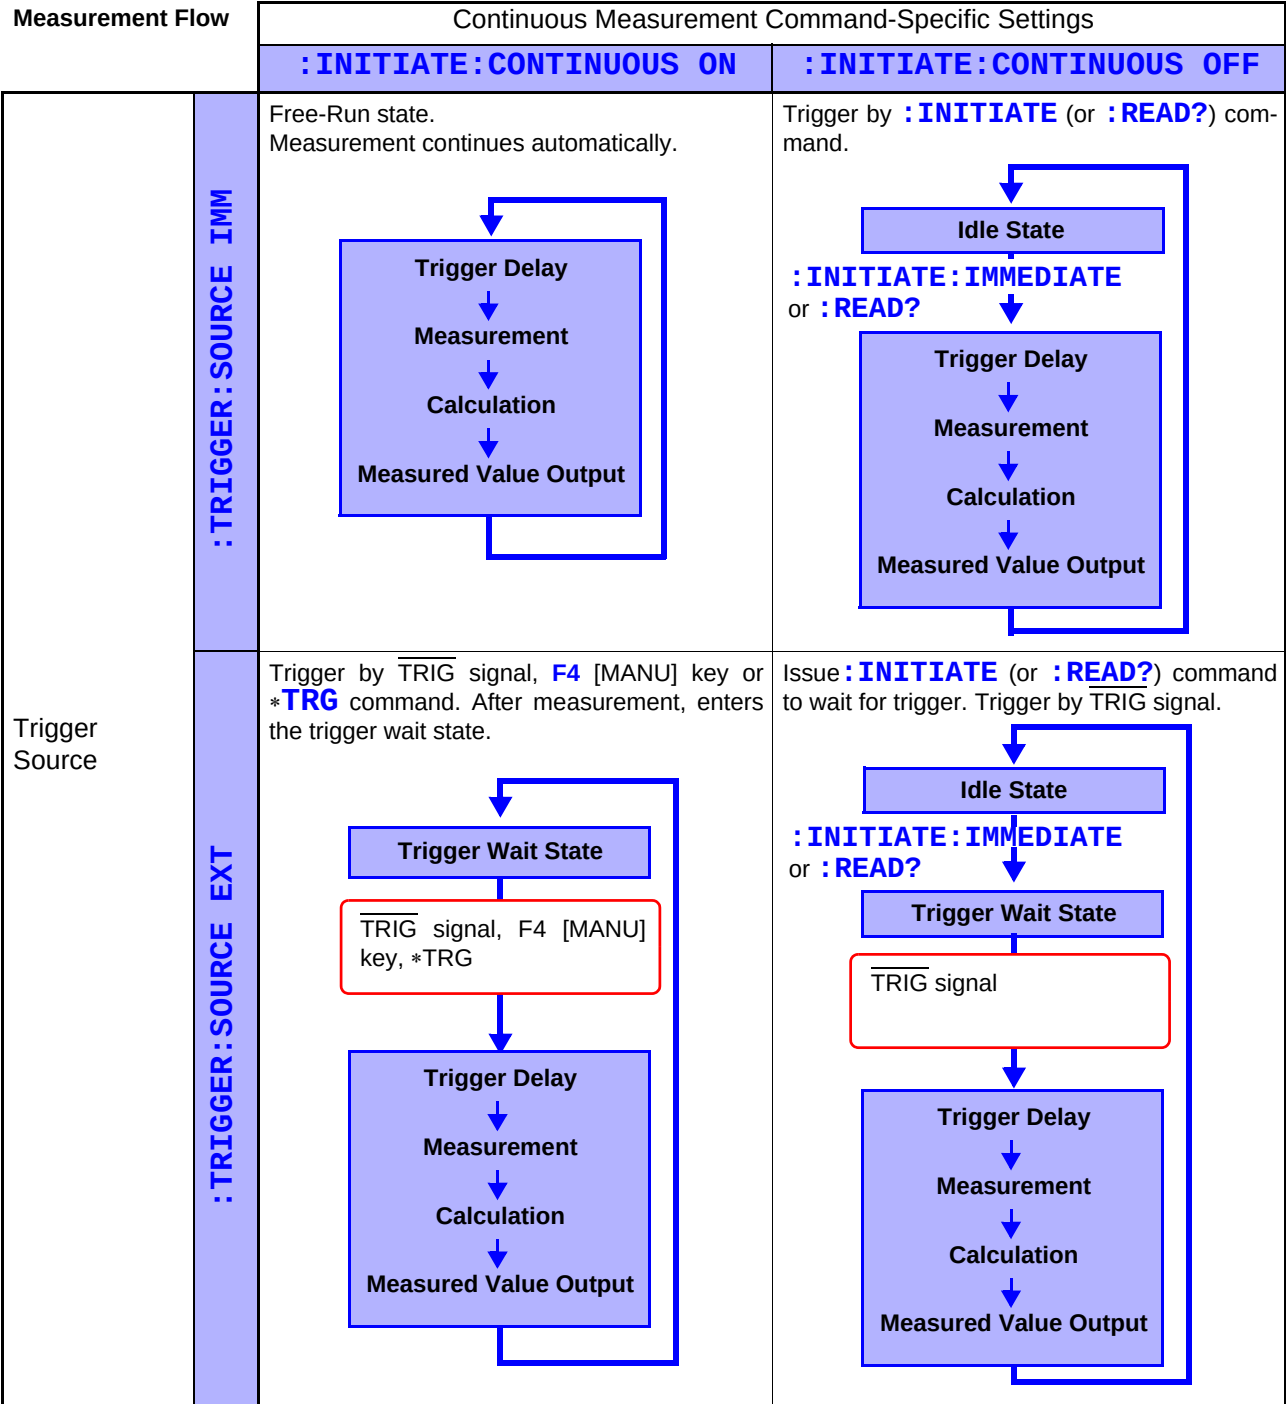

`:INITIATE:CONTINUOUS OFF`

Can only be set by Remote command.
If this has been set to OFF when operation is returned to the Local state or power is turned off, the following state occurs when power is turned back on.

`:INITIATE:CONTINUOUS ON` ("To cancel the Remote state (enter the local state)" (p. 108)

Exporting measured values: "9.8 Data Exporting Methods" (p. 152)

Continuous Measurement Setting

Syntax	Command	:INITiate:CONTinuous <1/ 0/ ON/ OFF>
	Query	:INITiate:CONTinuous?
	Response	<ON/ OFF>
		<ON> = Continuous Measurement Enabled <OFF> = Continuous Measurement Disabled
Description	- Continuous Measurement Enabled: After measurement, enters the Trigger Wait State. When the trigger source setting is IMMEDIATE, the next trigger occurs immediately (the Free-Run State). - Continuous Measurement Disabled: After measurement, enters the Idle State instead of the Trigger Wait State. - Triggering is ignored in the Idle State. Executing :INITiate[:IMMEDIATE] enables the Trigger Wait State. - Continuous measurement is enabled upon exit from the Remote State.	
Example	<pre>:INIT:CONT OFF :INIT:CONT? ON</pre>	

Trigger Wait Setting

Syntax	Command	:INITiate[:IMMEDIATE]
Description	Switches triggering from the Idle State to the Trigger Wait State.	
Example	Disable continuous measurement, and read one value for each trigger event. Sending <pre>:TRIG:SOUR IMM ..Trigger immediately when entering Trigger Wait State :INIT:CONT OFF ..Disables continuous measurement :INITEnable Trigger Wait Trigger immediately upon :TRIG:SOUR IMM :FETC?Fetch measured value</pre> Reading <pre>2.16414E-3.....Measured value is 2.16414 mΩ</pre>	
Error	An execution error occurs when continuous measurement is enabled. (:INITiate:CONTINUOUS ON).	
Note	- When the trigger source is IMMEDIATE, triggering occurs immediately before entering the Idle State. - When the trigger source is EXTERNAL, the Trigger Wait State is enabled to wait for an external trigger, and when a trigger occurs, one measurement is taken before entering the Idle State.	

Trigger Source Setting

Syntax	Command	:TRIGger:SOURce <IMMEDIATE/ EXTERNAL>
	Query	:TRIGger:SOURce?
	Response	<IMMEDIATE/ EXTERNAL>
		<IMMEDIATE> = Internal triggering <EXTERNAL> = External triggering
Description	Trigger by pressing F4 [MANU] on the [MENU]-[TRG] selection screen, $\overline{\text{TRIG}}$ signal or *TRG command.	
Example	<pre>:TRIG:SOUR IMM :TRIG:SOUR? IMMEDIATE</pre>	
Note	When external (EXT) triggering is enabled, the auto-memory mode is disabled (OFF).	

Set and query the Trigger Delay 1 time

Syntax Command **:TRIGger:DElay1** <Delay1 time>
 Query **:TRIGger:DElay1?**
 Response <Delay1>

 <Delay1 time> = 0 to 0.100 (NR2) (seconds)

Example **:TRIG:DEL1?**
 0.010

Set and Query the Trigger Signal Logic

Syntax Command **:TRIGger:EDGE** <RISE/ FALL>
 Query **:TRIGger:EDGE?**
 Response <RISE/ FALL>

 <RISE> = Rising (OFF) edge
 <FALL> = Falling (ON) edge

Description Set the operating logic of the $\overline{\text{TRIG}}$ signal at external I/O pins.

Example **:TRIG:EDGE?**
 FALL

(8) Reading Measured Values

Measurement Value Formats

Measurement Range	Measured Value	±OvrRng	Measurement Fault
10mΩ	±□□.□□□□□E-3	±10.00000E+8	+10.00000E+9
100mΩ	±□□□.□□□□□E-3	±100.0000E+7	+100.0000E+8
1000mΩ	±□□□□.□□□□E-3	±1000.000E+6	+1000.000E+7
10Ω	±□□.□□□□□E+0	±10.00000E+8	+10.00000E+9
100Ω	±□□□.□□□□□E+0	±100.0000E+7	+100.0000E+8
1000Ω	±□□□□.□□□□E+0	±1000.000E+6	+1000.000E+7

Note For positive measured values, a space (ASCII 20H) represents the sign.

Time to receive measured values is different for the **:FETCh?** and **:READ?** commands.

[See: "9.8 Data Exporting Methods" \(p. 152\)](#)

Reading the Most Recent Measurement

Syntax	Query :FETCh?
Description	Reads the most recent measurement. No trigger occurs. See: "Measurement Value Formats" (p. 144)
Example	:FETC? 1023.579E-3
Note	Binary data is returned when the Binary sending format is selected.

Measuring (Awaiting Triggers and Reading Measurements)

Syntax	Query :READ?						
Description	Switches from the Idle State to the Trigger Wait State, then reads the next measured value. With auto-ranging enabled, the most suitable range is selected before measurement.						
	<table border="1"> <thead> <tr> <th>Trigger Source</th><th>Operation</th></tr> </thead> <tbody> <tr> <td>IMMediate</td><td>Triggers and reads measured value.</td></tr> <tr> <td>EXTernal</td><td>Triggers by $\overline{\text{TRIG}}$ signal (EXT I/O) input, and continuously reads measured values.</td></tr> </tbody> </table>	Trigger Source	Operation	IMMediate	Triggers and reads measured value.	EXTernal	Triggers by $\overline{\text{TRIG}}$ signal (EXT I/O) input, and continuously reads measured values.
Trigger Source	Operation						
IMMediate	Triggers and reads measured value.						
EXTernal	Triggers by $\overline{\text{TRIG}}$ signal (EXT I/O) input, and continuously reads measured values.						
	See: "Measurement Value Formats" (p. 144)						
Error	- This command causes an execution error if issued during the Continuous Measurement state (after :INITIATE:CONTINUOUS ON). - This command causes an execution error if issued during the Trigger Wait State.						
Note	- The next command does not execute until measurement is finished. - When using an external trigger source (EXT) with auto-sending of measured values (Auto-Memory function) enabled, returned measured values will be duplicated. Therefore, disable the Auto-Memory function when triggering externally. See: "6.4 Auto-Exporting Measured Values (at End of Measurement) (Data Output Function)" (p. 81) - Binary data is returned when the Binary sending format is selected.						

(9) Memory Functions

You can save and load up to 30000 measurement data entries.

Set and Query Memory Functions ---

Memory Function Execution Mode

Syntax Command **:MEMory:MODE** <OFF/ MEMory/ AUTO>

Query **:MEMory:MODE?**

Response <OFF/ MEMORY/ AUTO>

<OFF> = Memory function OFF

<MEMORY> = Memory function

<AUTO> = Auto memory function

Description Selects the memory function operation mode.

The Memory function can be disabled (OFF), set to store one data item (MEM), or set for auto-memory (AUTO) operation.

Example **:MEM:MODE MEM**

:MEM:MODE?

AUTO

- Note**
- Changing the memory mode setting erases stored data.
 - Enabling the auto-memory mode automatically selects internal [INT] triggering and enables statistical calculation.

Clear Memory Data

Syntax Command **:MEMory:CLEAr**

Example **:MEM:CLE**

Retrieve the Memory Data Count

Syntax Query **:MEMory:COUNT?**

Response <Memory data count >

<Memory data count > = 0 to 30000 (NR1)

Example **:MEM:COUN?**

3

Read Memory Data

Syntax	Query	:MEMory:DATA?
	Response	<Measurement value (NR3)>,<Measurement value (NR3)>,...,<Measurement value (NR3)>
Description	Measured values transferred from memory are separated by commas (","). The number of stored measurement values to be exported can be acquired by the :MEMory:COUNT? query. Data stored by both the data (MEM) and auto-memory (AUTO) modes can be acquired by this command (although only one mode can be enabled at a time). See: "Measurement Value Formats" (p. 144)	
Note	- Memory data is available only by remote command. - Memorize measurement values with the $\overline{\text{TRIG}}$ signal, F4 [MANU] key on the [MENU]-[TRG] selection screen, or *TRG command. - Binary data is returned when the Binary sending format is selected.	

Set and Query the Memory Point (maximum data quantity)

Syntax	Command	:MEMory:POINT <1 to 30000>
	Query	:MEMory:POINT?
	Response	<1 to 30000>
Description	Sets the number of measured values that can be stored. When the number of stored values reach the memory point number, no further values are stored (no overwriting occurs).	
Example	<pre>:MEM:POIN 1000 :MEM:POIN? 1000</pre>	
Note	- When the auto-memory mode is enabled, the maximum memory point number is 99. Although the value may be set higher with the :MEMory:POINT command, the memory is limited to 100 measurement values. - When the auto-memory mode is enabled, stored data is erased when the memory point number is changed.	

(10) Measurement Settings**Set and Query Delay 2 (after applying measurement current)**

Syntax	Command	:RESistance:DElay2 <Range>, <Delay 2 time>
	Query	:RESistance:DElay2? <Range>
	Response	<Delay 2 time>
<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000 <Delay 2 time> = 0 to 0.1 (seconds)		
Example		:RES:DEL2 RNG1000MIL, 0.003
		:RES:DEL2? RNG10
		0.005

Set and Query Integration Time (no. of power line cycles)

Syntax	Command	:RESistance:NPLCycles <Range>, <Speed>, <Integration time (NPLC)>
	Query	:RESistance:NPLCycles? <Range>, <Speed>
	Response	<Integration time (NPLC)>
<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000 <Speed> = SLOW/ MEDium/ FAST <Integration time (NPLC)> = 0.01 to 6		
Description	Sets the integration time as an integer multiple of power line cycles (NPLC).	
Note	- For high-resistance measurements, hum noise is suppressed and stable measured values are acquired by setting an integer multiple of power line cycles. - When converting to seconds, values over 100 ms are set to 100 ms. - When querying the integration time, the instrument's internal variable is converted and output. So in some cases, the returned value may not match the set value.	

Set and Query Integration Time (in seconds)

Syntax	Command	:RESistance:APERTure <Range>, <Speed>, <Integration time (seconds)>
	Query	:RESistance:APERTure? <Range>, <Speed>
	Response	<Integration time (seconds)>
<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000 <Speed> = SLOW/ MEDium/ FAST <Integration time> = 0.0001 to 0.1 (seconds)		
Description	Sets the integration time, in seconds.	

Set and Query Contact Improver Operating Mode

Syntax Command **:RESistance:CIMProve** <Range>, <OFF/ HOLD/ PULSe>
 Query **:RESistance:CIMProve?** <Range>
 Response <OFF/ HOLD/ PULSE>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

Description Sets Contact Improver operation to OFF, HOLD or PULSE.

Set and Query Contact Improver Level

Syntax Command **:RESistance:CIMProve:LEVel** <Range>, <Level>
 Query **:RESistance:CIMProve:LEVel?** <Range>
 Response <Level>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

<Level> = L1/ L2/ L3/ L4 (applied current)
 (L1: 17 mA/ L2: 25 mA/ L3: 35 mA/ L4: 50 mA)

Description Sets the level of current applied by the Contact Improver function.

Set and Query Measurement Current Mode

Syntax Command **:RESistance:CURRent** <Range>, <PULSe/ CONTInuous>
 Query **:RESistance:CURRent?** <Range>
 Response <Range>, <PULSE/ CONTINUOUS>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

<PULSe> = Measurement current is applied as a pulse only during measurement.

<CONTInuous> = Measurement current is applied continuously.

Description Selects the method of current application. Select CONTInuous when measuring objects that require time for stabilization after applying measurement current.

Note When using the Contact Improver function (set to HOLD or PULSE), measurement current is only applied as a pulse, even if CONTInuous is selected here. Therefore, to measure with continuous current, the Contact Improver function must be disabled (set to OFF). (p. 149)

Set and Query Contact Check Operation

Syntax Command : **RESistance:CONtactcheck** <Range>, <1/ 0/ ON/ OFF>
 Query : **RESistance:CONtactcheck?** <Range>
 Response <ON/ OFF>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

Description Enables/disables the Contact Check function.

Set and Query Contact Check Threshold

Syntax Command : **RESistance:CONtactcheck:LEVel** <Range>, <Level>
 Query : **RESistance:CONtactcheck:LEVel?** <Range>
 Response <Level>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

<Level> = L1/ L2/ L3 / L4/ L5/ L6/ L7

Contact Check Error Threshold:

(L1: 50Ω/ L2: 100Ω/ L3: 150Ω/ L4: 200Ω/ L5: 300Ω/ L6: 400Ω/

L7: 500Ω)

Description Sets the error threshold value for contact checking.

Set and Query Voltage Level Monitor Level

Syntax Command : **RESistance:VMONitor** <Range>, <1/ 0/ ON/ OFF>
 Query : **RESistance:VMONitor?** <Range>
 Response <ON/ OFF>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

Description Enables/disables the voltage level monitor function.

Set and Query Voltage Level Monitor Level

Syntax Command : **RESistance:VMONitor:LEVel** <Range>, <Level>
 Query : **RESistance:VMONitor:LEVel?** <Range>
 Response <Level>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

<Level> = L1/ L2/ L3

(L1: Loose/ L2: Normal/ L3: Severe)

Description Sets the error level for the voltage level monitor function.

Set and Query Averaging Function

Syntax Command **:RESistance:AVERage** <Range>, <1/ 0/ ON/ OFF>
 Query **:RESistance:AVERage?** <Range>
 Response <ON/ OFF>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

Description Enables/disables the averaging function.

Set and Query Averaging Iterations

Syntax Command **:RESistance:AVERage:NUMBER** <Range>, <Averaging iterations (Times)>
 Query **:RESistance:AVERage:NUMBER?** <Range>
 Response <Averaging iterations (Times)>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000
 <Averaging iterations (Times)> = 2 to 32

Description Sets the averaging iterations.

Set and Query Scaling Function

Syntax Command **:RESistance:SCALing** <Range>, <1/ 0/ ON/ OFF>
 Query **:RESistance:SCALing?** <Range>
 Response <ON/ OFF>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000

Description Enables/disables the scaling function.

Set and Query Scaling Function's Compensation Coefficient

Syntax Command **:RESistance:SCALing:PARAmeterA** <Range>, <Compensation coefficient>
 Query **:RESistance:SCALing:PARAmeterA?** <Range>
 Response <Compensation coefficient>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000
 <Compensation coefficient> = 0.5 to 2.0

Description Sets the scaling function's compensation coefficient.

Set and Query Scaling Function's Offset

Syntax Command **:RESistance:SCALing:PARAmeterB** <Range>, <Offset>
 Query **:RESistance:SCALing:PARAmeterB?** <Range>
 Response <Offset>

<Range> = RNG10MIL/ RNG100MIL/ RNG1000MIL/ RNG10/ RNG100/ RNG1000
 <Offset> = -10% of range measurement range to 10% of range measurement range

Description Sets the scaling function's offset.

9.8 Data Exporting Methods

Basic Data Exporting Methods

Flexible data exporting is available depending on the application.

Free-Run Data Exporting

Initial Setup	:INITiate:CONTinuous ON (continuous measurement enable) :TRIGger:SOURce IMMEDIATE (internal triggering)
Exporting	:FETCh? Imports the most recent measurement.

Exporting by Host Triggering


Initial Setup	:INITiate:CONTinuous OFF (continuous measurement disable) :TRIGger:SOURce IMMEDIATE (internal triggering)
Exporting	:READ? A trigger occurs, and a measurement is taken and the result is transferred.

Exporting by Pressing the F4 [MANU] Key*1 or Applying TRIG Signal

Initial Setup	:INITiate:CONTinuous OFF (disable continuous measurement) :TRIGger:SOURce EXT (external triggering)
Exporting	:READ? When triggered by the F4 [MANU] Key*1 or TRIG signal, a measurement is taken and the result is transferred.

*1. The **F4** [MANU] key indicator is displayed when [TRG: EXT] is selected on the Basic Setting screen.

Using the :FETCh? Command during Continuous Measurement with Internal Triggering

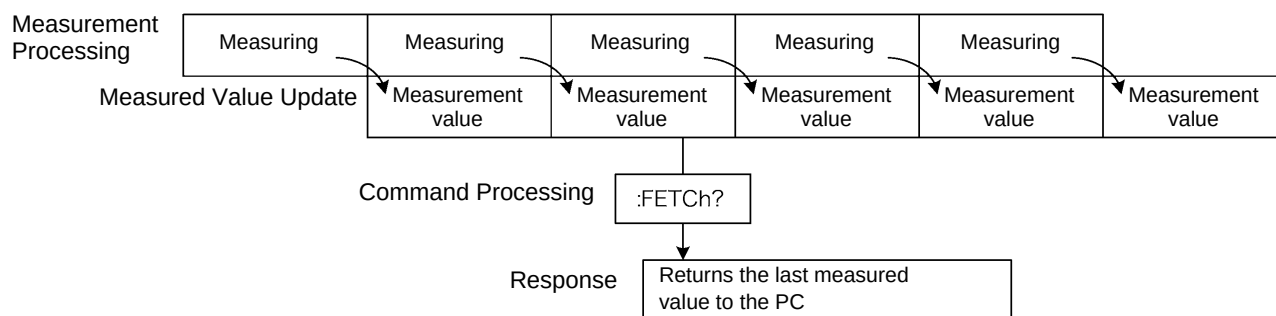


This is the simplest method for exporting measured values.

It is ideal when measurement (tact) time is not limited, and when external synchronization is not needed.


After connecting to the measurement object, wait for twice the measurement time plus the self-calibration time (about 130 ms) before exporting the measured value.

Using the :READ? Command while Continuous Measurement is Disabled

Internal Trigger Case

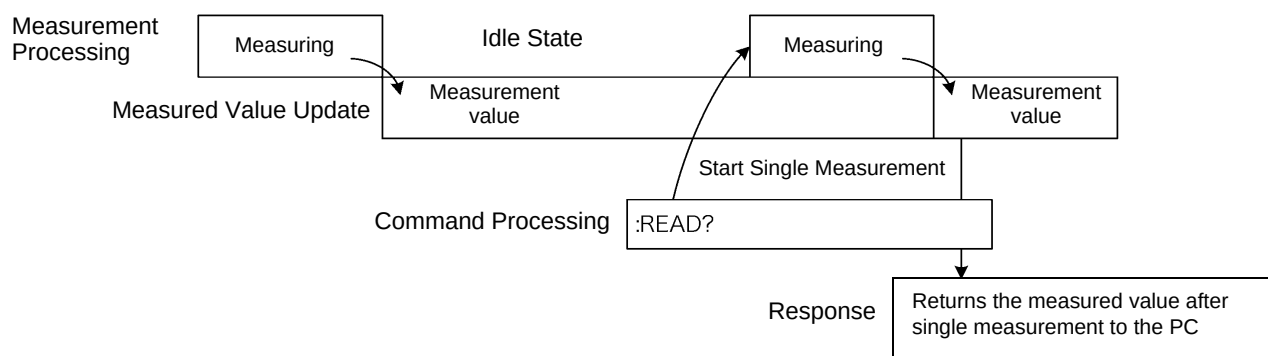

External Trigger Case

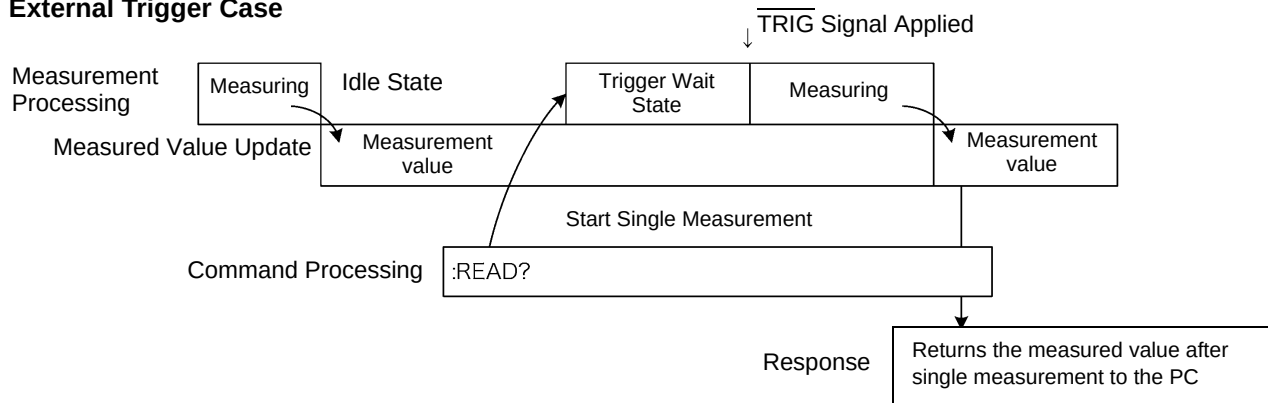

Use this method to measure (and export) synchronously with the PC or external trigger signal. Measurement time can be minimized.

9.9 Sample Programs

These programs can be created using Visual Basic 5.0, 6.0 or Visual Basic 2005 (p. 164).
Visual Basic is a registered trademark of Microsoft Corporation.

Using Visual Basic 5.0 or 6.0

These sample programs are created with Microsoft Visual Basic 5.0 and 6.0.

The following are used for communication:

For RS-232C communication: MSComm from Visual Basic Professional

For GP-IB communication: National Instruments GP-IB Board, Driver and Module for Visual Basic

During communications, the terminator setting is supposed to be as follows:

RS-232C: CR+LF

GP-IB: LF

RS-232C Communications

(Using Microsoft Visual Basic Professional MSComm)

■ Simple Resistance Measurement

Imports measured values 10 times, and saves measurements in a text file.

```
Private Sub MeasureSubRS()
Dim rcvstr As String           'Receiving char string
Dim i As Integer

MSComm1.Settings = "9600,n,8,1" 'Comm port setting
MSComm1.PortOpen = True        'Open a port
Open App.Path & "\data.csv" For Output As #1 'Open a text file for saving

MSComm1.Output = ":TRIG:SOUR IMM" & vbCrLf 'Select internal triggering
MSComm1.Output = ":INIT:CONT ON" & vbCrLf 'Continuous measurement ON
For i = 1 To 10
    MSComm1.Output = ":FETCH?" & vbCrLf 'Send ":FETCH?" to import the most recent measurement
    rcvstr = "" 'From here on, continue receiving until an LF code occurs
    While Right(rcvstr, 1) <> Chr(10)
        rcvstr = rcvstr + MSComm1.Input
        DoEvents
    Wend
    rcvstr = Left(rcvstr, Len(rcvstr) - 2) 'Delete the terminator (CR+LF)
    Print #1, Str(i) & "," & rcvstr 'Write to the file
Next

Close #1
MSComm1.PortOpen = False
End Sub
```

■ Measure Resistance by PC Key

Measures and imports by key input on the PC, and saves measurements in a text file.

```

Private Sub MeasureReadSubRS()
Dim recvstr As String           'Receiving char string
Dim i As Integer

MSComm1.Settings = "9600,n,8,1" 'Comm port setting
MSComm1.PortOpen = True        'Open a port
Open App.Path & "\data.csv" For Output As #1 'Open a text file for saving

MSComm1.Output = ":TRIG:SOUR IMM" & vbCrLf 'Select internal triggering
MSComm1.Output = ":INIT:CONT OFF" & vbCrLf 'Continuous measurement OFF
For i = 1 To 10
    'Wait for PC key input
    'Create a key input check routine to set InputKey() = True when a key is pressed
    Do While 1
        If InputKey() = True Then Exit Do
        DoEvents
    Loop

    'After confirming key input, measure once, and read the measured value
    MSComm1.Output = ":READ?" & vbCrLf 'Send ":READ?" to measure and import the mea-
                                        'surement
    recvstr = "" 'From here on, continue receiving until an LF code
                                        'occurs

    While Right(recvstr, 1) <> Chr(10)
        recvstr = recvstr + MSComm1.Input
        DoEvents
    Wend
    recvstr = Left(recvstr, Len(recvstr) - 2) 'Delete the terminator (CR+LF)
    Print #1, Str(i) & "," & recvstr 'Write to the file
Next

Close #1
MSComm1.PortOpen = False
End Sub

```

■ External Trigger Measurement 1

Measure and import according to external triggering of the RM3543 (**F4** [MANU] key or $\overline{\text{TRIG}}$ signal input), and save measurements in a text file.

```
Private Sub MeasureTrigSubRS()
Dim recvstr As String           'Receiving char string
Dim i As Integer

MSComm1.Settings = "9600,n,8,1" 'Comm port setting
MSComm1.PortOpen = True        'Open a port
Open App.Path & "\data.csv" For Output As #1 'Open a text file for saving

MSComm1.Output = ":TRIG:SOUR EXT" & vbCrLf 'Select external triggering
MSComm1.Output = ":INIT:CONT OFF" & vbCrLf 'Continuous measurement OFF
For i = 1 To 10
    MSComm1.Output = ":READ?" & vbCrLf 'Send ":READ?" to measure and import the measurement

    recvstr = "" 'From here on, continue receiving until an LF code occurs
    While Right(recvstr, 1) <> Chr(10)
        recvstr = recvstr + MSComm1.Input
        DoEvents

        'Input a trigger signal to the TRIG input pin of the EXT I/O connector.

    Wend
    recvstr = Left(recvstr, Len(recvstr) - 2) 'Delete the terminator (CR+LF)
    Print #1, Str(i) & "," & recvstr 'Write to the file
Next

Close #1
MSComm1.PortOpen = False
End Sub
```

■ External Trigger Measurement 2

Measure and import according to external triggering of the RM3543 (F4 [MANU] key or $\overline{\text{TRIG}}$ signal input), and save measurements in a text file.

(The RM3543 imports the most recent measurement by trigger input timing with the continuous measurement state)

```

Private Sub MeasureTrig2SubRS()
Dim recvstr As String                                'Receiving char string
Dim i As Integer

MSComm1.Settings = "9600,n,8,1"                     'Comm port setting
MSComm1.PortOpen = True                             'Open a port
Open App.Path & "\data.csv" For Output As #1         'Open a text file for saving

MSComm1.Output = ":TRIG:SOUR IMM" & vbCrLf           'Select internal triggering
MSComm1.Output = ":INIT:CONT ON" & vbCrLf           'Continuous measurement ON

'Clear confirmation of External I/O TRIG input
MSComm1.Output = ":IO:IN?" & vbCrLf
recvstr = ""
While Right(recvstr, 1) <> Chr(10)
    recvstr = recvstr + MSComm1.Input
    DoEvents
Wend

For i = 1 To 10
    'Wait for External I/O TRIG input
    Do While 1
        MSComm1.Output = ":IO:IN?" & vbCrLf
        recvstr = ""
        While Right(recvstr, 1) <> Chr(10)
            recvstr = recvstr + MSComm1.Input
            DoEvents
        Wend
        If Left(recvstr, 1) = "1" Then Exit Do
        DoEvents
    Loop

    MSComm1.Output = ":FETCH?" & vbCrLf              'Send ":FETCH?" to import the most recent mea-
                                                    'surement

    recvstr = ""                                     'From here on, continue receiving until an LF code
                                                    'occurs

    While Right(recvstr, 1) <> Chr(10)
        recvstr = recvstr + MSComm1.Input
        DoEvents
    Wend
    recvstr = Left(recvstr, Len(recvstr) - 2)         'Delete the terminator (CR+LF)
    Print #1, Str(i) & ", " & recvstr                'Write to the file
Next

Close #1
MSComm1.PortOpen = False
End Sub

```

■ Set Measurement State

Sets up the measurement setting state.

```
'Measurement Setting Configuration
'Configures instrument settings for measurement
'Function: Resistance Measurement
'Range: 1Ω
'Sampling: FAST
'Trigger: External trigger
'Comparator enabled, REF% mode, reference value 1 Ω, tolerance +1.0% / -1.5%, beep upon Hi or Lo
Private Sub SettingsSubRS()
MSComm1.Settings = "9600,n,8,1"           'Comm port setting
MSComm1.PortOpen = True                  'Open a port

MSComm1.Output = ":FUNC RES" & vbCrLf    'Select Resistance function
MSComm1.Output = ":RES:RANG 1E+0" & vbCrLf 'Select 1000 mΩ range
MSComm1.Output = ":SPEE FAST" & vbCrLf   'Select FAST sampling
MSComm1.Output = ":TRIG:SOUR EXT" & vbCrLf 'Select external triggering
MSComm1.Output = ":INIT:CONT ON" & vbCrLf 'Continuous measurement ON
MSComm1.Output = ":CALC:LIM:MODE REF" & vbCrLf 'From here on, comparator settings
MSComm1.Output = ":CALC:LIM:BEEP HL" & vbCrLf
MSComm1.Output = ":CALC:LIM:REF 1E+0" & vbCrLf
MSComm1.Output = ":CALC:LIM:PERC 1.0, -1.5" & vbCrLf
MSComm1.Output = ":CALC:LIM:STAT ON" & vbCrLf 'Comparator ON

MSComm1.PortOpen = False
End Sub
```

GP-IB Communications

(Using National Instruments GP-IB Board)

■ Simple Resistance Measurement

Imports measured values 10 times, and saves measurements in a text file.

Private Sub MeasureSub()	
Dim buffer As String * 20	'Receiving buffer
Dim recvstr As String	'Receiving char string
Dim pad As Integer	'Controller Address
Dim gpibad As Integer	'Device Address
Dim timeout As Integer	'Timeout period
Dim ud As Integer	'State (unused)
Dim i As Integer	
pad = 0	'Board Address 0
gpibad = 1	'RM3543 Address 1
timeout = T10s	'Timeout about 10s
Call ibfind("gpib0", 0)	'Initialize GP-IB
Call ibdev(pad, gpibad, 0, timeout, 1, 0, ud)	
Call SendIFC(pad)	
Open App.Path & "data.csv" For Output As #1	'Open a text file for saving
Call Send(pad, gpibad, ":TRIG:SOUR IMM", NLen)	'Select internal triggering
Call Send(pad, gpibad, ":INIT:CONT ON", NLen)	'Continuous measurement ON
For i = 1 To 10	
Call Send(pad, gpibad, ":FETCH?", NLen)	'Send ":FETCH?" to import the most recent mea-
	surement
Call Receive(pad, gpibad, buffer, STOPend)	'Receive
recvstr = Left(buffer, InStr(1, buffer, Chr(10)) - 1)	
Print #1, Str(i) & "," & recvstr	'Write to the file
Next	
Close #1	
Call ibonl(pad, 0)	
End Sub	

■ Measure Resistance by PC Key

Measures and imports by key input on the PC, and saves measurements in a text file.

```
Private Sub MeasureReadSub()
Dim buffer As String * 20
Dim recvstr As String
Dim pad As Integer
Dim gpibad As Integer
Dim timeout As Integer
Dim ud As Integer
Dim i As Integer

pad = 0
gpibad = 1
timeout = T10s

Call ibfind("gpib0", 0)
Call ibdev(pad, gpibad, 0, timeout, 1, 0, ud)
Call SendIFC(pad)
Open App.Path & "\data.csv" For Output As #1

Call Send(pad, gpibad, ":TRIG:SOUR IMM", NLen)
Call Send(pad, gpibad, ":INIT:CONT OFF", NLen)
For i = 1 To 10
    'Wait for PC key input
    'Create a key input check routine to set InputKey() = True when a key is pressed

    Do While 1
        If InputKey() = True Then Exit Do
        DoEvents
    Loop

    'After confirming key input, measure once, and read the measured value
    Call Send(pad, gpibad, ":READ?", NLen)

    Call Receive(pad, gpibad, buffer, STOPend)
    recvstr = Left(buffer, InStr(1, buffer, Chr(10)) - 1)
    Print #1, Str(i) & ", " & recvstr
Next

Close #1
Call ibonl(pad, 0)
End Sub
```

'Receiving buffer
'Receiving char string
'Controller Address
'Device Address
'Timeout period
'State (unused)

'Board Address 0
'RM3543Address 1
'Timeout about 10s

'Initialize GP-IB

'Open a text file for saving

'Select internal triggering
'Continuous measurement OFF

'Send ":READ?" to measure and import the measurement
'Receive

'Write to the file

■ External Trigger Measurement 1

Measure and import according to external triggering of the RM3543 (**F4** [MANU] key or $\overline{\text{TRIG}}$ signal input), and save measurements in a text file.

Private Sub MeasureTrigSub()	
Dim buffer As String * 20	'Receiving buffer
Dim rcvstr As String	'Receiving char string
Dim pad As Integer	'Controller Address
Dim gpibad As Integer	'Device Address
Dim timeout As Integer	'Timeout period
Dim ud As Integer	'State (unused)
Dim i As Integer	
pad = 0	'Board Address 0
gpibad = 1	'RM3543 Address 1
timeout = T100s	'Timeout 100s (because of external trigger wait state)
Call ibfind("gpib0", 0)	'Initialize GP-IB
Call ibdev(pad, gpibad, 0, timeout, 1, 0, ud)	
Call SendIFC(pad)	
Open App.Path & "\data.csv" For Output As #1	'Open a text file for saving
Call Send(pad, gpibad, ":TRIG:SOUR EXT", NLen)	'Select external triggering
Call Send(pad, gpibad, ":INIT:CONT OFF", NLen)	'Continuous measurement OFF
For i = 1 To 10	
Call Send(pad, gpibad, ":READ?", NLen)	'Send ":READ?" to measure and import the measurement
 Call Receive(pad, gpibad, buffer, STOPend)	'Receive
rcvstr = Left(buffer, InStr(1, buffer, Chr(10)) - 1)	
Print #1, Str(i) & "," & rcvstr	'Write to the file
Next	
Close #1	
Call ibonl(pad, 0)	
End Sub	

■ External Trigger Measurement 2

Measure and import according to external triggering of the RM3543 (**F4** [MANU] key or $\overline{\text{TRIG}}$ signal input), and save measurements in a text file.

(The RM3543 imports the most recent measurement by trigger input timing with the continuous measurement state)

Private Sub MeasureTrig2Sub()	
Dim buffer As String * 20	'Receiving buffer
Dim recvstr As String	'Receiving char string
Dim pad As Integer	'Controller Address
Dim gpibad As Integer	'Device Address
Dim timeout As Integer	'Timeout period
Dim ud As Integer	'State (unused)
Dim i As Integer	
pad = 0	'Board Address 0
gpibad = 1	'RM3543 Address 1
timeout = T100s	'Timeout 100s (because of external trigger wait state)
Call ibfind("gpib0", 0)	'Initialize GP-IB
Call ibdev(pad, gpibad, 0, timeout, 1, 0, ud)	
Call SendIFC(pad)	
Open App.Path & "data.csv" For Output As #1	'Open a text file for saving
Call Send(pad, gpibad, ":TRIG:SOUR IMM", NLen)	'Select internal triggering
Call Send(pad, gpibad, ":INIT:CONT ON", NLen)	'Continuous measurement ON
'Clear confirmation of External I/O TRIG input	
Call Send(pad, gpibad, ":IO:IN?", NLen)	
Call Receive(pad, gpibad, buffer, STOPend)	
recvstr = Left(buffer, InStr(1, buffer, Chr(10)) - 1)	
For i = 1 To 10	
'Wait for External I/O TRIG input	
Do While 1	
Call Send(pad, gpibad, ":IO:IN?", NLen)	
Call Receive(pad, gpibad, buffer, STOPend)	
If Left(buffer, 1) = "1" Then Exit Do	
DoEvents	
Loop	
Call Send(pad, gpibad, ":FETCH?", NLen)	'Send ":FETCH?" to import the most recent measurement
Call Receive(pad, gpibad, buffer, STOPend)	'Receive
recvstr = Left(buffer, InStr(1, buffer, Chr(10)) - 1)	
Print #1, Str(i) & ", " & recvstr	'Write to the file
Next	
Close #1	
Call ibonl(pad, 0)	
End Sub	

■ Set Measurement State

Sets up the measurement setting state.

```
'Measurement Setting Configuration
'Configures instrument settings for measurement
'Function: Resistance Measurement
'Range: 1Ω
'Sampling: FAST
'Triggering: External trigger
'Comparator enabled, REF% mode, reference value 1 Ω, tolerance +1.0% / -1.5%, beep upon Hi or Lo
Private Sub SettingsSub()
Dim pad As Integer
Dim gpibad As Integer
Dim timeout As Integer
Dim ud As Integer

pad = 0
gpibad = 1
timeout = T10s

Call ibfind("gpib0", 0)
Call ibdev(pad, gpibad, 0, timeout, 1, 0, ud)
Call SendIFC(pad)

Call Send(pad, gpibad, ":FUNC RES", NLEnd)
Call Send(pad, gpibad, ":RES:RANG 1E+0", NLEnd)
Call Send(pad, gpibad, ":SPEE FAST", NLEnd)
Call Send(pad, gpibad, ":TRIG:SOUR EXT", NLEnd)
Call Send(pad, gpibad, ":INIT:CONT ON", NLEnd)
Call Send(pad, gpibad, ":CALC:LIM:MODE REF", NLEnd)
Call Send(pad, gpibad, ":CALC:LIM:BEEP HL", NLEnd)
Call Send(pad, gpibad, ":CALC:LIM:REF 1E+0", NLEnd)
Call Send(pad, gpibad, ":CALC:LIM:PERC 1.0, -1.5", NLEnd)
Call Send(pad, gpibad, ":CALC:LIM:STAT ON", NLEnd)

Call ibonl(pad, 0)
End Sub
```

'Controller Address
'Device Address
'Timeout period
'State (unused)

'Board Address 0
'RM3543 Address 1
'Timeout about 10s

'Initialize GP-IB

'Select Resistance function
'Select 1000 mΩ range
'Select FAST sampling
'Select external triggering
'Continuous measurement ON
'From here on, comparator settings

'Comparator ON

Creation Procedure (Visual Basic 2005)


This section describes an example of how to use the Windows development language Visual Basic2005 Express Edition to operate the RM3543 unit from a PC via RS-232C, incorporate measurement values, and save measurement values to a file.

Visual Basic2005 is referred to as VB2005 hereafter.


NOTE

Depending on the environment of the PC and VB2005, the procedure may differ slightly from the one described here. For a detailed explanation on how to use VB2005, refer to the instruction manual or Help of VB2005.


- 1 Startup VB2005, select [**Windows Application**] from [**File**] - [**New Project**] (a), and click the “OK” button (b).

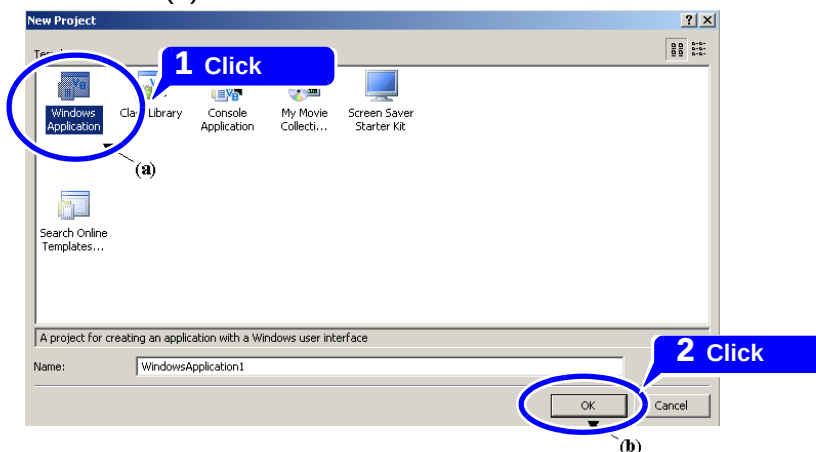


- 2 Click on the common control [**Button**] icon (a), and then drag the mouse over the form layout window (b) to insert the button.

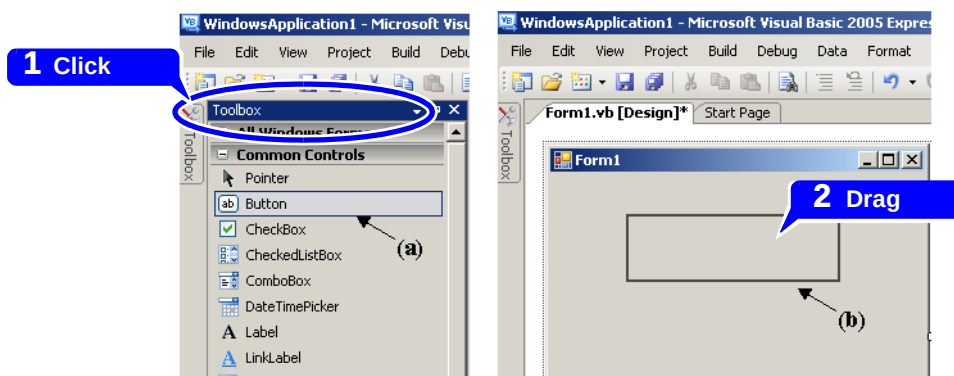


- 3** Use the method in step 2 to create another button, and edit the text in the property window of each button to appear as in the diagram.

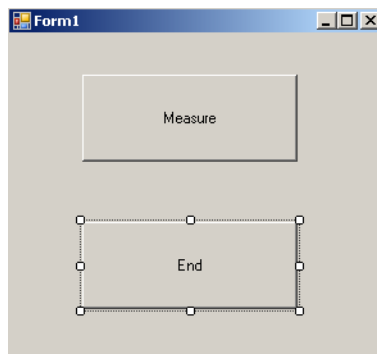

- 4** Right-click above [**Form1**] in the solution explorer, and select [**View Code**].

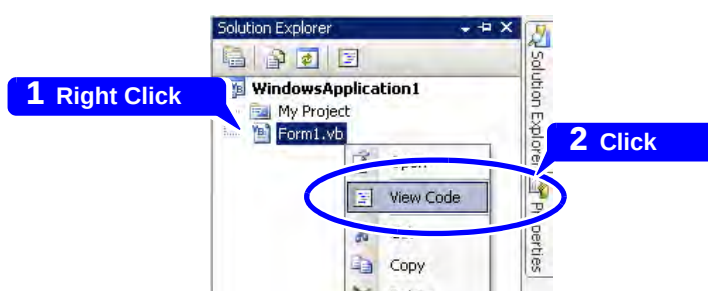

Follow the procedure below so that the VB2005 window becomes as shown in the diagram below. Write a program referring to Sample program (p. 166), and execute the created program.

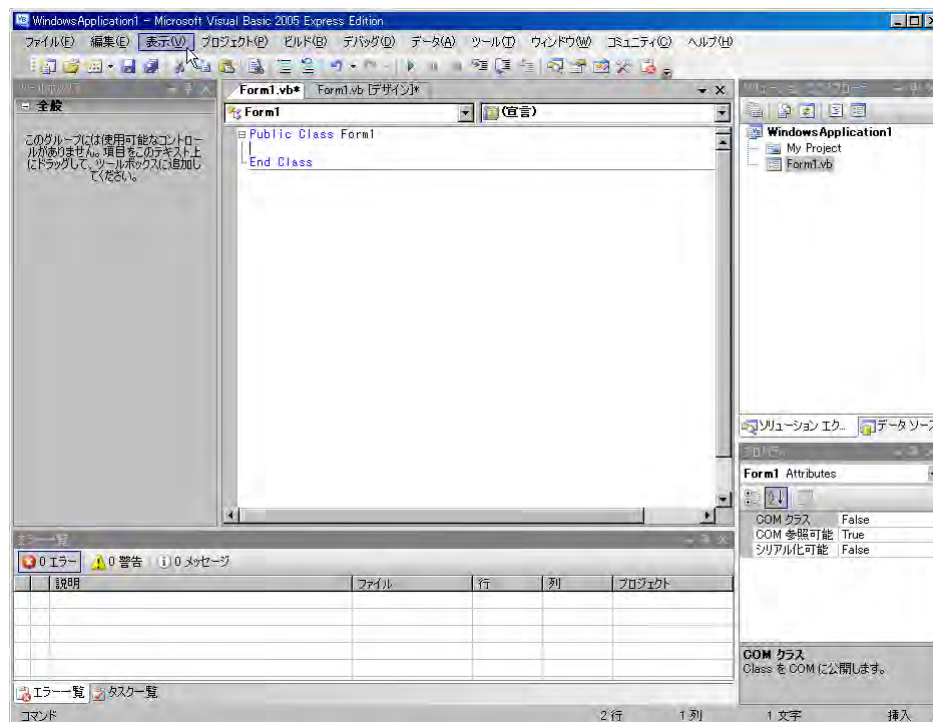

Sample Programs (Visual Basic 2005)

Shown below is a sample program which uses VB2005 to enact RS-232C communication, set the RM3543 measurement conditions, read measurement results and then save them to file. The sample program will be written in the following manner.

Creation Procedure (Visual Basic 2005) description	Write using sample program
Button created to begin measurement	Button1
Button created to close application	Button2

When the [Begin Measurement] is pressed, the RM3543 takes 10 measurements and writes the measurement values to a [data.csv] file.

When the [Quit] button is pressed the program closes.

The following program is written entirely in [Form1] code.

```
Imports System
Imports System.IO
Imports System.IO.Ports

Public Class Form1
    'Perform process when Button1 is pressed
    Private Sub Button1_Click(ByVal sender As System.Object, ByVal e As System.EventArgs) Handles Button1.Click
        Dim recvstr As String
        Dim i As Integer

        Try
            Button1.Enabled = False           'Disable buttons during communication..... (a)
            Button2.Enabled = False
            Dim sp As New SerialPort("COM1", 9600, Parity.None, 8, StopBits.One) 'Communication port setting ..... (b)
            sp.NewLine = vbCrLf               'Terminator setting..... (c)
            sp.ReadTimeout = 2000              '2 second time out ..... (d)
            sp.Open()                          'Open port
            SendSetting(sp)                    'RM3543 settings
            FileOpen(1, "data.csv", OpenMode.Output) 'Create text file to be saved ..... (e)
            For i = 1 To 10
                sp.WriteLine("*FETCH?")        'Begin measurement and read measurement results command..... (f)
                recvstr = sp.ReadLine()         'Read measurement results
                WriteLine(1, recvstr)           'Write to file
            Next i
            FileClose(1)                       'Close file
            sp.Close()                          'Close port
            Button1.Enabled = True
            Button2.Enabled = True
        Catch ex As Exception
            MessageBox.Show(ex.Message, "Error", MessageBoxButtons.OK, MessageBoxIcon.Error)
        End Try
    End Sub

    'Set measurement conditions
    Private Sub SendSetting(ByVal sp As SerialPort)
        Try
            sp.WriteLine(":TRIG:SOUR IMM") 'Select internal triggering
            sp.WriteLine(":INIT:CONT ON")  'Continuous measurement ON
        Catch ex As Exception
            MessageBox.Show(ex.Message, "Error", MessageBoxButtons.OK, MessageBoxIcon.Error)
        End Try
    End Sub

    'Close program when Button2 is pressed
    Private Sub Button2_Click(ByVal sender As System.Object, ByVal e As System.EventArgs) Handles Button2.Click
        Me.Dispose()
    End Sub
End Class
```

- (a) This makes it so that during communication the [Begin Measurement] and [Close] buttons cannot be pressed.
- (b) Matches the RM3543 communication conditions and the computer usage conditions.
 - The port to be used on the computer: 1
 - Transmission speed: 9600 bps
 - Parity: none
 - Data length: 8 bit
 - Stop bit: 1bit
- (c) Sets CR + LF as the terminator indicating the end of the sending and receiving character string.
- (d) Sets the reading operation time to 2 seconds.
- (e) Opens the "data.csv" file. However, if a file with this name already exists, the previous "data.csv" will be deleted and a new file created.
- (f) Sends the command to the RM3543 to perform one measurement and return that measurement result to the computer.

9.10 Device Compliance Statement



"Information on compliance to standards" based on the IEEE 488.2 standard

1. IEEE 488.1 interface functions	See: "GP-IB Specifications (Interface Functions) (RM3543-01 only)" (p. 102)
2. Operation with a device address other than 0 through 30	A setting outside the 0 to 30 range cannot be made.
3. Timing of changed device address recognition	A change of address is recognized immediately after changing.
4. Device settings at power on	The status information is cleared, and all other items are preserved. However, the header on/off setting, and response message separator and terminator are all reinitialized.
5. List of message exchange options	- Input buffer capacity and operation See: "Input Buffer" (p. 112) Queries to which multiple response message units are returned <pre> :CALCulate:STATistics:NUMBer?2 :CALCulate:STATistics:MAXimum?2 :CALCulate:STATistics:MINimum?2 :CALCulate:STATistics:LIMit?4 :CALCulate:STATistics:DEViation?2 :CALCulate:STATistics:CP?2 :MEMory:DATA? Number of stored values :CALCulate:LIMit:ABS?2 :CALCulate:LIMit:PERCent?2 :SYSTem:DATE?3 :SYSTem:TIME?3 </pre> - Queries producing responses as syntax checking is performed: All queries produce responses when syntax checking is performed. - Whether any queries produce responses when read: There are no queries which produce response messages at the instant they are read in by the controller. - Whether any commands are coupled: There are no relevant commands.
6. Summary of functional elements for use when constructing device specific commands, and whether compound commands or program headers can be used:	The followings can be used - Program message - Program message terminator - Program message unit - Program message unit separator - Command message unit - Query message unit - Command program header - Query program header - Program data - Character program data - Decimal program data - Compound commands and program headers
7. Buffer capacity limitations for block data	Block data is not used.

8. Summary of program data elements used in expressions, and deepest nesting level allowable in sub-expressions, including syntax restrictions imposed by the device.	Sub-expressions are not used. Character data and decimal data are the only program data elements used.
9. Response syntax for queries	See: "9.7 Message Reference" (p. 126)
10. Transmission congestion relating to device-to-device messages which do not conform to the general principles for basic response messages	There are no device to device messages.
11. Response capacity for block data	Block data does not appear in responses.
12. Summary of standard commands and queries used	See: "9.6 Message List" (p. 120)
13. Device state after a calibration query has been completed without any problem	The " *CAL? " query is not used.
14. Existence/nonexistence of " *DDT " command	The " *DDT " command is not used.
15. Existence/nonexistence of macro command	Macros are not used.
16. For queries related to identification, explanation of the response to the " *IDN? " query	See: "Standard Commands" (p. 127)
17. Capacity of the user data storage area reserved for when the " *PUD " command and the " *PUD? " query are being executed	The " *PUD " command and the " *PUD? " query are not used. Further, there is no user data storage area.
18. Resources when the " *RDT " command and the " *RDT? " query are being used	The " *RDT " command and the " *RDT? " query are not used. Further, there is no user data storage area.
19. Conditions which are influenced when " *RST ", " *LRN? ", " *RCL? ", and " *SAV " are used	" *LRN? ", " *RCL? ", and " *SAV " are not used. The " *RST " command returns the unit to its initial state. See: "Standard Commands" (p. 127), "Initialization Items" (p. 118)
20. Scope of the self-testing executed as a result of the " *TST? " query	See: "Standard Commands"; " *TST? " (p. 127)
21. Additional organization of the status data used in a device status report	See: "Event Registers" (p. 115)
22. Whether commands are overlap or sequential type	All the commands are sequential commands.
23. Criterion relating to the functions required at the instant that the termination message is produced, as a response to each command	Termination occurs when the command has been parsed. The :READ? query finishes when the measurement data is received.

Specifications Chapter 10

Measurement Ranges

0.00000 mΩ (10 mΩ range) to 1200.000 Ω (in 6 ranges)

Measurement Method

Measurement signal	Constant current
Measurement method	Four-terminal
Measurement jacks	BNC female, 22 mm pitch H _{CUR} jack Current sourcing terminal H _{POT} jack High-side voltage detection terminal L _{POT} jack Low-side voltage detection terminal L _{CUR} jack Current detection terminal GUARD jack (measurement ground potential)

Functions

(1) Comparator Function

Operation	Compares setting and measured values
Default state	ON Reference value 1000 Ω, Upper limit value 0.000%, Lower limit value 0.000% REF% mode
Setting	ON / OFF
Comparator mode	REF%/ ABS
Decision	Decisions include any fraction of least-significant display digit Hi Measurement value > Upper limit value IN Upper limit value ≥ measurement value ≥ Lower limit value Lo Lower limit value > measurement value

REF% Mode

Display	Absolute and relative value display $\text{Relative value} = \left(\frac{\text{Measurement value}}{\text{Reference value}} - 1 \right) \times 100 [\%]$
Displayable range	-999.999% to +999.999%
Reference value range	0.0000 mΩ to 1200.0 Ω
Upper/Lower limit ranges	-9.999% to +9.999% (when Upper limit value and Lower limit value are 10% or less) -99.99% to +99.99% (when Upper limit value or Lower limit value is more than 10%)

ABS Mode

Upper/Lower limit ranges	0.0000 mΩ to 1200.00 Ω
--------------------------	------------------------

(2) Range Switching

Comparator On	Per following table Table 1. Ranges of reference (REF%) tolerance and upper limit (ABS) values														
	<table> <tr> <th>Range of reference (REF%) and upper limit (ABS) values</th><th>Selected Range</th></tr> <tr> <td>0 to 10.009 mΩ</td><td>10 mΩ</td></tr> <tr> <td>10.01 to 100.09 mΩ</td><td>100 mΩ</td></tr> <tr> <td>100.1 to 1000.9 mΩ</td><td>1000 mΩ</td></tr> <tr> <td>1.001 to 10.009 Ω</td><td>10 Ω</td></tr> <tr> <td>10.01 to 100.09 Ω</td><td>100 Ω</td></tr> <tr> <td>100.1 to 1200.0 Ω</td><td>1000 Ω</td></tr> </table>	Range of reference (REF%) and upper limit (ABS) values	Selected Range	0 to 10.009 mΩ	10 mΩ	10.01 to 100.09 mΩ	100 mΩ	100.1 to 1000.9 mΩ	1000 mΩ	1.001 to 10.009 Ω	10 Ω	10.01 to 100.09 Ω	100 Ω	100.1 to 1200.0 Ω	1000 Ω
Range of reference (REF%) and upper limit (ABS) values	Selected Range														
0 to 10.009 mΩ	10 mΩ														
10.01 to 100.09 mΩ	100 mΩ														
100.1 to 1000.9 mΩ	1000 mΩ														
1.001 to 10.009 Ω	10 Ω														
10.01 to 100.09 Ω	100 Ω														
100.1 to 1200.0 Ω	1000 Ω														
	Manual setting is available on the Basic Settings screen.														
Comparator Off	The range is selected by Range key														
Default setting	1000 Ω range														

(3) Measurement Current Switching

Measurement current	100 mΩ range: 100 mA/ 1 A
Default state	100 mA

(4) Delay Setting**DELAY1**

Operation	Adjusts the mechanical delay of trigger input and probing (setting affects all ranges) When using the internal trigger, add 100 ms to the setting (to prevent heat generation).
Default state	0.0 ms
Setting range	0.0 ms to 100.0 ms

DELAY2

Operation	Adjusts measurement object response (for each range)
Default state	0.0 ms
Setting range	0.0 ms to 100.0 ms

(5) OVC (Offset Voltage Compensation)

Operation	Reverses measurement current polarity to eliminate offset voltage effects
Applicable ranges	10 mΩ to 1000 Ω range (All ranges)

(6) Integration Time Setting

Operation Sets the voltage detection acquisition time span (for each range)

Default state

Table 2. Integration Time Settings

Range	Integration Time			OVC
	FAST	MED	SLOW	
10mΩ	2.0 ms	5.0 ms	1PLC	ON
100mΩ (1A)	1.0 ms	5.0 ms	1PLC	ON
100mΩ (100mA)	0.5 ms	5.0 ms	1PLC	ON
1000mΩ	0.3 ms	2.5 ms	1PLC	ON
10Ω	0.3 ms	2.5 ms	1PLC	ON
100Ω	0.3 ms	1.5 ms	1PLC	ON
1000Ω	0.3 ms	1.5 ms	1PLC	ON

Integration time is doubled when OVC is enabled.

Setting range 0.1 ms to 100.0 ms, per PLC* setting
1 to 5PLC: 50 Hz, 1 to 6PLC: 60 Hz
*PLC: Power Line Cycle, One power line cycle (at 50 or 60 Hz)

(7) Averaging function

Operation Moving average (during internal trigger measurement) or simple average (during external trigger measurement) (for each range)

Default state OFF, No. of averaging iterations: 16Times

Setting ON/ OFF

Number of averaging iterations 2 to 32 times

(8) Faulty Measurement Detection**Out-of-Range Detection Function**

Operation Indicates under- or over-range values in the following conditions:

- Measured value is outside of the measurement range
- The relative calculation value is outside of the display range
- Measured value is outside of the A/D converter input range
- The zero-adjusted value is outside of the display range

Ex.: In the 1 Ω range with 0.5 Ω zero-adjustment in effect, a measurement of 0.1 Ω provides a zero-adjusted value of -0.4 Ω, which is outside of the display range.

Contact Check Function

Operation Checks the connections between H_{POT} and H_{CUR}, and between L_{POT} and L_{CUR} terminals (for each range)

Default state ON, 100 Ω

Setting ON/ OFF

Threshold setting 50 Ω/ 100 Ω/ 150 Ω/ 200 Ω/ 300 Ω/ 400 Ω/ 500 Ω (reference value)

Current Monitor Function

Operation Detects faults that can obstruct normal measurement current. This function cannot be disabled.

Voltage Level Monitor Function

Operation	Detects an error when the detection voltage is unstable (for each range)
Default state	ON, Normal
Setting	ON / OFF
Threshold setting	Loose Normal Severe

Comparator Decision and Display Indications

Table 3. Measurement States and Display Indications

		Constant Current Monitor	
		PASS	FAIL
Contact Check Voltage Level Monitor	PASS	Measurement value is displayed Normal Decision	Out-of-Range Display Hi Decision
	FAIL	Contact Error No Decision	Contact Error No Decision

(9) Probe Short-Circuit Detection

Operation	An error is detected within a certain period after $\overline{\text{EOM}}$ signal output if a connection lasting more than 1 ms is found between H_{POT} and H_{CUR} or L_{POT} and L_{CUR} terminals.
Default state	OFF, 5 ms
Setting	ON / OFF Test timing is 1 ms to 100 ms
Threshold	500 Ω fixed (reference value)

(10) Contact Improvement Function (Contact Improver)

Operation	Applies a contact improvement current (at oxidized film breakdown voltage) between the H_{POT} and H_{CUR} , and the L_{POT} and L_{CUR} terminals. (for each range) The PULSE setting applies the contact improvement current for only 100 μs before measuring.
Default state	ON, Current-limited to 35 mA
Setting	OFF/ ON/ PULSE
Applied voltage	20 V_{MAX}
Current limit	17 mA, 25 mA, 35 mA, 50 mA (peak current reference value)

(11) Current Mode Setting

Operation	Enable if measurement current flows when not measuring. (for each range) The CONT (continuous) setting is available only when the Contact Improver function is disabled.
Default state	PULSE
Setting	CONT/ PULSE

(12) Scaling Function

Operation	Measured values are corrected with the linear function $y=ax+b$. (for each range)
Default state	OFF, $a=1$, $b=0$
Setting	ON/ OFF
Coefficient a	0.50000 to 2.00000
Offset b	$\pm 10\%$ for each range

(13) Zero Adjustment

Operation	Nullifies wiring resistance when measuring with the two-terminal method.
Default state	OFF, $0\ \Omega$
Adjustment range	-1 to $10\ \Omega$

(14) Measurement-Start Logic Setting

Operation	Sets $\overline{\text{TRIG}}$ signal logic for EXT I/O
Default state	ON edge
Setting	OFF edge/ ON edge

(15) EOM Pulse Width Setting

Default state	PULSE Pulse width 5 ms
Setting	HOLD/ PULSE, 1 ms to 100 ms

(16) Data Output Function

Operation	Measured values are automatically output when measurement is finished.
Default state	OFF
Setting	ON/ OFF

(17) Output Data Format Setting

Default state	ASCII
Setting	ASCII/ BINARY

(18) Comparator Beeper Setting

Default state	OFF, HIGH, or LOW
Audibility	ON/ OFF
Signaling criteria	HIGH/ LOW/ HIGH or LOW/ IN

(19) Key-Press Beeper Setting

Default state	ON
Setting	ON/ OFF

(20) Clock

Auto calendar, auto leap year, 24-hour clock	
Accuracy	Approx. 4 minutes/month
Default state	01/01/2011, 00:00:00
Backup battery life	Approx. 10 years (23°C reference value)

(21) Power Line Frequency Setting

Operation	Selects the line voltage frequency
Default state	AUTO (auto-detect upon power on and resetting)
Setting	AUTO (50 or 60 Hz, fixed)/ 50 Hz / 60 Hz

(22) Reset Functions**Reset**

Operation	Resets settings (except the clock) to factory defaults
-----------	--

***RST (Remote command)**

Operation	Resets settings (except the clock and interface) to factory defaults When power is restored, reverts to the settings before *RST was sent
-----------	--

(23) Self-Calibration Function

Operation	Compensates for offset voltage and gain of measurement circuit
Compensation timing	When setting is changed and once every 10 minutes

(24) Memory Function

Operation	Measured values are stored by an EXT I/O $\overline{\text{TRIG}}$ signal or by pressing the F4 [MANU]* button * Displayed when EXT is selected on the [MENU] – [TRG] selection screen
Default state	OFF
Setting	ON/ OFF
Memory capacity	30,000 (volatile memory, no backup)

(25) Auto-Memory Function

Operation	When stable, measured values are acquired by internal continuous triggering during manual measurement The beeper sounds when the specified number of measurements is acquired Memory is cleared when acquired data has been transferred or printed by RS-232C During Auto-Memory operation, the statistical calculation function is always enabled. The voltage level monitor function is disabled.
Default state	OFF/ 10
Setting	ON/ OFF Number of measurements stored: 1 to 99

(26) Statistical Calculations

Operation	Statistical calculations are performed on measured values in memory.
Default state	OFF
Setting	ON/ OFF
Calculations	Total data count, Mean, Minimum value (sample no.), Maximum value (sample no.), Standard deviation of sample, Population standard deviation, Process capability indices

(27) Settings Monitor Function

Operation	Measurement settings of two instruments are compared, and if different, an alarm sounds and $\overline{\text{TRIG}}$ input is inhibited. However, the comparator thresholds of the 1 st stage instrument can be smaller than those of the 2 nd .
Default state	OFF, 1st, 0.000%
Setting	Function ON / OFF Measurement stages 1st / 2nd Tolerance range 0.000% to 9.999%
Compared contents	Comparator threshold, measurement speed

(28) Retry Function

Operation	The Retry function causes measurement to be automatically retried when a measurement fault occurs due to probe chatter. If a measurement fault persists after the specified continuous retry interval, retrying is aborted and the $\overline{\text{EOM}}$ signal is output.
Default state	ON, 50 ms
Setting	Function ON/ OFF Continuous retry interval 1 ms to 50 ms

(29) Self-Test

At power-on	ROM/RAM check, non-volatile ROM checksum test
--------------------	---

(30) Trigger Source Setting

Default state	EXT (external)
Settings	INT (Internal)/ EXT (external)

(31) Measurement Speed

Default state	FAST
Setting	FAST/ MED/ SLOW

(32) Key-Lock Functions

Operation	Disables operation of unneeded keys.
Setting	(1) Disables all except the comparator setting and cancel keys (2) Disables all except the cancel key (3) All front panel keys are disabled when the $\overline{\text{KEY_LOCK}}$ signal is received.

(33) Remote Control

Operation	During REMOTE operation by RS-232C or GP-IB, all front panel operations are disabled.
Cancellation methods	F1 [LOCAL] key By RS-232C : SYSTem:LOCa l command By GP-IB GTL command Reset At power-on

Interface**(1) Display**

Monochrome graphical	LCD 240 × 64
Backlight	White LED Brightness adjustment range 0 to 100% When using EXT trigger source, brightness is automatically reduced when keys are not used. Brightness recovers upon front panel key operation.
Contrast	Adjustment range 0 to 100%

(2) Keys

 , REF%, ABS, 0, 1, 2, 3, 4, 5, 6, 7, 8, 9, +/-, BACK SPACE, Period, ENTER, ESC, mΩ, Ω, kΩ, MΩ, %,  ,  ,  ,  , F1, F2, F3, F4

(3) External Interface**EXT I/O**

Input Signals	$\overline{\text{TRIG}}$, $\overline{\text{HOLD}}$, $\overline{\text{KEY_LOCK}}$, $\overline{\text{0ADJ}}$, $\overline{\text{PRINT}}$, $\overline{\text{CAL}}$, $\overline{\text{PRB_CHECK}}$ Optocoupler-isolated no-voltage contact inputs L voltage (assert): 0 to 1 V (3 mA input current (reference value)) H voltage (de-assert): OPEN or 5 V to 30 V
Output Signals	$\overline{\text{HI}}$, $\overline{\text{IN}}$, $\overline{\text{LO}}$, $\overline{\text{EOM}}$, $\overline{\text{INDEX}}$, $\overline{\text{ERR}}$, $\overline{\text{PRB_SHORT}}$, $\overline{\text{CE_HI}}$, $\overline{\text{CE_LO}}$ Optocoupler-isolated npn open-collector output V_{CE} DC30 V_{MAX} Residual voltage 1.5 V or less ($I_{\text{C}} = 50 \text{ mA}$) / 1 V or less ($I_{\text{C}} = 10 \text{ mA}$) I_{C} 50 $\text{mA}_{\text{MAX}}/\text{ch}$
External power output	(1) 4.5 to 5 V, 100 mA_{MAX} 11 to 13 V, 20 mA_{MAX} • However, loads cannot be drawn from the +5 V and +12 V power supplies at the same time. (2) Isolation: Floating from protective ground potential and measurement circuit Insulation rating vs. ground: not more than 50 VDC, 33 Vrms AC, and 46.7 Vpk AC

RS-232C

Communication contents	Remote control, measured value output (export)
Transfer method	Asynchronous, Full duplex
Transmission speed	9,600bps (default setting)/ 19,200bps/ 38,400bps
Data length	8 bit
Stop bit	1
Parity	none
Delimiter	Transmit CR+LF, Receive CR or CR+LF
Handshaking	No X-flow, no hardware flow
Protocol	Non-procedure
Connector	Male 9-pin D-sub, with #4-40 attachment screws

Printer

Printing Contents	Measurement data ($\overline{\text{PRINT}}$ signal input), Total data count, Mean, Minimum value (sample no.), Maximum value (sample no.), Standard deviation of sample, Population standard deviation, Process capability, No. of IN, No. of Hi and Lo, No. of OvrRng, No. of Measurement faults	
Communications	Communications method	Asynchronous RS-232C
	Transmission speed	9,600bps
	Data length	8 bits
	Stop bit	1 bit
	Parity	none
	Delimiter	Transmit CR+LF, Receive CR or CR+LF
	Handshake	No X-flow, no hardware flow

GP-IB interface (RM3543-01 only)

Communication contents	Remote control	
Interface Functions	SH1	All Source Handshake functions are supported.
	AH1	All Acceptor Handshake functions are supported.
	T6	Basic talker functions are supported. Serial poll function are supported. No talk-only mode. The talker cancel function with MLA (My Listen Address) is supported.
	L4	Basic listener functions are supported. No listen-only mode. The listener cancel function with MTA (My Talk Address) is supported.
	SR1	All Service Request functions are supported.
	RL1	All Remote/Local functions are supported.
	PP0	No Parallel Poll function.
	DC1	All Device Clear functions are supported.
	DT1	All Device Trigger functions are supported.
	C0	No Controller functions are supported.
Miscellaneous	Conforms to IEEE 488.2	

Settings Monitor terminal (SET MONITOR)

Connector	Male 9-pin D-sub, with #4-40 attachment screws
Connection cable	Crossover

Measurement Specifications

(1) Resistance Measurement Accuracy

Conditions of guaranteed accuracy

Warm-up time At least 30 minutes

Integration time Set longer than the initial "Integration Time Setting" (p. 173) for the default PLC setting, unspecified for ms setting

Temperature and humidity range for guaranteed accuracy 23±5°C, 80%RH or less

Period of guaranteed accuracy 1 year

Temperature variation after self-calibration is within ±2°C.

Add thermal coefficient (±1/10th of measurement accuracy per °C) from 0 to 18°C and from 28 to 40°C.

Accuracy %rdg.+%f.s. (calculated as f.s. = 1,000,000dgt., or 0.001% f.s. = 10dgt.)

Range	Max. Display ^{*1}	FAST	MED	SLOW	Measurement Current ^{*2}	Open-Terminal Voltage
10mΩ	12.00000 mΩ	0.060 + 0.005	0.060 + 0.003	0.060 + 0.001 ^{*4} 0.060 + 0.002	1 A	20 V _{MAX} ^{*3}
100mΩ	120.0000 mΩ	0.060 + 0.003	0.060 + 0.002	0.060 + 0.001	1 A	
100mΩ	120.0000 mΩ	0.015 + 0.008	0.015 + 0.003	0.015 + 0.002	100 mA	
1000mΩ	1200.000 mΩ	0.012 + 0.003	0.012 + 0.002	0.012 + 0.001	100 mA	
10Ω	12.00000 Ω	0.010 + 0.003	0.008 + 0.002	0.008 + 0.001	10 mA	
100Ω	120.0000 Ω	0.009 + 0.003	0.007 + 0.002	0.007 + 0.001	10 mA	
1000Ω	1200.000 Ω	0.008 + 0.003	0.006 + 0.002	0.006 + 0.001	1 mA	

*1 Negative values can be up to 10% of positive full scale.

*2 Measurement current accuracy is ±5%

*3 Less than 20 mV when not measuring, with Pulse current mode and Contact Improver set to OFF or Pulse (by 10-MΩ input-impedance voltmeter)

*4 When the number of averaging iterations is set to 16 or higher, accuracy is defined for slow measurement in the 10 mΩ range only. For other configurations, accuracy is not dependent on the averaging setting.

- f.s. (maximum display value) The maximum displayable value. This is usually the name of the currently selected range.
- rdg. (reading or displayed value) The value currently being measured and indicated on the measuring instrument.
- dgt. (resolution) The smallest displayable unit on a digital measuring instrument, i.e., the input value that causes the digital display to show a "1" as the least-significant digit.

(2) Measurement Time (default settings)

Range	FAST	MED	SLOW	Upper value: 50Hz power line frequency Lower value: 60Hz power line frequency Tolerance $\pm 10\% \pm 0.2$ ms (Without retry) *1 When performing external trigger measurement. When performing internal trigger measurement, same as when averaging is off.
10m Ω Average: 16 times*1	176 ms	272 ms	752 ms 640 ms	
10m Ω	11 ms	17 ms	47 ms 40 ms	
100m Ω (1A)	5.0 ms	13 ms	43 ms 36 ms	
100m Ω (100mA)	3.8 ms	13 ms	43 ms 36 ms	
1000m Ω	2.0 ms	6.4 ms	41 ms 35 ms	
10 Ω	1.6 ms	6.0 ms	41 ms 34 ms	
100 Ω	1.6 ms	4.0 ms	41 ms 34 ms	
1000 Ω	1.6 ms	4.0 ms	41 ms 34 ms	

Environment and Safety Specifications

Operating environment	Indoors, Pollution degree 2, up to 2000 m (6562-ft.) ASL
Storage temperature and humidity	-10°C to 50°C (14 to 122°F), 80%RH or less (non-condensating)
Operating temperature and humidity	0°C to 40°C (32 to 104°F), 80%RH or less (non-condensating)
Dielectric strength	1.62 kV AC for 1 min., Cutoff current 10 mA, between all power terminals and protective ground, interfaces, and measurement jacks
Applicable Standards Safety EMC	EN61010 EN61326 Class A EN61000-3-2 EN61000-3-3 Effect of radiated radio-frequency electromagnetic field: 3%f.s. at 10V/m Effect of conducted radio-frequency electromagnetic field: 2%f.s. at 3 V
Power source	Rated supply voltage 100 to 240 VAC (Voltage fluctuations of $\pm 10\%$ from the rated supply voltage are taken into account) Rated supply frequency: 50/60 Hz Anticipated transient overvoltage 2,500 V
Maximum rated power	40 VA
Dimensions	Approx. 260W x 88H x 300D mm (10.24"W x 3.46"H x 11.81"D)
Mass	Approx. 3.0 kg (105.8 oz.)

Accessories

- Power Cord (2-line + ground) (1)
- EXT I/O Male Connector (1)
- Instruction Manual (This document) (1)
- Operation Guide (1)

Options

- Model 9140 4-terminal Probe
- Model 9500 4-terminal Probe
- Model 9262 Test Fixture (less than 10 m Ω residual resistance after zero adjustment)
- Model 9263 SMD Test Fixture (less than 10 m Ω residual resistance after zero adjustment)

Interface Cables:

- Model 9637 RS-232C Cable (9-pin to 9-pin/ crossover cable)
- Model 9638 RS-232C Cable (9-pin to 25-pin/ crossover cable)
- Model 9151-02 GP-IB Connector Cable (2 m)

Maintenance and Service

Chapter 11

11.1 Troubleshooting

Inspection and Repair



WARNING

Do not attempt to modify, disassemble or repair the instrument; as fire, electric shock and injury could result.

NOTE

- If damage is suspected, check the "Before Returning for Repair" p.184) section before contacting your dealer or Hioki representative.

Transporting

- Use the original packing materials when transporting the instrument, if possible.
- Pack the instrument so that it will not sustain damage during shipping, and include a description of existing damage. We do not take any responsibility for damage incurred during shipping.

Replaceable Parts and Operating Lifetimes

Useful life depends on the operating environment and frequency of use. Operation cannot be guaranteed beyond the following periods. For replacement parts, contact your dealer or Hioki representative.

Part	Life
LCD (to half brightness)	Approx. 50,000 hours
Electrolytic Capacitors	Approx. 10 years
Lithium Battery	Approx. 10 years
	The instrument contains a built-in backup lithium battery. If the date and time deviate substantially when the instrument is switched on, it is the time to replace that battery. Contact your dealer or Hioki representative.

If no measured value is displayed even when the probes are shorted together, internal damage may have occurred. Contact your dealer or Hioki representative.

Before Returning for Repair

If abnormal operation occurs, check the following items.

Symptom	Check Items	
The display does not appear when you turn the power on.	- Is the power cord disconnected? - Are connections made correctly?	Verify that the power cord is connected properly. (p. 22)
Keys do not work.	- Is any key being held down? - Is Key-Lock enabled (M.LOCK or F.LOCK displayed)? - Is remote control communication enabled (RMT displayed)? - Is the EXT I/O KEY_LOCK signal asserted (Low level)?	Verify key operation. Cancel Key-Lock (p. 64) Switch to local control (p. 108) De-assert the KEY_LOCK signal (High level).
Measured values are unstable.	Are the cables and measurement object adequately shielded?	"Appendix 3 Unstable Measurement Values" (p. A3)
Measured values are shifted.	- Is zero-adjust enabled? - Are the CUR and POT terminals connected before contacting the measurement object? - Is the measured object calibrated correctly? - Is the GUARD terminal drawing more than 10 mA? (the GUARD terminal shield may be contacting a BNC terminal) - There may be a large thermal emf.	"3.6 Zero Adjustment" (p. 32)
If the cause is unknown	Try performing a system reset (p. 71). All settings are returned to their factory defaults.)	

11.2 Cleaning

NOTE

- To clean the instrument, wipe it gently with a soft cloth moistened with water or mild detergent. Never use solvents such as benzene, alcohol, acetone, ether, ketones, thinners or gasoline, as they can deform and discolor the case.
- Wipe the LCD gently with a soft, dry cloth.

11.3 Error Displays and Remedies

The following messages are displayed when the instrument detects an error or abnormal measurement setting. If repair is necessary, contact your dealer or Hioki representative.

Display	Description	Remedy
+OvrRng/-OvrRng	Measurement out of range (p. 38)	Select the appropriate range.
C.E. Hi	Hi wiring contact error (p. 38)	Check for cable breakage and worn out probes.
C.E. Lo	Lo wiring contact error (p. 38)	Check for cable breakage and worn out probes.
C.E. Volt	Voltage Level Monitor error (p. 38)	Check for worn out probes. Keep wiring away from nearby equipment.
ERR:001 LOW limit is higher than UPP limit	Upper limit is below lower limit	Check comparator settings (p. 34).
ERR:002 Exceeding range (From 0Ω to 1200Ω)	Comparator input is out of range. (out-of-range reference value, such as 1000 kΩ)	Check comparator settings (p. 34).
ERR:003 Setting monitor error. (COMP)	Comparator settings are different from the other RM3543.	Make comparator settings the same (p. 56).
ERR:004 Setting monitor error. (SPEED)	SPEED setting is different from the other RM3543.	Make SPEED settings the same (p. 56).
ERR:011 Zero adjustment error. Offset value exceeds 10Ω.	Out of zero-adjust range	Check the zero-adjustment procedure (p. 32).
ERR:021 Probe short error	Short-circuited probe	Check for correct connections (p. 54).
ERR:031 Command error	Command Error	Check for incorrect commands (p. 119).
ERR:032 Execution error	Execution Error	Check the last command and instrument state (p. 119).
ERR:033 RS-232C communication error	I/F Communications Error	Check communication settings and wiring.
ERR:034 Setting monitor communication error	Settings monitor communications error	Check settings monitor settings and wiring (p. 56).
ERR:041 Line frequency detection error	Error detecting the line frequency	Manually set the frequency to match the line (p. 67).
ERR:042 Clock error Reset?(11-01-01 00:00:00) Press F1 Key.	The clock is not set, so pressing F1 [OK] displays the initialized time 11-01-01 00:00:00.	The back-up battery needs to be replaced. Contact your nearest Hioki representative.
ERR:101 Hardware error (Main CPU ROM)	Hardware failure.	Repair is required.
ERR:102 Hardware error (Main CPU RAM)	Hardware failure.	Repair is required.
ERR:103 Hardware error (SRAM)	Hardware failure.	Repair is required.
ERR:104 Hardware error (Adjustment data)	Hardware failure.	Repair is required.
ERR:105 Hardware error (Backup data) Reset? Press F1 Key.	Hardware failure. (back-up data is corrupted)	Repair is required. Press F1 [OK] to resets the instrument.
ERR:106 Hardware error (Meas CPU communication)	Hardware failure.	Repair is required.
ERR:107 Hardware error (Meas CPU ROM)	Hardware failure.	Repair is required.

11.3 Error Displays and Remedies

Display		Description	Remedy
ERR:108	Hardware error (Meas CPU RAM)	Hardware failure.	Repair is required.
ERR:109	Hardware error (Measurement end)	Hardware failure.	Repair is required.
ERR:110	Hardware error (Zero measurement end)	Hardware failure.	Repair is required.
ERR:111	Hardware error (F.S. measurement end)	Hardware failure.	Repair is required.
ERR:112	Hardware error (Calibration)	Hardware failure.	Repair is required.
ERR:113	Hardware error (Meas CPU A/D data)	Hardware failure.	Repair is required.
ERR:114	Hardware error (Meas CPU)	Hardware failure.	Repair is required.
ERR:115	Hardware error (FAN Stop)	Hardware failure.	Repair is required.
INFO:001	Printing...	Printing in progress.	—
INFO:002	Memory full	Memory full.	Delete stored data.
INFO:011	Zero adjusting...	Zero-adjust in progress.	—
INFO:012	Clearing zero adjustment	Clearing zero-adjust.	—
INFO:021	Clear all memory and statistics data?	Confirm deletion of all memory data. (F1:CANCEL/ F2:YES)	—
INFO:022	Undo memory and statistics data?	Confirm deletion of one memory data item. (F1:CANCEL/ F2:YES)	—
INFO:023	Save and Return? [CANCEL]: Continue to edit.	Confirm MISC setting, or CANCEL to return to previous screen. (F1:CANCEL/ F2:SAVE/ F3:NOSAVE)	—
INFO:024	System Reset?	Confirm system reset. (F1:CANCEL/ F4:YES)	—
INFO:031	Press enter code.	Waiting for key code entry to access adjustment mode.	—
-----		Not measuring When awaiting a trigger after changing settings, and immediately after power-on.	—

11.4 Disposing of the Instrument

The instrument uses a lithium battery for back-up power to the clock. When disposing of this instrument, remove the lithium battery and dispose of battery and instrument in accordance with local regulations.


Removing the Lithium Battery




WARNING To avoid electric shock, turn off the power button and disconnect the power cord and measurement cables before removing the lithium battery.

Required tools:


- One Phillips screwdriver (No.1)
- One wire cutter (to remove the lithium battery)

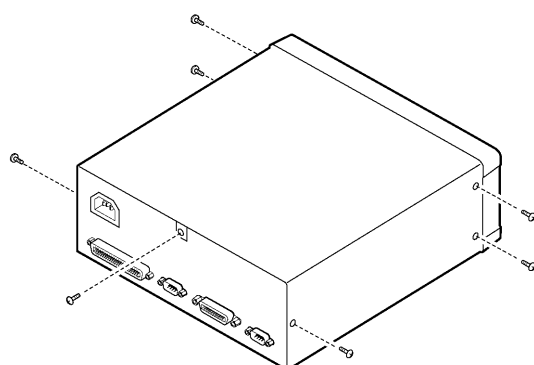

(Overhead View)

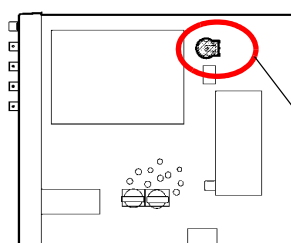

Lithium Battery

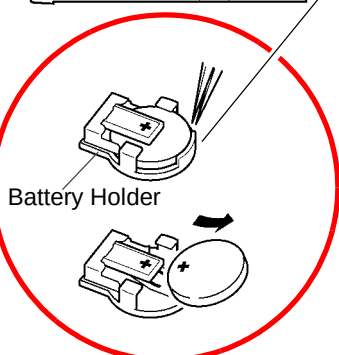

Battery Holder

- 1 Verify that the power is off, and remove the connection cables and power cord.
- 2 Remove the six screws from the sides and one screw from the rear.
- 3 Remove the cover.
- 4 Insert the tweezers between the battery and battery holder as shown in the diagram below and lift up the battery.



CAUTION Take care not to short the + and -. Doing so may cause sparks.

CALIFORNIA, USA ONLY

This product contains a CR Coin Lithium Battery which contains Perchlorate Material - special handling may apply.
See www.dtsc.ca.gov/hazardouswaste/perchlorate

Appendix

Appendix 1 Four-Terminal (Voltage-Drop) Method

The Four-Terminal method is essential for measuring very small resistance values.

With two-terminal measurements (Fig. 1), the resistance of the test leads is included in the measured resistance, resulting in measurement errors.

The four-terminal method (Fig. 2) consists of current source terminals (H_{CUR} , L_{CUR}) to provide constant current, and voltage detection terminals (H_{POT} , L_{POT}) to detect voltage drop.

Because of the high input impedance of the voltmeter, measurement requires practically no current flow through the leads connecting the voltage detection terminals to the test object, practically eliminating the effects of lead and contact resistance on the measurement.

Two-Terminal Measurement Method

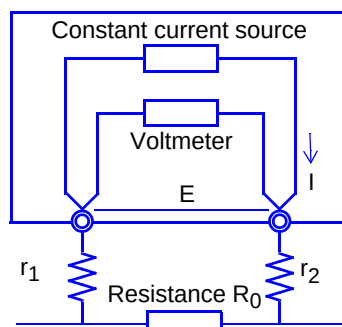


Figure 1.

Measurement current I flows through test object resistance R_0 as well as lead resistances r_1 and r_2 . The voltage to be measured is obtained by $E = I(r_1 + R_0 + r_2)$, which includes lead resistances r_1 and r_2 .

Four-Terminal Measurement Method

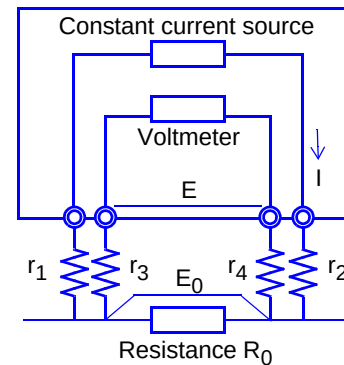



Figure 2.

Current I flows from r_2 through DUT resistance R_0 and through r_1 . The high input impedance of the voltmeter allows only negligible current flow through r_3 and r_4 . So the voltage drop across r_3 and r_4 is practically nil, and voltage E across the measurement terminals and voltage E_0 across test object resistance R_0 are essentially equal, allowing test object resistance to be measured without being affected by r_1 to r_4 .

Appendix 2 Effect of Thermal emf

Thermal emf is the potential difference that occurs at the junction of two dissimilar metals, which if sufficiently large, can cause erroneous measurements. Because this instrument functions by measuring potential difference while applying a constant direct current through the test object, the effect of thermal emf can affect measurements. The amplitude of thermal emf depends on the temperature of the measurement environment, with the force generally being greater at higher temperature.

Thermal emf typically occurs at any junction of dissimilar metals, including between the test probe tips and the test object.

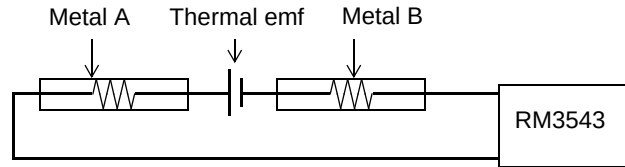

Measurement discrepancy caused by thermal emf:

(Example)

If the amplitude of electromotive force is $10\ \mu\text{V}$ and the resistance to be measured is $1\ \Omega$, the measurement current of the LP $1\ \Omega$ range is $10\ \text{mA}$, and the actual measured value displayed on the instrument is as follows:
 $(1\ \Omega \times 10\ \text{mA} + 10\ \mu\text{V}) \div 10\ \text{mA} = 1.00100\ \Omega$

The offset voltage compensation (OVC) function is enabled in all ranges to minimize the effects of thermal emf.

OVC employs the principle that the following value is known to be a true resistance value from $R_P (>0)$, the value measured with current flowing in the positive direction, and $R_N (<0)$, the value measured with current flowing in the negative direction.

(R_N is a negative value)

$$\frac{R_P - R_N}{2}$$

When the test object has inductance (i.e., is an inductor, etc.), some delay (DELAY2) must be set (p. 42) to allow adequate current flow before starting measurement.

To fine tune the delay, begin with a longer delay than necessary, then gradually shorten it while watching the measured value.

Appendix 3 Unstable Measurement Values

If the measurement value is unstable, verify the following.

(1) Effect of Noise from Power Supply Lines

Noise from power supply lines arises from commercial power, and not only from power lines or outlets, but also as radiated emissions from fluorescent lights and home appliances. The frequency of the noise from power supply lines depends on the commercial supplied power frequency, and is typically 50 or 60Hz.

To minimize the affects of this noise from power supply lines, measurements are generally timed to occur at an integer multiple of the supplied power period.

The instrument provides FAST, MEDIUM, and SLOW measurement speed settings.

With the FAST setting, measurements are not synchronized with the power line period, so measurements may be scattered.

In such cases, use the SLOW setting or take noise suppression countermeasures.

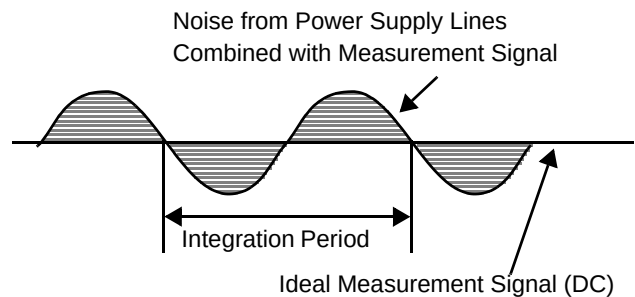


Figure 1. Effect of Noise from Power Supply Lines

For high-resistance measurements, connecting the shield to the GUARD potential is helpful.

For the lower resistance ranges, the measurement wires should be twisted together, apart from the GUARD-potential shield.

Even when the integration time is set by a PLC, measured values are unstable if the line frequency setting is 60 Hz and the instrument is used in a 50-Hz region. Confirm the line frequency setting of the instrument.

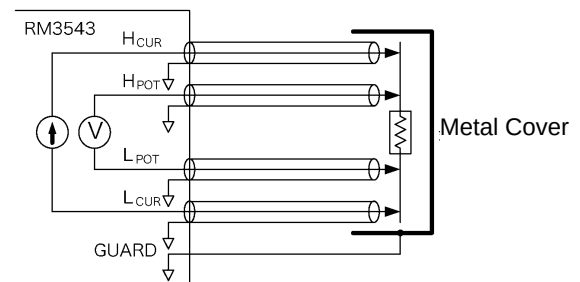


Figure 2. For High-Resistance Measurements

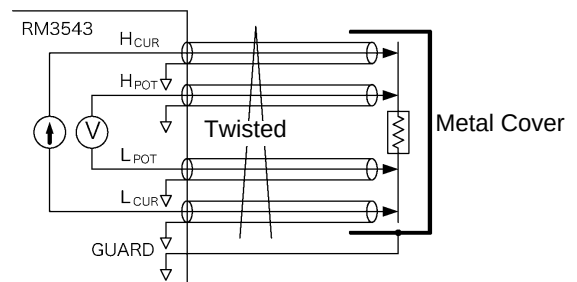


Figure 3. For Low-Resistance Measurements

Measurement should be conducted as far as possible from devices emitting electric or magnetic fields such as power cords, fluorescent lights, solenoid valves and PC displays. If electrical noise ingress is a problem, prepare the measurement leads as shown in Figs. 2 and 3.

If thermal emf is a problem, use the RM3543's OVC function. If OVC cannot be used for reasons such as tact time limitations, use a low-thermal emf material such as copper for wiring, and protect against airflow on connecting parts (test object or connectors).

(2) Multi-Point Contacts with Clip Leads

The ideal conditions for four-terminal measurements are shown in Fig. 4: current flows from the far probe and voltage is detected with uniform current distribution.

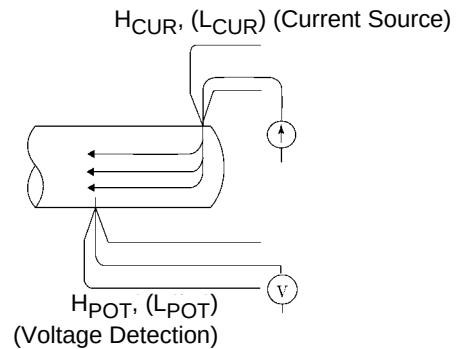


Figure 4. Ideal Four-Terminal Method

To facilitate measurement, the tips of the Model 9140 4-Terminal Probe are jagged.

When a clip is opened as shown in Fig. 5, measurement current flows from multiple points, and voltage is detected at multiple points. In such cases, the measurement value varies according to the total contact area.

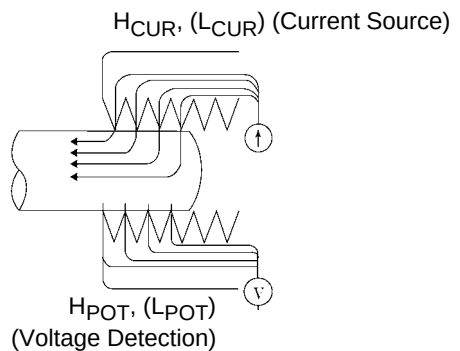


Figure 5. Measurement with Model 9140 4-Terminal Probe

Additionally, as shown in Fig. 6, when measuring the resistance of a 100 mm length of wire, the length between the nearest edges of the clips is 100mm, but the length between the farthest edges of the clips is 110mm, so the actual measurement length (and value) has an uncertainty of 10mm (10%). If measured values are unstable for any of these reasons, maximize stability by measuring with point contacts as far as possible.

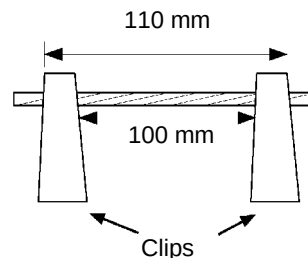


Figure 6. Measuring the resistance of a 100 mm length of wire

(3) Wider/Thicker DUTs

If the DUT has a certain width or thickness like boards or blocks, it will be difficult to measure accurately using Pin Type Leads or Clip Type Leads. By using such measurement probes, there may be considerable fluctuation of the measured value due to contact pressure or contact angle. For example, when measuring a W300 x L370 x t0.4 mm metal board, the measured values are fairly different, even if measuring the same points, as shown below:

- 0.2mm pitch Pin type lead: 1.1 m Ω
- 0.5mm pitch Pin type lead: 0.92 to 0.97 m Ω
- Model 9287-10 Clip Type Lead: 0.85 to 0.95 m Ω

This does not depend on the contact resistance between probes and the DUT, but on the current distribution on the DUT.

Fig. 7 is an example of plotting equivalent electric potential lines of a metal board. Similar to the relation between atmospheric pressure distribution and wind on a weather forecast diagram, current density is higher in locations where the equivalent electric potential lines are narrowly spaced, and lower in locations where they are widely spaced. Through this example, it is shown that the electric potential slope is larger around current applying points. This phenomenon is caused by high current density while current expands on the metal board. Due to this phenomenon, measured values should be rather different, even if the connected position difference is quite slight, in case connecting voltage detection terminals (of measurement probes) near current applying points.

It is known that such effects can be minimized by detecting the voltage within the space between the current contact points. Generally, if the distance between the voltage detection points and their corresponding current application points (CUR, POT terminals) is greater than the width (W) or thickness (t) of the DUT, current distribution may be considered uniform. As shown in Fig. 8, POT leads should be 3W or 3t mm or more inside from the CUR leads.

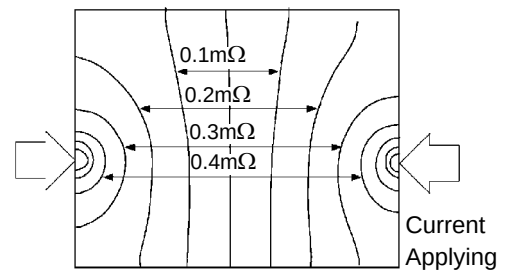


Figure 7. Equipotential lines on a metal board (W300 x L370 x t0.4 mm)

* Applying 1 A current on points on edges and plotting equivalent electric potential lines at each 50 μ V level

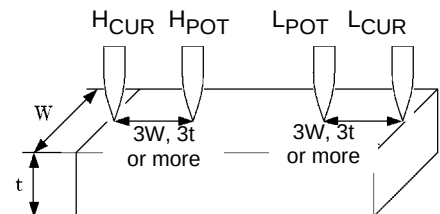


Figure 8. Probe Positions on Wider/Thicker DUT

(4) Unstable Temperature of the DUT

Copper wire resistance has a temperature coefficient of about 0.4%/°C. Just holding a copper wire in the hand raises its temperature, causing its resistance to be increased as well. When the hand is removed from the wire, temperature and resistance decrease.

Varnished windings are more susceptible to temperature increase, so the resistance tends to be relatively high.

Use an instrument with a temperature-compensation function such as the Hioki RM3544, RM3545, and RM3548 to minimize copper-like temperature dependence.

(5) DUT Becomes Warm

The maximum applied power to a measurement object by this instrument is determined as follows. The resistance of samples with small thermal capacity can change due to heating.

Range	Measurement Current	Maximum Applied Power = (Measured Resistance) x (Measurement Current) ²
10mΩ	1 A	12 mW
100mΩ	1 A	120 mW
100mΩ	100 mA	1.2 mW
1000mΩ	100 mA	12 mW
10Ω	10 mA	1.2 mW
100Ω	10 mA	12 mW
1000Ω	1 mA	1.2 mW

(6) Ingress of External Noise

Measurement should be conducted as far as possible from devices emitting electric or magnetic fields such as power cords, fluorescent lights, solenoid valves and PC displays. If external noise ingress is a problem, prepare the measurement leads as shown in Fig. 9.

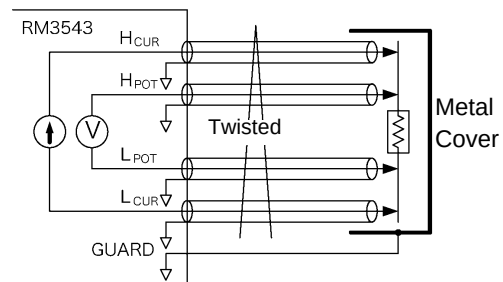


Figure 9. Wiring to Minimize Noise Ingress

(7) Measuring Transformers and Motors

If noise enters an unconnected terminal of a transformer or if motor rotor moves, measurements may be unstable due to induced voltage on the measured winding. Pay attention to the treatment of unconnected terminals on transformers or to motor vibration.

(8) Measuring Large Transformers or Motors

When measuring high-inductance (high-Q) DUTs such as large transformers or motors, measured values may be unstable.

The RM3543 depends on constant current flow through the DUT, but producing constant current becomes impossible as inductance approaches infinity. To obtain stability in a constant-current source with a large inductance, response time is sacrificed. If you find that resistance values are scattered when measuring large transformers or motors, please consider the above or contact your local HIOKI distributor for further assistance.

(9) Non-Four-Terminal Measurements

The four-terminal method requires that four probes be connected to the DUT.

By measuring as shown in Fig.10, the measured resistance includes that of the contacts between the probes and DUT. Typical contact resistance is several milliohm with gold plating, and several tens of milliohm with nickel plating. With measurement values of several $k\Omega$ this would not seem to be a problem, but if a probe tip is oxidized or dirty, contact resistance on the order of a $k\Omega$ is not unusual.

To maximize the opportunity for proper measurements, emulate the four-terminal method as close as possible to the contact points of the DUT. (Fig.11)

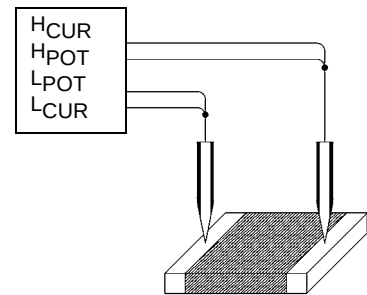


Figure. 10 Two-Terminal Measurement

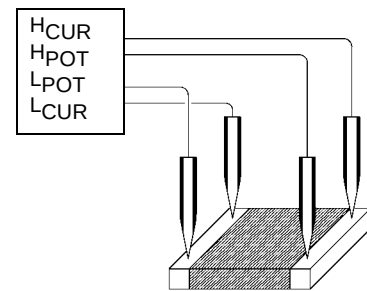


Figure. 11 Four-Terminal Measurement

(10) Effects of cable configuration

To cancel thermal EMF, the RM3543 periodically reverses the polarity of the measurement current (via its OVC function). Additionally, it only applies the current during measurement to limit heat generation. Rapid fluctuations in this measurement current trigger corresponding fluctuations in the magnetic field, inducing the following voltage in the voltage detection line between H_{POT} and L_{POT} :

$$v = \frac{d\phi}{dt} = \frac{d}{dt} \left(\mu S \frac{I}{l} \right) = \frac{\mu S}{l} \cdot \frac{dI}{dt}$$

To avoid the effects of this voltage, the RM3543 waits for a fixed period of time after the measurement current changes before acquiring the voltage between H_{POT} and L_{POT} .

It is necessary to exercise caution when there are metallic objects present near the measurement cable or measurement target. When the measurement current fluctuates, an eddy current will be induced in such objects (see Figure 12). This induced current is characterized by a sawtooth-shaped waveform and affects the voltage detection line between H_{POT} and L_{POT} for an extended period of time (see Figure 13.b). The eddy current gradually decays due to the resistance of the metal plate, so its effect is more pronounced the faster the measurement speed.

The following five methods may be used to counteract this issue:

1. Move the metallic object farther away.
2. Twist the H_{POT} and L_{POT} lines together.
Doing so will make the lines more resistant to the effects of the eddy current.
3. Twist the H_{CUR} and L_{CUR} lines together.
Doing so will inhibit the generation of an eddy current.
4. Increase the DELAY2 setting.
Doing so will delay the start of measurement until the eddy current has dissipated.
5. Reduce the measurement speed.
Averaging data from the start of measurement, when the effects of the eddy current are more pronounced, can effectively reduce those effects.


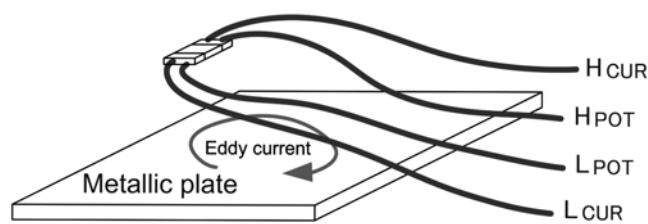


Figure. 12 Generation of an eddy current

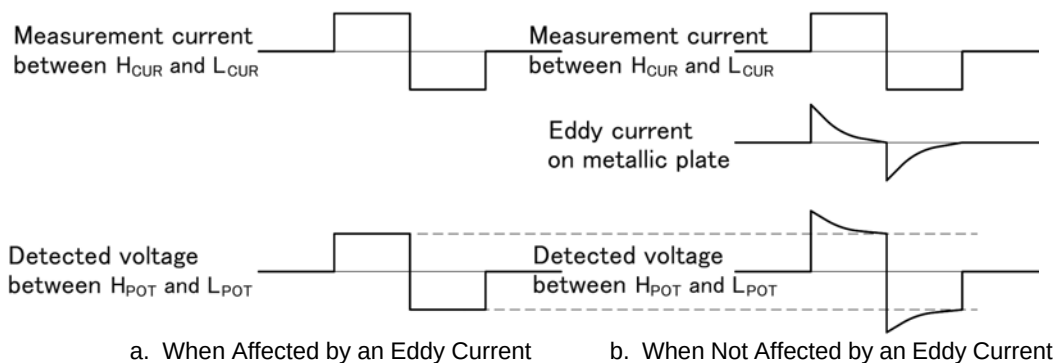

a. When Affected by an Eddy Current

b. When Not Affected by an Eddy Current

Appendix 4 Effects of Probing

When mounting a two-terminal current sensing resistor on a printed circuit board, it is typical to separate the current line and voltage detection line as shown in Figure 1 in order to avoid the effects of wiring resistance. To ensure that the current will flow uniformly, it is necessary to use current lines that are the same width as the electrodes and to avoid bending the trace in the vicinity of the electrodes (see Figure 2).

Wire probes are typically used in testing current sensing resistors (see Figure 3). In this case, the measurement current gradually spreads out inside the current sensing resistor from the point of entry (H_{CUR}) and then returns to the probe point (L_{CUR}) (see Figure 4). If the voltage terminals (H_{POT} , L_{POT}) are placed near the current entry point (H_{CUR} , L_{CUR}), where the current density is high, the reading will tend to be greater than the resistance value in the mounted state (see Figure 5).

The RM3543's scaling function can be used to compensate for this effect. This function corrects the measured value R with the linear function $AR+B$ based on the coefficient A and offset B . An example of how the constants A and B are calculated using scaling is described below.

STEP 1

Prepare two resistors whose resistance values in the mounted state are known. The resistance values in the mounted state are given by R_{M1} and R_{M2} .

STEP 2

Measures the two resistors with the RM3543's tester. The resistance values in the test state are given by R_{I1} and R_{I2} .

STEP 3

The simultaneous equations are as follows:

$$\begin{cases} R_{M1} = AR_{I1} + B \\ R_{M2} = AR_{I2} + B \end{cases}$$

Solving for A and B ,

$$\begin{cases} A = \frac{R_{M2} - R_{M1}}{R_{I2} - R_{I1}} \\ B = \frac{R_{M1}R_{I2} - R_{M2}R_{I1}}{R_{I2} - R_{I1}} \end{cases}$$

If you wish to cancel out differences between individual RM3543 instruments, you can provide a standard resistor near full-scale for the range being used (calibration value R_{M1} , value before RM3543 scaling R_{I1}) and use the following equations, since the RM3543's zero point is extremely stable:

$$\begin{cases} A = \frac{R_{M1}}{R_{I1}} \\ B = 0 \end{cases}$$

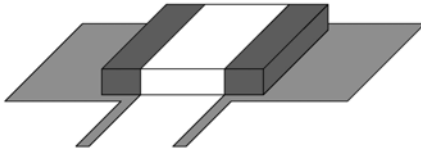


Figure. 1 A Current Sensing Resistor Mounted on a Printed Circuit Board

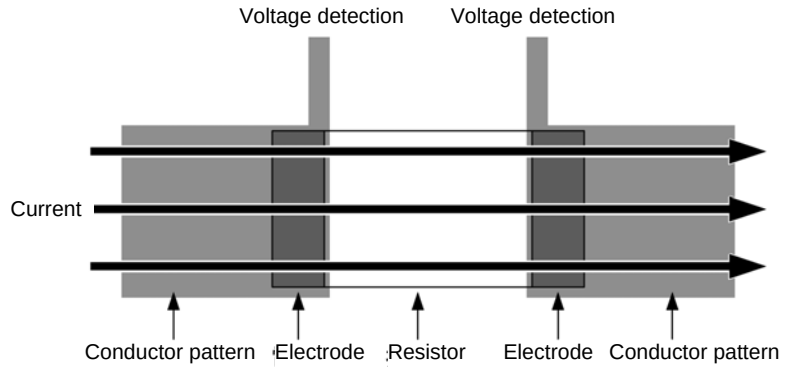


Figure. 2 Current Flow in the Mounted State

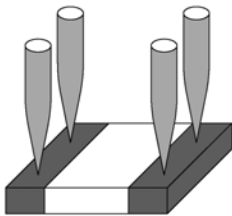


Figure. 3 Probing in the Test State

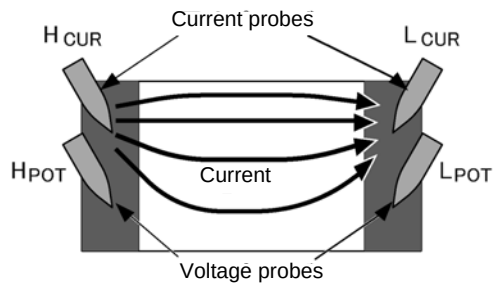


Figure. 4 Flow of Current in the Test State

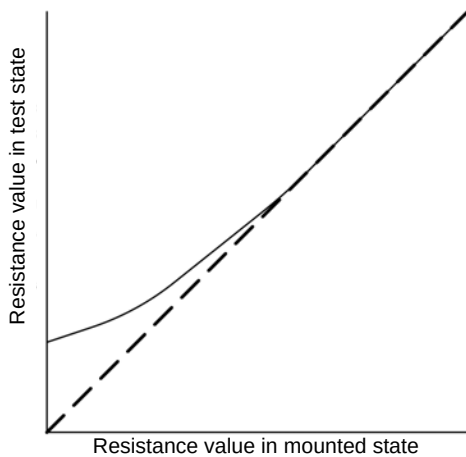


Figure. 5 Difference between Mounted State and Test State

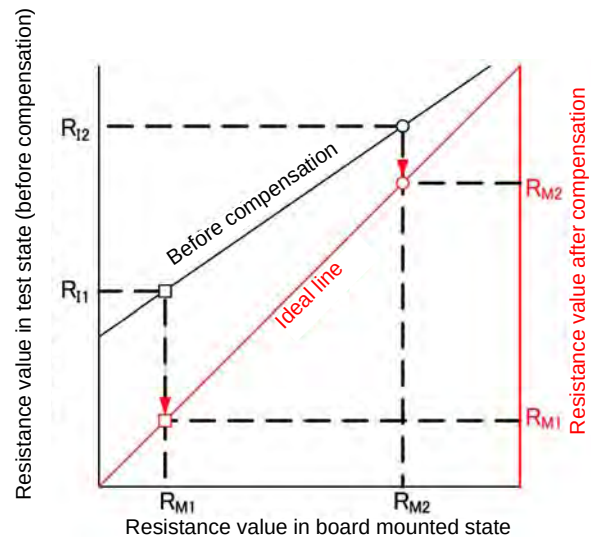


Figure. 6 Scaling Operation

Appendix 5 Rack Mounting

By removing the screws on the sides, this instrument can be installed in a rack mounting plate.




WARNING

Observe the following precautions regarding the mounting screws to avoid instrument damage and electric shock accidents.


- When installing the Rack Mounting Plate, the screws must not intrude more than 3.5 mm into either side of the instrument.
- When removing the Rack Mounting Plate to return the instrument to stand-alone use, replace the same screws that were installed originally. (Feet: M3 x 6 mm, Sides: M4 x 6 mm)

Rack Mounting Plate Template Diagram and Installation Procedure


Rack Mounting Plate (EIA)

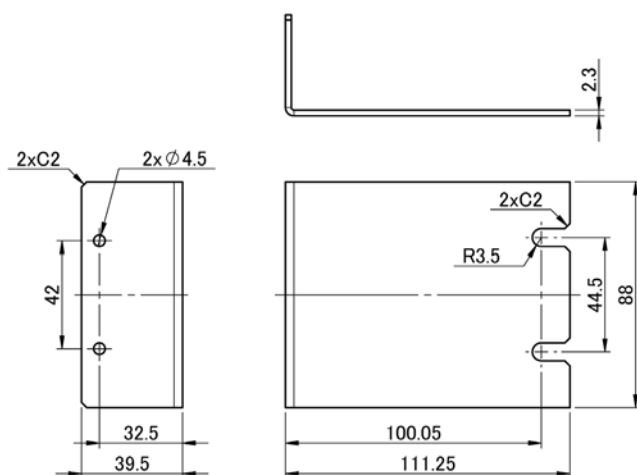


Spacer (Two Required)

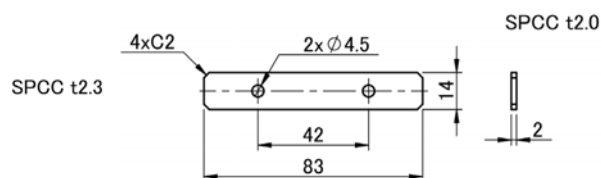


Rack Mounting Plate (JIS)

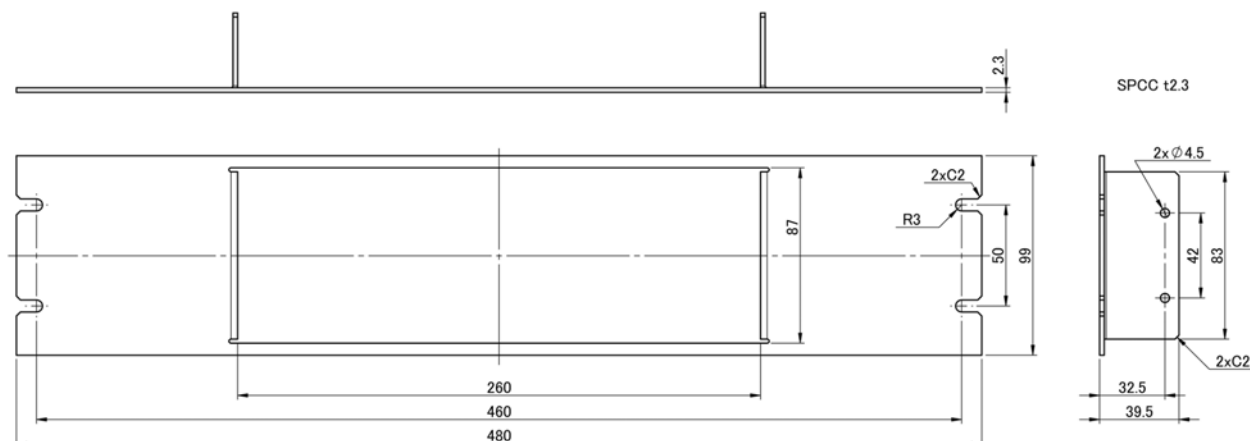

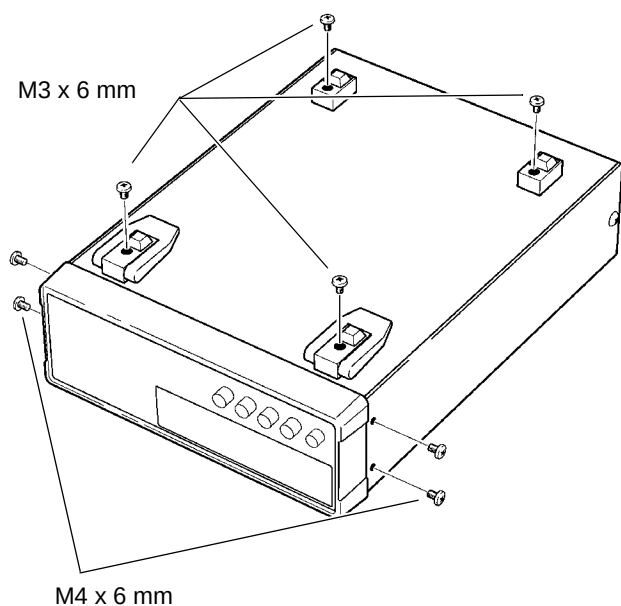


- 1** Remove the feed from the bottom of the instrument, and the screws from the sides (four near the front).

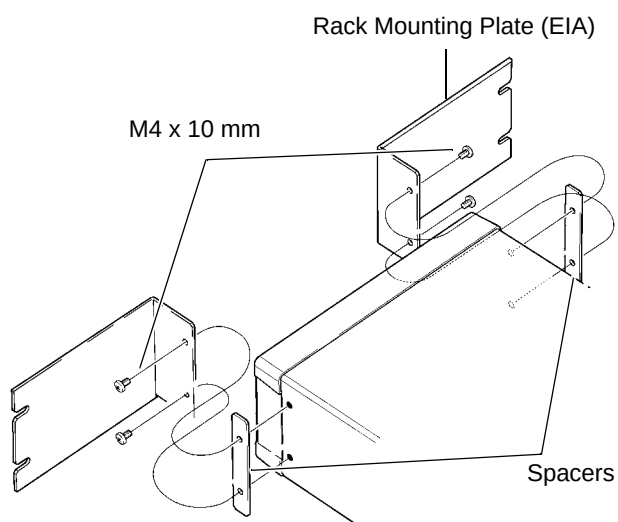


- 2** Installing the spacers on both sides of the instrument, affix the Rack Mounting Plate with the M4 x 10 mm screws.

When installing into the rack, reinforce the installation with a commercially available support stand.

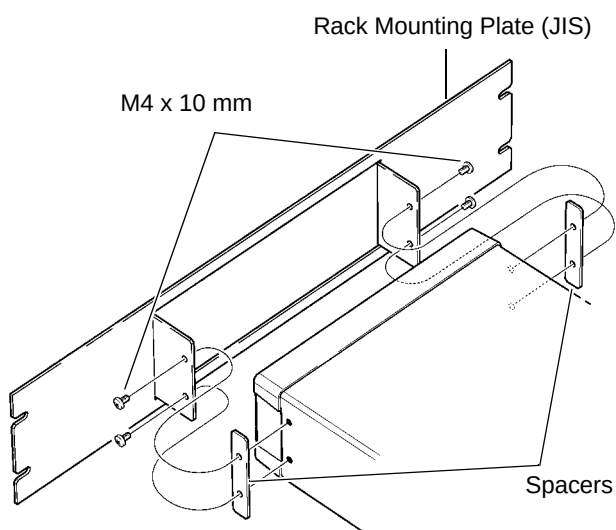

Appendix 6 Dimensional Diagram

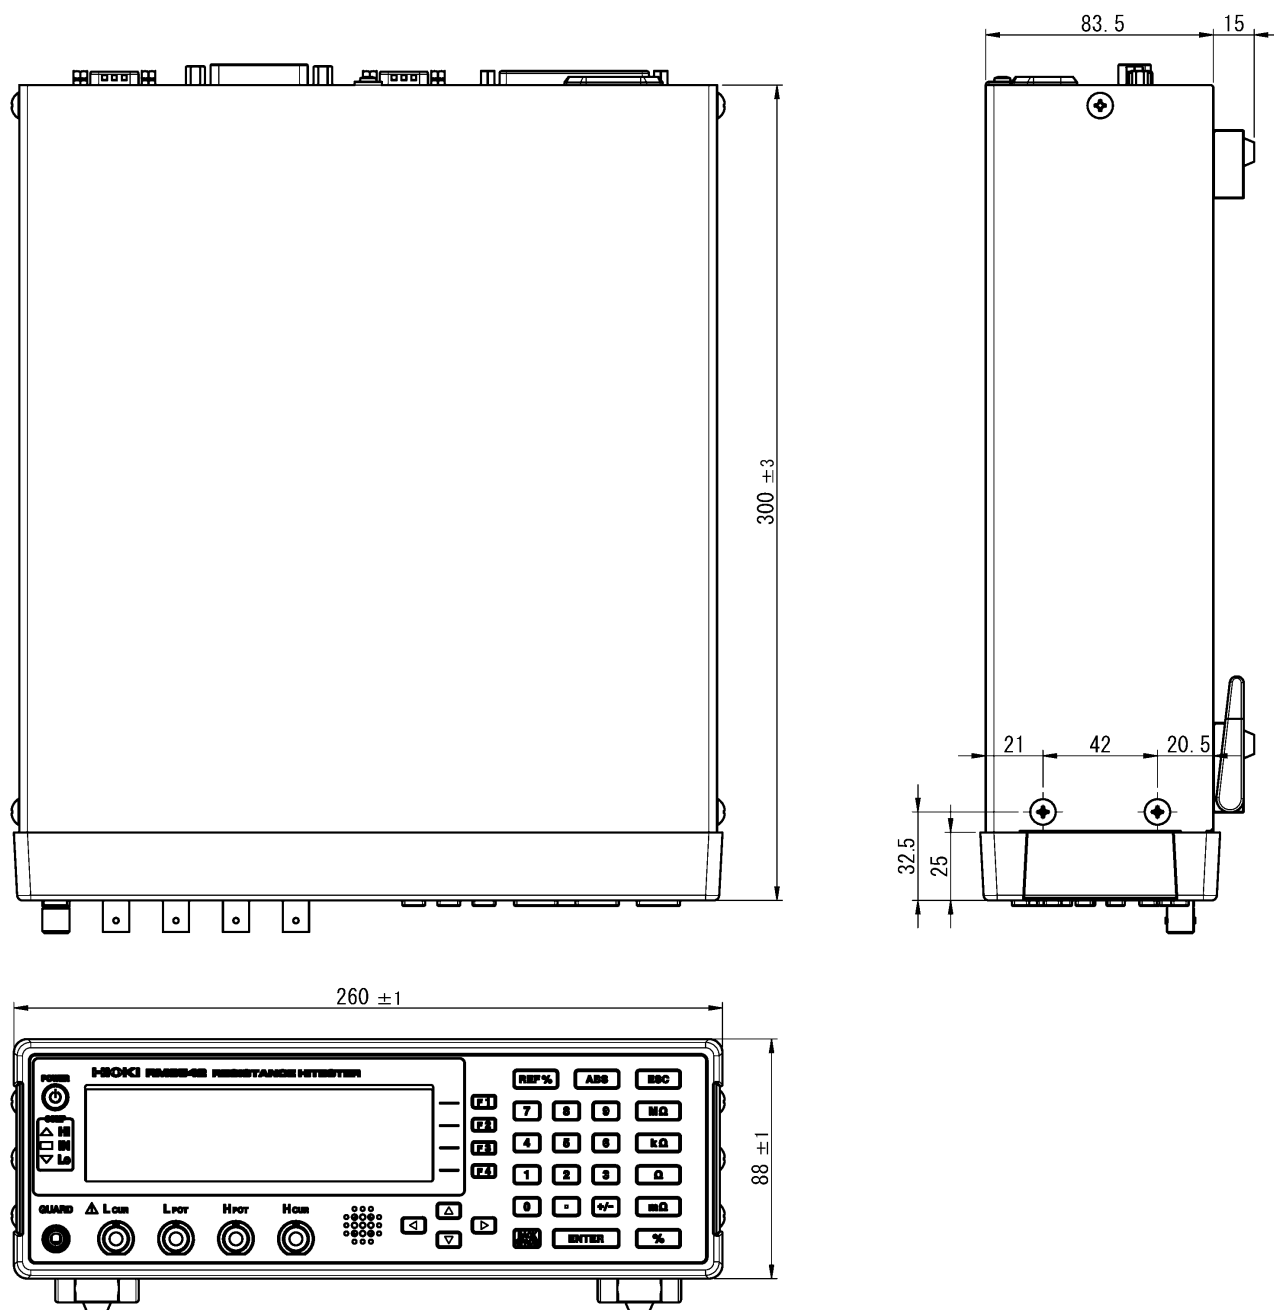

Appendix 7 Calibration

Calibration Conditions

• Ambient temperature and humidity	23±5°C, 80%RH or less
• Warm-up time	30 minutes
• Power supply	100 to 240 V±10%, 50/60 Hz
• Measurement speed	SLOW
• Integration time	Default setting
• Contact Improver	OFF (Required when using the Fluke 5700A)
• Measurement Current	CONT (Required when using the Fluke 5700A)
• Probe short-circuit detection	OFF
• 0ADJ	OFF (necessary)
• External magnetic field	Environment close to the Earth's magnetic field
• Voltage level monitor	OFF (Required when using the Fluke 5700A)

Calibration equipment

Please use the following for calibration equipment.

See: " Connection Methods" (p. A15)

Resistance measurement equipment


- Fluke 5700A (10 Ω or more) or equivalent
- Alpha Electronics CSR-10 m Ω or equivalent
- Alpha Electronics CSR-100 m Ω or equivalent
- Alpha Electronics CSR-1 Ω or equivalent

If the Fluke 5700A cannot be used, please use the following equipment.



- Alpha Electronics CSR-100 (10 Ω)
- Alpha Electronics CSR-101 (100 Ω)
- Alpha Electronics CSR-102 (1 k Ω)

When using the YOKOGAWA 2792 to calibration


Use the Four-terminal Lead from Hioki. Note that connection cannot be made with the Clip Type Lead.

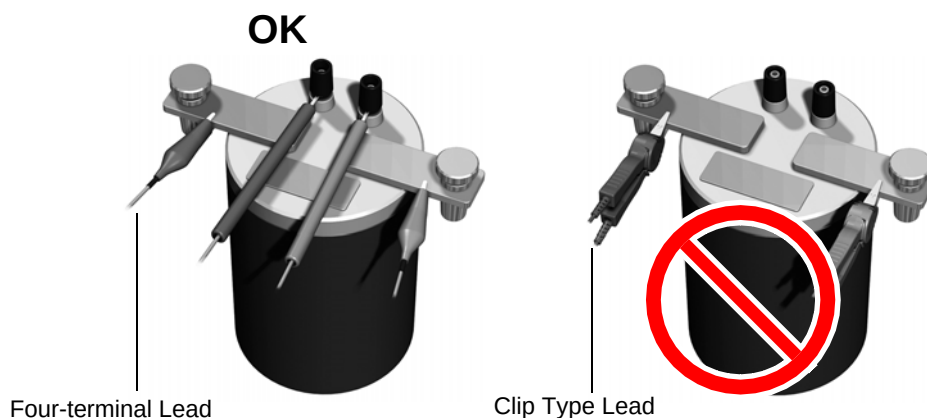

Connection Methods

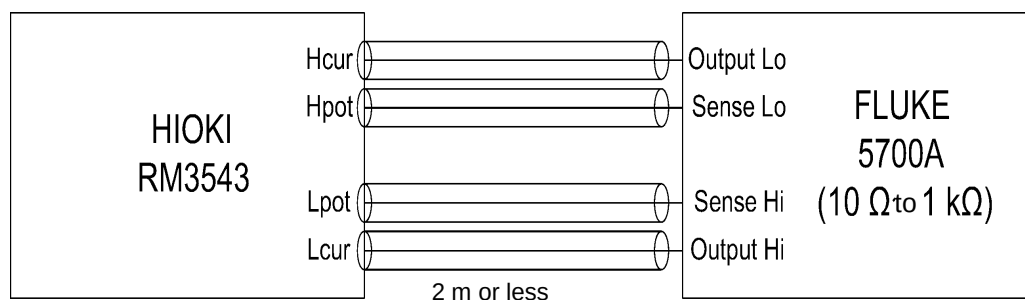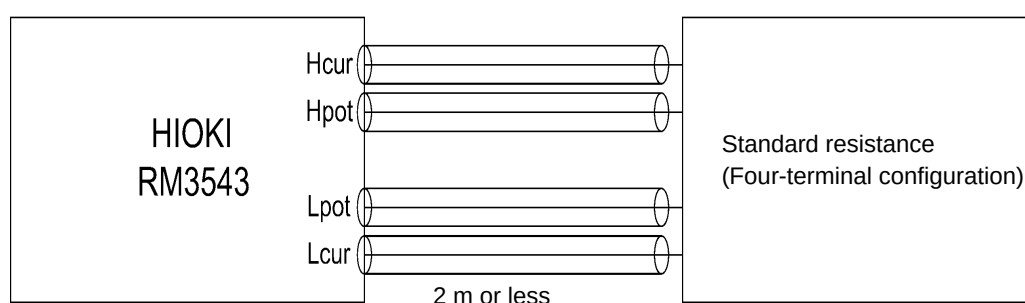Calibration using Fluke 5700A at 10 Ω to 1 k Ω 

Calibration using standard resistance

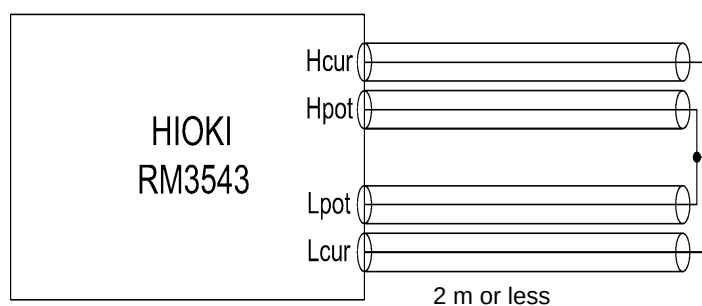0- Ω calibration**NOTE**

- When calibrating using the Fluke 5700A, measured values may change during self-calibration (once every 10 minutes).
- During 0 Ω calibration, do not allow the measurement current to flow to the line connecting the H_{POT} and L_{POT} lines. For more information, see "Appendix 10 Zero Adjustment" (p. A19).

Appendix 8 Adjustment Procedure

The System screen includes an adjustment screen.
The Adjustment screen is used in repairs and adjustment carried out by Hioki. It is not available for use by end-users.

SYSTEM			RETURN
LINE FREQ	AUTO	^	ADJUST
CONTRAST	50		
BACKLIGHT	80		
RESET			
ADJUST			

Appendix 9 Table of Commands Compatible with the ADEX AX-1152D

Description	Model AX-1152D		Model RM3543	
	Command	Data	Command	Data
Measurement mode setting	Ff	$f = D$ (% mode)/ R (R mode)	:CALCuLate:LIMit:MODE m	$m = \text{REF}\%$ (REF mode)/ ABS (ABS mode)
Measurement range setting	RNGr	$r = 0$ to 6	:RESistance:RANGe r	$r = 0$ to 120E+6
Reference resistance setting	SDdddd	$dddd = 500$ to 10000	:CALCuLate:LIMit:REF- erence float	$float = 0$ to 120.000E+6
Setting % mode +/- tolerances	DHsdddd DLsdddd	$s = \pm$ $dddd = 0000$ to 5000	:CALCuLate:LIMit:PER- Cent float1,float2	$float1 = -99.990$ to 99.990 $float2 = -99.990$ to 99.990
Setting ABS mode thresholds	LHdddd LLdddd	$dddd = 00000$ to 15000	:CALCuLate:LIMit:ABS float1,float2	$float1 = 0$ to 120.000E+6 $float2 = 0$ to 120.000E+6
Measurement speed setting	Ww	$w = 0$ (SLOW)/ 1 (FAST)	:SPEEd s	$s = \text{FAST/ ME-}$ Dium/ SLOW
Trigger	E		*TRG	

Note: The RM3543 cannot accept continuous commands (a delimiter is necessary between multiple commands).

A18

Appendix 9 Table of Commands Compatible with the ADEX AX-1152D

Example 1

Measurement mode: R mode
Measurement range: 100 mΩ
Upper limit: 105.00 mΩ
Lower limit: 95.00 mΩ
Measurement speed: SLOW
Trigger after the above settings

AX-1152D	RM3543
FR	:CALCulate:LIMit:MODE ABS
R2	:RESistance:RANGe 100E-3
LH10500	:CALCulate:LIMit:ABS 105E-3,95E-3
LL9500	
W0	:SPEED SLOW
E	*TRG

or

FRR2LH10500LL9500W0E

Note: Although no delimiters are shown, they must be included at the end of each command line.

Example 2

Measurement mode: % mode
Measurement range: 10 mΩ
Reference resistance: 10 mΩ
Upper limit: 1.00%
Lower limit: -1.00%
Measurement speed: FAST
Trigger after the above settings

AX-1152D	RM3543
M0	:CALCulate:LIMit:MODE REF
	:RESistance:RANGe 10E-3
RS100E+3	:CALCulate:LIMit:REFerence 10E-3
LH+1000E-2	:CALCulate:LIMit:PERCent 1, -1
LL-1000E-2	
S1	:SPEED FAST
E	*TRG

or

FDR1SD10000DH+0100DL-0100W1E

Note: Although no delimiters are shown, they must be included at the end of each command line.

Appendix 10 Zero Adjustment

Zero adjustment is a function which adjusts the zero point by deducting the residual value obtained during $0\ \Omega$ measurement. For this reason, zero adjustment must be performed when connection is made to $0\ \Omega$. However, connecting a sample with no resistance is difficult and therefore is not practical.

In this respect, when performing the actual zero adjustment, create a pseudo connection to $0\ \Omega$ and then adjust the zero point.

To create $0\ \Omega$ connection state

If an ideal $0\ \Omega$ connection is made, the voltage between H_{POT} and L_{POT} becomes $0\ V$ according to the Ohm's Law of $E = I \times R$. In other words, if you set the voltage between H_{POT} and L_{POT} to $0\ V$, this gives you the same state of $0\ \Omega$ connection.

To perform zero adjustment using the instrument

The instrument uses a measurement fault detection function to monitor the state of connection between the four measurement terminals. For this reason, when performing zero adjustment, you need to make connections between the terminals appropriately in advance (Figure 1).

First, short between H_{POT} and L_{POT} to set the voltage between H_{POT} and L_{POT} to $0\ V$. If lead resistances R_{SEH} and R_{SEL} of the cable are less than few Ω , there will be no problem. Because the POT terminal is a voltage measurement terminal, almost no current I_0 flows. Therefore, in the $E = I_0 \times (R_{SEH} + R_{SEL})$ formula, $I_0 \approx 0$ is achieved; if lead resistances R_{SEH} and R_{SEL} are less than few Ω , voltage between H_{POT} and L_{POT} will become almost zero.

Next, make connection between H_{CUR} and L_{CUR} . This is to avoid display of error when no measurement current flows through. Lead resistances R_{SOH} and R_{SOL} of the cable must be less than the resistance for flowing measurement current.

Furthermore, if you also monitor the connection between POT and CUR, you need to make connection between POT and CUR. If lead resistance R_{Short} of the cable has only few Ω , there will be no problem.

If you wire in the way described above, measurement current I flowing out from H_{CUR} will go to L_{CUR} but not to the lead of H_{POT} or L_{POT} . This enables the voltage between H_{POT} and L_{POT} to be kept accurately at $0\ V$, and appropriate zero adjustment becomes possible.

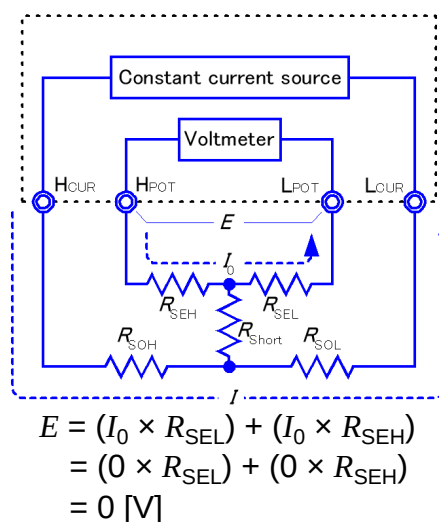


Figure 1. Pseudo connection to $0\ \Omega$

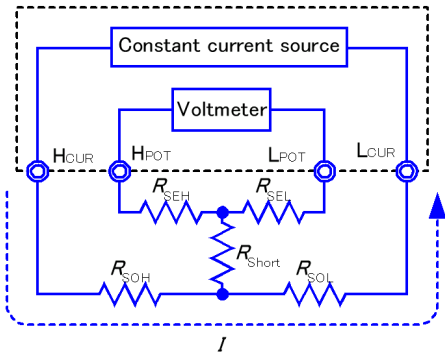
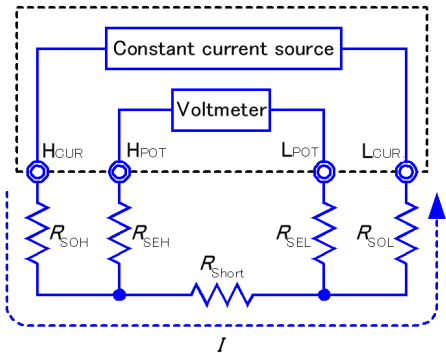
To perform zero adjustment appropriately

Table 1 shows the correct and wrong connections. The resistances in the figure indicate lead resistances; there will be no problem if they are less than few Ω respectively

In (a), if you connect H_{POT} and L_{POT} as well as H_{CUR} and L_{CUR} respectively, and use one path to make connection between POT and CUR, no potential difference occurs between H_{POT} and L_{POT} , and 0 V is input. This enables zero adjustment to be carried out correctly.

In (b), on the other hand, if you connect H_{POT} and H_{CUR} as well as L_{POT} and L_{CUR} respectively, and use one path to make connection between Hi and Lo, $I \times R_{Short}$ voltage occurs between H_{POT} and L_{POT} . For this reason, the pseudo 0 Ω connection state cannot be achieved and zero adjustment cannot be carried out correctly.

Table 1: Connection methods







Connection methods	 (a) Use one point each between POT and CUR for connection	 (b) Use one point each between Hi and Lo for connection
Resistance between H_{POT} and L_{POT}	$R_{SEH} + R_{SEL}$	$R_{SEH} + R_{Short} + R_{SEL}$
Measurement current I 's flow path	$R_{SOH} \rightarrow R_{SOL}$	$R_{SOH} \rightarrow R_{Short} \rightarrow R_{SOL}$
Voltage occurring between H_{POT} and L_{POT}	0	$I \times R_{Short}$
As connection method for zero adjustment	Correct	Wrong

To perform zero adjustment using a probe

When you actually perform zero adjustment using a probe, you may unexpectedly make the connection shown in Table 1 (b). Therefore, when performing zero adjustment, you need to pay sufficient attention to the connection state of each terminal.

Here, 9287-10 Clip Type Lead is used as an example for the connection explanation. Table 2 shows the connection state of the tip of the lead and equivalent circuit in the respective correct and wrong connections. Table 1 (a) indicates the correct connection method, resulting in 0 V between H_{POT} and L_{POT} . However, Table 1 (b) is the wrong connection method, so that 0 V is not obtained between H_{POT} and L_{POT} .

Table 2: Clip type lead connection methods used during zero adjustment

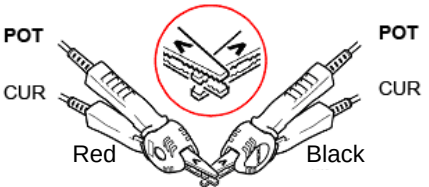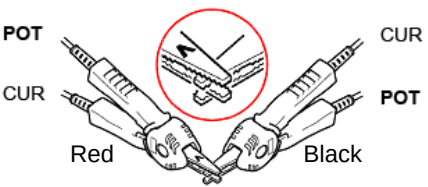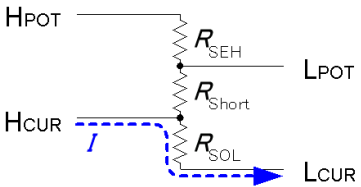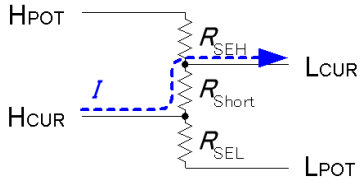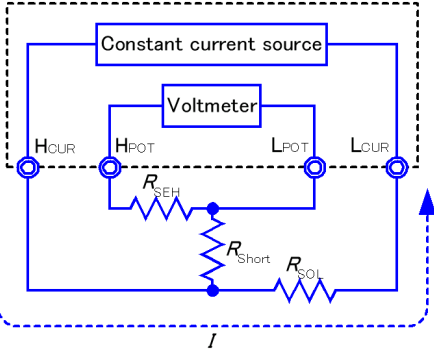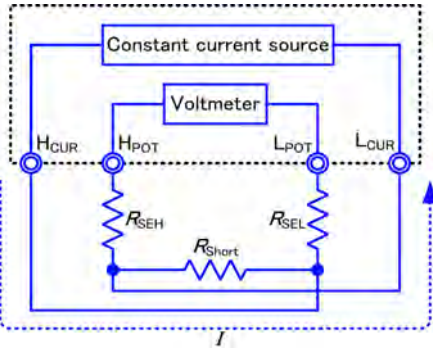Connection method	Correct	Wrong
Tip of lead		
Equivalent circuit		
Deformed equivalent circuit		
As connection method for zero adjustment	Correct	Wrong








To perform zero adjustment using 9454 Zero Adjustment Board

When performing zero adjustment, you cannot use a metal board or similar object to replace 9454 Zero Adjustment Board.

9454 Zero Adjustment Board is not just a metal board. Its structure consists of two layers of metal boards screwed at one point. The zero adjustment board is used when performing zero adjustment of 9465 Pin Type Lead.

Table 3 shows cross sectional diagrams and equivalent circuits of the two connection methods: connecting Pin Type Lead to zero adjustment board, and connecting that to a metal board or similar object. Table 1 (a) indicates the connection using zero adjustment board, resulting in 0 V between H_{POT} and L_{POT} . However, Table 1 (b) is the connection using a metal board or similar object, so that 0 V is not obtained between H_{POT} and L_{POT} .

Table 3: Pin type lead connection methods in zero adjustment

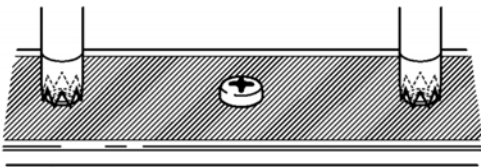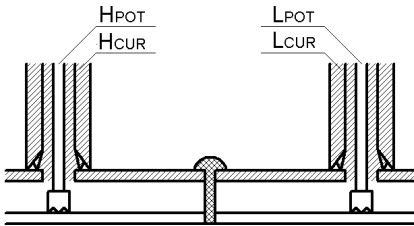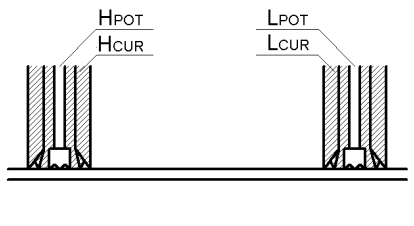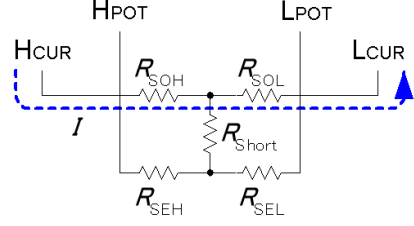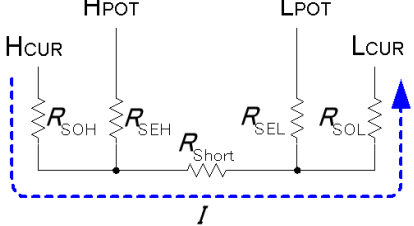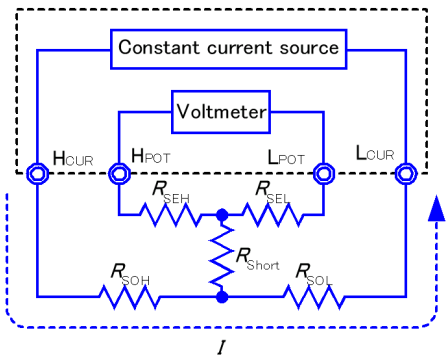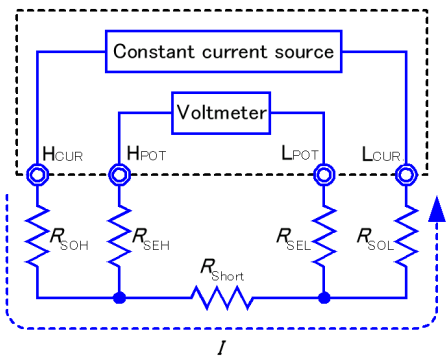Connection method	 If connection is made using 9454 Zero Adjustment Board	 If connection is made using metal board or similar object
Tip of lead		
Equivalent circuit		
Deformed equivalent circuit		
As connection method for zero adjustment	Correct	Wrong

If zero adjustment is difficult when using self-made probe to measure

When you perform zero adjustment using a self-made probe to do measurement, connect the tip of the self-made probe as shown in Table 1 (a). However, if such connection is difficult, you can try the following methods.

If DC resistance meter is used

The main purpose of performing zero adjustment is to remove offset of the measurement instrument. For this reason, the value to be deducted as a result of zero adjustment almost does not depend on the probe. Therefore, after using a different probe to make the connection shown in Table 1 (a) and performing zero adjustment, you can replace it with a self-made probe to measure with offset removed from the measurement instrument.

If AC resistance meter is used

In addition to removing offset of the measurement instrument, another main purpose of performing zero adjustment is to remove influence of the probe shape. For this reason, when performing zero adjustment, try as much as possible to set the form of the self-made probe close to the measurement state. Then, you need to make the connection as shown in Table 1 (a) and perform zero adjustment.

However, if a HIOKI product is used, even in AC resistance measurement, if the required resolution exceeds $100\ \mu\Omega$, the same zero adjustment method used in DC resistance meter may be sufficient.

Index

Symbols

+OvrRng185

Number

0ADJ91

A

ABS34

Accuracy180

Adjustment A 16

ASCII107

Auto-Memory Function73, 75

Auto-Ranging31

Average78

Averaging Function48

B

Backlight70

Backup function26

Basic Settings screen17, 18

Baud rate102

Binary107

Block diagram14

Broken measurement cables49

C

C.E. Hi38, 49, 185

C.E. Lo38, 49, 185

C.E. Volt38, 52, 185

CAL91

Calibration A 14

CE_HI91

CE_LO91

Clock68

Command error119

Command execution time119

Command Message109

Command Syntax109

Communications105

Comparator decision66

Comparator decision beeper66

Comparator Function34

Comparing the Measurement Settings56

Contact

Poor or improper contact 49

Contact Check Fault 38

Contact Check Function 49

Contact Improver Function 50

Continuous measurement 30, 142

Count 77

Crossover wiring 104

Current Mode Setting 53

Current Monitor Fault 38

Current Monitor Function 39

D

Data exporting methods 152

Data formats 111

Data Memory Function 73, 74

Data Output Function 73, 81

DATA SETTINGS 17, 19

Data Settings screens 17, 19

Default settings 72

DELAY 42

Delay 42

Delay time 42, 43

Device clear 112

Dimensional diagram A 13

Disposing 187

E

EOM 91

ERR 91, 185

Error displays 185

Event registers 115

Device-Specific Event Status Registers

(ESR0 and ESR1) 116

Standard Event Status Register (SESR) 115

Execution error 119

EXT 30

EXT I/O 178

Connection examples 96

Connector 100

External control Q&A 99

External triggering (EXT) 30

F

F.LOCK 63

Faulty measurements 30

Index 2

Index

Fixed-point data	111
Floating-point exponential representation data	111
Four-Terminal	A 1
Free-run	30, 99, 142
Frequency	67
FULL	63

G

GP-IB interface	179
-----------------------	-----

H

Header	109, 110
Header omission	112
HI	91
HOLD	91

I

IEEE 488.2	111
IN	91
INDEX	91
INFO	186
Initialization Items	118
Initializing	71
Input buffer	112
Inspection	27, 183
INT	30
Integer data	111
Integration Time	46, 173
Internal Circuitry	94
Internal triggering (INT)	30

K

Key Beeper	65
KEY_LOCK	91
Key-Lock Cancel	64
Key-Lock Function	63
Keys do not work	184

L

LO	91
LOCAL	108
Local state	108
Long form	109

M

M.LOCK	63
Manual Range	31
MEAS SETTINGS	17, 19
Measure automatically	30
Measured values	

Shifted	184
Store as soon as measurement is stable	75
Storing data	74
Unstable	184, A 3
Unstable and errors	24
Measurement Cables	23
Extending Measurement Cables	25
Measurement faults	38, 91, 99
Measurement flow	142
Measurement object	28
Measurement ranges	29, 31, 171
Measurement screen	17, 18
Measurement settings	27
Measurement Settings screens	17, 19
Measurement speed	29, 46
Measurement time	181
Message terminators	110

N

Noise	25
NR1	111
NR2	111
NR3	111
NRf	111

O

Offset Voltage Compensation (OVC)	61
Out-of-range	38
Out-of-Range Detection Function	39
Output queue	112
Output signals	91
OVC	61
-OvrRng	185
OvrRng	34, 38

P

Population standard deviation	78
POWER button	26
Power cord	22
PRB_CHECK	91
PRB_SHORT	91
PRINT	86, 91
Printer	83, 179
Printing	83, 86
Probe Short-Circuit Detection Function	54
Process capability index (bias)	78
Process capability index (dispersion)	78
Program Messages	109

Q

Query error	101, 112, 115, 119
Query Message	109

R

Rack Mounting	A 11
Range	41
REF%	34
Remote	108
Repair	183
Response messages	109
RS-232C	179

S

Scaling Function	44
Screen contrast	69
Self calibration	60, 91
Self-test	26, 27
Separators	111
Service request	113
SET MONITOR	179
Settings Monitor Function	56
Short form	109
Short-circuited probes	54
Signal pinouts	90
Standard deviation of sample	78
Standard Event Status Register	115
STAT	79
Statistical calculation results	80
Printing	86
Statistical calculations	79
Status Byte Register	113
SYSTEM	17, 20
System reset	71
System screens	17, 20

T

Test fixtures	23
Thermal emf	61, A 2
Timing chart	92
Contact improvement current	50
DELAY1/ DELAY2	42
EXT I/O	92
Probe short-circuit detection	54
TRG	79, 130
TRIG	91, 98
Trigger source	30, 142
Triggering	142

U

UNLOCK	63
--------------	----

V

Voltage Level Monitor Function	52
Voltage Monitor fault	38

W

Wiring	24
--------------	----

Z

Zero Adjustment	32, A 19
Zero Adjustment Faults	33

Warranty Certificate

Model	Serial No.	Warranty period One (1) year from date of purchase (___ / ___)
This product passed a rigorous inspection process at Hioki before being shipped. In the unlikely event that you experience an issue during use, please contact the distributor from which you purchased the product, which will be repaired free of charge subject to the provisions of this Warranty Certificate. This warranty is valid for a period of one (1) year from the date of purchase. If the date of purchase is unknown, the warranty is considered valid for a period of one (1) year from the product's date of manufacture. Please present this Warranty Certificate when contacting the distributor. Accuracy is guaranteed for the duration of the separately indicated guaranteed accuracy period. - Malfunctions occurring during the warranty period under conditions of normal use in conformity with the Instruction Manual, product labeling (including stamped markings), and other precautionary information will be repaired free of charge, up to the original purchase price. Hioki reserves the right to decline to offer repair, calibration, and other services for reasons that include, but are not limited to, passage of time since the product's manufacture, discontinuation of production of parts, or unforeseen circumstances. - Malfunctions that are determined by Hioki to have occurred under one or more of the following conditions are considered to be outside the scope of warranty coverage, even if the event in question occurs during the warranty period: - Damage to objects under measurement or other secondary or tertiary damage caused by use of the product or its measurement results - Malfunctions caused by improper handling or use of the product in a manner that does not conform with the provisions of the Instruction Manual - Malfunctions or damage caused by repair, adjustment, or modification of the product by a company, organization, or individual not approved by Hioki - Consumption of product parts, including as described in the Instruction Manual - Malfunctions or damage caused by transport, dropping, or other handling of the product after purchase - Changes in the product's appearance (scratches on its enclosure, etc.) - Malfunctions or damage caused by fire, wind or flood damage, earthquakes, lightning, power supply anomalies (including voltage, frequency, etc.), war or civil disturbances, radioactive contamination, or other acts of God - Damage caused by connecting the product to a network - Failure to present this Warranty Certificate - Failure to notify Hioki in advance if used in special embedded applications (space equipment, aviation equipment, nuclear power equipment, life-critical medical equipment or vehicle control equipment, etc.) - Other malfunctions for which Hioki is not deemed to be responsible *Requests - Hioki is not able to reissue this Warranty Certificate, so please store it carefully. - Please fill in the model, serial number, and date of purchase on this form.		
HIOKI E.E. CORPORATION 81 Koizumi, Ueda, Nagano 386-1192, Japan TEL: +81-268-28-0555 FAX: +81-268-28-0559		13-09