

SILICON ON SAPPHIRE PRESSURE TRANSMITTER WITH OPTIONAL LOOP POWERED PRESSURE MONITOR

PX4200 Series

- ✓ Silicon on Sapphire Construction
- ✓ High Operating Temperature
- ✓ Titanium Wetted Parts
- ✓ 0.25% Accuracy
- ✓ Optional Plug-On Display with Available Set-point
- ✓ IP65 Enclosure

OMEGA's PX4200 Series Transmitters bring state-of-the-art Silicon-on-Sapphire (SOS) sensor technology to the industrial arena. SOS construction uses very stable solid state silicon strain gages on a Sapphire carrier which is glass bonded to a titanium diaphragm. This combination provides a very durable transducer which has excellent stability and corrosion resistance over a wide temperature range. A loop powered 3½ digit (-1999 to 1999) plug-on display adds versatility to the PX4200 by providing local display plus an available open collector set-point with 60 mA capability.

SPECIFICATIONS

Excitation: 13 to 36 Vdc with PM1000
18 to 36 Vdc reverse polarity protected

Load Driving Capacity: 1150Ω @ 36 Vdc, R maximum = (Vs-13)/20 with PM1000 R maximum = (Vs-18)/20

Output: 4 to 20 mA (2-Wire) with zero and span adjustments

Accuracy: ±0.25% full scale includes linearity, and hysteresis

Repeatability: ±0.1% full scale

Long Term Stability (1yr): ±0.2% full scale

Media Temperature: -50 to 120°C (-58 to 248°F)

Ambient Temperature: -40 to 80°C (-40 to 175°F)

Thermal Zero Effect: <±0.016% full scale/°F

Thermal Span Effect: <±0.016% full scale/°F

Humidity: 95% RH non-condensing

Maximum Overpressure: 200% full scale

Sensor: Silicon on Sapphire

Wetted Parts: Titanium

Case Material: Stainless Steel, IP65

Pressure Port: ¼ NPT male

Electrical Connection: DIN 43650 plug mating connector supplied

Response Time: 10 ms

Weight: 90 g (3.2 oz)


Vacuum to 6000 psi
4 to 20 mA Output



PX4200-100GI, connector (not shown) is included.



PX4200-150GI, shown smaller than actual size with Plug-on Loop Powered Pressure Monitor PM1001, attached (shipped as 2 pieces).

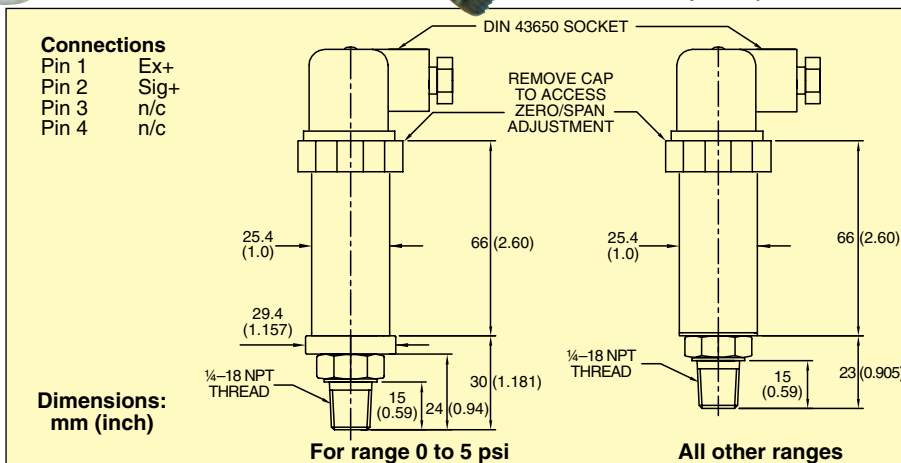

To Order

RANGE (psig)	MODEL NO.	COMPATIBLE METERS*
30 inHg to 0	PX4200-30VACI	DP41-E, DP25B-E, PM1000
0 inHg to 30	PX4200-30VACRI	DP41-E, DP25B-E, PM1000
0 to 5	PX4200-005GI	DP41-E, DP25B-E, PM1000
0 to 10	PX4200-010GI	DP41-E, DP25B-E, PM1000
0 to 15	PX4200-015GI	DP41-E, DP25B-E, PM1000
0 to 30	PX4200-030GI	DP41-E, DP25B-E, PM1000
0 to 60	PX4200-060GI	DP41-E, DP25B-E, PM1000
0 to 100	PX4200-100GI	DP41-E, DP25B-E, PM1000
0 to 150	PX4200-150GI	DP41-E, DP25B-E, PM1000
0 to 200	PX4200-200GI	DP41-E, DP25B-E, PM1000
0 to 300	PX4200-300GI	DP41-E, DP25B-E, PM1000
0 to 600	PX4200-600GI	DP41-E, DP25B-E, PM1000
0 to 1K	PX4200-1KGI	DP41-E, DP25B-E, PM1000
0 to 1.5K	PX4200-1.5KGI	DP41-E, DP25B-E, PM1000
0 to 3K	PX4200-3KGI	DP41-E, DP25B-E, DP24-E
0 to 6K	PX4200-6KGI	DP41-E, DP25B-E, DP24-E
PRESSURE MONITOR		
	PM1000	Plug-on display
	PM1001	Plug-on display with single set-point

* Visit us online for compatible meters.

Comes complete with operator's manual.

Ordering Example: PX4200-100GI, 0 to 100 psig range with a 4 to 20 mA current output, and PM1001 display with set-point.

SPECIALTY
PRESSURE TRANSDUCERS

