


Three-Phase Current **Transformers**

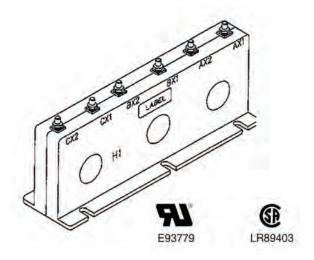



| Dimensions | | | |
|-------------------|-------------------------|--|--|
| Frequency: | 50-400 Hz | | |
| | | | |
| Insulation Level: | 0.6kV | | |
| | | | |
| Weight | Approximately 1.75 lbs. | | |
| Width: | 7.13" | | |
| Height: | 3.22" | | |
| Length: | 2.22" | | |

- Use with GIMA Series Meters
- Reduce high AC current signals

Ordering Information

| Catalog Number | Current Ratio | Accuracy @ 60 Hz | Burden VA 60 Hz |
|-------------------|------------------|---------------------|--------------------|
| 37026 | 50:5 | ± 3% | 2.0 |
| 37027 | 100:5 | ± 2% | 2.0 |
| 37028 | 150:5 | ± 1% | 4.0 |
| 37029 | 200:5 | ± 1% | 5.0 |
| 37030 | 300:5 | ± 1% | 10.0 |

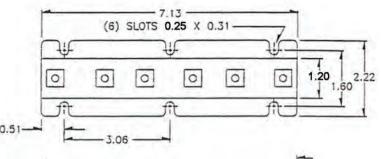

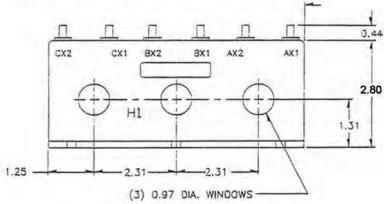

Hardware Required:

- (6) 1/4" Washers
- (6) 1/4" Bolts and Nuts

Hardware not furnished with the Current Transformer