

# **USB ATMOSPHERIC PRESSURE, ENHANCED PRECISION TEMPERATURE AND RELATIVE HUMIDITY SENSOR**

**PTH420** 



## **DESCRIPTION**

The PTH420 includes an enhanced precision temperature and humidity sensor, pushing the precision limit a step further. It is designed for environmental temperature, humidity and atmospheric pressure (barometric) data acquisition. Its core digital sensor chips are built around industry-proven technologies and are individually factory-calibrated, linearized and temperature-compensated, resulting in a cutting-edge performance. The compact probe eases integration, even in space-constrained locations, and the built-in particle filter provides protection against dust, soot and other contaminants.

## **APPLICATIONS**

- o OEM
- Greenhouse
- Server rooms
- Manufacturing
- Pre-certification
- LIMS integration
- Humidity control
- Scientific research
- Building automation
- Engineering and R&D
- Environmental chamber

#### **INSTALLATION TIME**

Less than 10 minutes

#### **UNIQUE SERIAL NUMBER**

Each unit is assigned a unique serial number allowing for traceability and certification

## **FREE DAO SOFTWARE**

Real-time data visualization and logging

## **DATA INTEGRATION**

Command-line tools for direct data access and integration

#### **OPTIONS**

- Virtual COM Port (VCP) communication protocol
- 3-point user calibration mechanism

## **ALSO AVAILABLE**

Traceability certificates

Warning: This product should not be used in applications where its failure may cause personal injury.

Note: While every effort has been made to ensure accuracy in this publication, no responsibility can be accepted for errors or omissions.


Note: Data may change without notification, and you are strongly advised to obtain copies of the most recently issued datasheet.

	SPECIF	ICATIONS			
Parameter	Condition			Value	Units
Temperature (p	robe)				
Operating range[1]	-40 to	70	Max	-	°C
Accuracy	=/11) to :/11°1.		Typ. Max.	±0.2 ±0.3	°C
Accuracy	20 to 6	0°C	Typ. Max		°C
Accuracy	60 to 7	O°C	Typ. Max.		°C
Accuracy	-40 to 7	70°C	Typ. Max.		°C
Resolution		Тур.		0.015	°C
Repeatability		Тур.		0.06	°C
Response time	-	63%		10	S
Factory calibrated	Indiv	idually <sup>[2]</sup>		yes	-
Extended temperature range <sup>[6]</sup>	-45	5 to 80			°C
Long-term drift	1	<b>Иах</b> .		< 0.03	°C/yr
Relative humid	ity (probe)				
Operating range <sup>[3]</sup>	Non-cond	ensing	_	0 to 100	%RH
Accuracy	0 to 80 %RH	25°C	Typ. Max	±1.5 ±2	%RH
Accuracy	80 to 100 RH%	25°C	Typ. Max	±2 ±3	%RH
Accuracy	0 to 80 %RH	10 to 50°C	Typ. Max.	±1.5 ±2	%RH
Accuracy	0 to 100 %RH	0 to 70°C	Typ. Max.	±2 ±3	%RH
Resolution		Тур.		0.01	%RH
Hesterisis	25°C			0.8	%RH
Factory calibrated	Individually <sup>[2]</sup>			Yes	-
Long-term drift <sup>[5]</sup>	Typ., -40 to 70°C			< 0.25	%RH/yr

Atmospheric pressure           Sensor location         Inside the USB interface housing           Operating temperature range         - 20 to 70           Operating pressure range         For full accuracy         45 to 110         k           Accuracy         70 to 110 kPa         25°C         Typ.         ±0.15         k           Accuracy         70 to 110 kPa         10 to 40°C         Typ.         ±0.18         k           Accuracy         45 to 110 kPa         0 to 50°C         Typ.         ±0.2         k
Operating temperature range         -         -20 to 70         -20 to 70
temperature range Operating pressure range Accuracy 70 to 110 kPa 25°C Typ. ±0.15 k Accuracy 70 to 110 kPa 10 to 40°C Typ. ±0.18 k
range Operating pressure range Accuracy 70 to 110 kPa 25°C Typ. ±0.15 k Accuracy 70 to 110 kPa 10 to 40°C Typ. ±0.18 k
Operating pressure range         For full accuracy         45 to 110         k           Accuracy         70 to 110 kPa         25°C         Typ.         ±0.15         k           Accuracy         70 to 110 kPa         10 to 40°C         Typ.         ±0.18         k
Portion accuracy         45 to 110 kPa           Accuracy         70 to 110 kPa         25°C         Typ.         ±0.15 k           Accuracy         70 to 110 kPa         10 to 40°C         Typ.         ±0.18 k
Accuracy 70 to 110 kPa $25^{\circ}$ C Typ. $\pm 0.15$ k Accuracy 70 to 110 kPa $10$ to $40^{\circ}$ C Typ. $\pm 0.18$ k
Accuracy 70 to 110 kPa 10 to 40°C Typ. ±0.18 k
Extended
pressure range <sup>[0]</sup>
Overpressure Pmax 600 k
Altitude – ≈10 c
ADC resolution – 24 b
Response time – 0.5
Sensor location Inside the USB interface housing
Factory calibrated Individually <sup>[2]</sup> Yes
Signal Noise Filter 1st order -
Noise – ±0.0012 k
Long term drift $ \pm 0.1$ kP
Probe
Cable material PVC
Cable lenght – 1 (3) m (ft)
First filter material Polyethylene terephthalate (PET) mesh – –
Sec. fi ter material PTFE membrane –
Efficiency Particle size ≥200 nm 99.99 %
Housing and USB cable
Temperature – -20 to 70 °C operating range
Humidity Non 10 to 90 %RH condensing
Material – ABS –
IP rating <sup>[3]</sup> – 51 –
USB cable length – 1 (3) m (ft)

SPECIFICATIONS (continued)						
Parameter	Condition	Value	Units			
Power supply						
Voltage	Powered through a USB port	5	V			
Current	At 5V	15	mA			
Miscellaneous						
Temperature compensated	By the manufacturer	Yes	-			
Lifetime	-	5	years			
Certification(s)						
RoHS	RoHS3	Yes	_			

- $^{\mbox{\scriptsize [1]}}$  Only if cable is not moved/flexed while the temperature is below 0°C.
- [2] Each sensor is individually conditioned by the manufacturer of the semi-conductor sensor chips, in the best stable conditions and their correction coefficients are recorded in each of them.
- [3] If water condensation or splashing is possible, it is recommended to install the probe pointing down to reduce the risk of water build-up in the sensor. If water splashing is possible, protect the sensor and the cable converter using extra precautions. Extra housing may be required depending on the
- [4] In a fully controlled environment.
- Typical value for operation in normal relative humidity and temperature range. Maximum value is < 0.5 %RH/yr. Higher drift values might occur due to contaminant environments with vaporized solvents, out-gassing tapes, adhesives, packaging materials, etc. For optimal perfomance, keep the unit in a contaminant free (VOCs) and well ventilated area.
- [6] To prevent damage, refrain from exposing the sensor to extended periods outside its operating range. Precision is not guaranteed beyond the specified operating ranges.

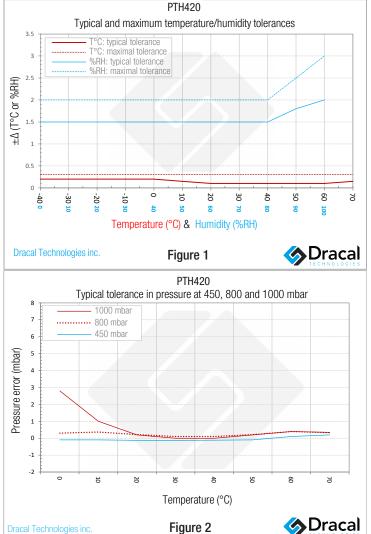


CAUTION: Please keep in mind that electromagnetic interference (EMI) may decrease the accuracy of the sensor. Avoid using this device near EMI sources such as motors, high voltage transformers and fluorescent tubes.

NOTE: Note that this product is not waterproof and requires protection if contact with water is possible.

- TIP: Avoid installing the sensor in a location where strong vibration is likely to occur. Strong vibrations may cause slight inaccuracies in the reading.
- TIP: As for any precision measurement equipment, it is advised to power on the unit at least 15 minutes before using it.

AVAILABLE CHANNEL(S) As displayed in our logging software					
CHANNEL ID*	DECRIPTION	TYPE	NATURE		
00	MS5611 Pressure	Pressure	Real		
01	SHT31 Temperature	Temperature	Real		
02	SHT31 Relative Humidity	Relative Humidity	Real		
03	Dew point	Dew point	Virtual		
04	Humidex	Humidex	Virtual		
05	Heat index	Heat index	Virtual		
06	Altitude	Height	Virtual		

\* Channel Id as it appears in DracalView. Virtual channel Id differ in DracalView and dracal-usb-get.

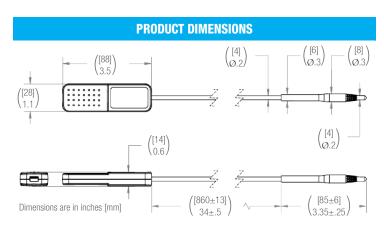

ORDERING				
PRODUCT(S)				
PART NUMBER	OPTION	DESCRIPTION		
601080	USB-PTH420	Enhanced precision USB temperature, humidity and barometer sensor (with filter)		
608080	USB-PTH420-CAL	Enhanced precision USB temperature, humidity and baromete sensor (with filter) - calibratable		
603080	USB-PTH420-CAL	CAL Enhanced precision USB temperature, humidity and baromete sensor (with filter) - calibratable		
605080	VCP-PTH420-CAL	Enhanced precision USB Atmospheric pressure, temperature and relative humidity sensor - calibratable with VCP mode		
TRACEABILITY CERTIFICATE(S)				
NT1WT	1-point temperature certificate for one (1) unit			
NT2WT	2-point temperature certificate for one (1) unit			
NT3WT	3-point temperature certificate for one (1) unit			
NT4WT	4-point temperature certificate for one (1) unit			
NT1WH	1-point relative humidity certificate for one (1) unit			
NT2WH	2-point relative humidity certificate for one (1) unit			
NT3WH	3-point relative humidity certificate for one (1) unit			
NT4WH	4-point relative humidity certificate for one (1) unit			
NT1WP	1-point pressure certificate for one (1) unit			
NT2WP	2-point pressure certificate for one (1) unit			
NT3WP	3-point pressure certificate for one (1) unit			
NT4WP	4-point pressure certificate for one (1) unit			
NT5WP	5-point pressure certificate for one (1) unit			