

# ANALOG M $\Omega$ HITESTER SERIES

Field measuring instruments



Models IR 4016-20, IR 4017-20, IR 4018-20, 3490



# B

# **Built for the Field**

# LIGHT

See better in the dark

#### **Luminous Scale**



# **Bright LED**

- · Work safely knowing that when the RED is lit, live wires, high voltage or electrical discharge is present
- The super bright light at the tip of the optional 9788 Test Leads adds to efficiency





# Check the Battery Status

Be well-informed about the condition of your batteries. Green signals that the battery level is sufficiently high, and red warns of low battery power. Replace the batteries before the LED turns completely off.



BATT: Hi BATT: Lo BATT: Dead

# Check for Live Circuits

The LIVE CIRCUIT LED will light up in red whenever the voltage exceeds 20V AC between the LINE and EARTH terminals, and when at least 20V DC is still remaining during the auto discharge.



# TEST LEAD WITH REMOTE CONTROL SWITCH



#### REMOTE CONTROL SWITCH

- Start and stop the test at the touch of a button
- Test for insulation resistance single-handedly

#### LED LIGHT

 Illuminate the test location with a bright white LED

# MEASURE SWITCH

 Ergonomic design lets you start and stop tests with a single press



Simply flip the switch to measure continuously












Testers are built tough to withstand a 1-meter drop onto a concrete floor

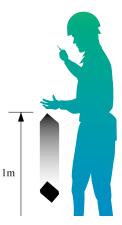

sales@calcert.com

1.888.610.7664

# Model Line-up

# At A Glance

MODEL	Insulation Resistance			Resistance	AC voltage
	250V	500V	1000V	Measurement	Measurement
IR 4016-20	_	100MΩ	_	_	600V AC
IR 4017-20	_	1000MΩ	_	_	600V AC
IR 4018-20	_	_	2000ΜΩ	_	600V AC
3490	100MΩ	100MΩ	4000MΩ	$3\Omega, 30\Omega$	600V AC

Single range

Models IR 4016-20, IR 4017-20, IR 4018-20



Rated output voltage
Effective maximum indicated value

3-range

Model 3490

**INSULATION & CONTINUITY** 

Rated output voltage 250V / 500V / 1000V



# Easy-to-Read Scale

The 250V and 500V ranges share a common 100M $\Omega$ , making the display completely clean and uncluttered

SCALE 250V/ 50MΩ 500V/100MΩ

**→** 100MΩ

 $4000 M\Omega$  Scale at the 1000V Range

3Ω range, 200mA EN 61557

#### Checks ground wire continuity with current of 200mA

Also capable of testing the continuity of electrical grounds in accordance with EN 61557

# **Accessories**



1.888.610.7664

Conforms to safety standard IEC61010-031 (revised) for hand-held probes




included as a standard accessory (This sleeve cannot be attached to previous products)

When measuring in a CAT III environment, be sure toattach the sleeve to the test leads.

# **Options**

**BREAKER PIN L9787-91** (for Model L9787)

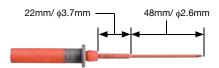

Extra long tips extend deep into the breaker openings for more reliable testing



#### TIP PIN

**L9788-90** (for Model L9788-10)

When measuring in a CAT III environment, be sure to attach the sleeve to the test leads.



Sieeve

TEST LEAD WITH REMOTE CONTROL SWITCH **L9788-10** (1.2m)



www.calcert.com

sales@calcert.com

## **General Specifications**

concrete operations			
Power supply	Rated power voltage: 1.5 VDC x 4, LR6 alkaline battery x 4		
Continuous operating time	Approx. 20 hours (at 500V range, no load) *1		
Auto Power Save	Approx. 15 minutes		
Operating Temperature & Humidity	0 to 40°C (32 to 104°F), 90%RH or lower (non-condensating) 40 to 50°C (104 to 122°F), at 50°C and below relative with linear decrease up to 50%RH		
Storage Temperature & Humidity	-10 to 50°C (14 to 122°F), 90%RH or lower (non-condensating)		
Maximum rated voltage to earth	600 VAC, Measurement Category III, Anticipated Transient Overvoltage: 6000V		
Dielectric strength	5312 VAC, 50/60Hz, Measurement terminals - electrical enclosure, current sensitivity 1 mA		
Standards	Safety EN61010, EMC EN61326 *3490 only: EN61557-1/-2/-4 *IR 4016-20, IR 4017-20, IR 4018-20: EN61557-1/-2		
Drop Proof	On concrete: 1m/1 time		
Dimensions (excluding protrusions)	Approx. 159W × 177H × 53D mm (6.26"W × 6.97"H × 2.09"D)		
Mass	Approx. 610g (21.5 oz.) (including battery, not including test lead)		
Accessories	Test lead L9787 x 1, Instruction manual x 1, Shoulder strap x 1, LR6 alkaline battery x 4		

<sup>\*1</sup> IR 4018-20 :15 hours

## ☐ 3490 specifications

Guaranteed for one year at 23°C±5°C (73°F±9°F) and 90% RH

	Rated output voltage	250 V DC	500 V DC	1000 V DC	
	, J			4000 MΩ	
	Effective maximum indicated value		100 MΩ		
	Center scale value	1 MΩ		50 MΩ	
	1st effective	$0.05$ to $50~\mathrm{M}\Omega$		2 to 1000 MΩ	
Insulation resistance measurement	measuring range	±5% of indicated value			
	2nd effective	$0.01$ to $0.05$ M $\Omega$ 50 to $100$ M $\Omega$		$0.5$ to $2$ M $\Omega$ 1000 to 4000 M $\Omega$	
	measuring range	±10% of indicated value			
	Open circuit voltage	1 to 1.2 times of rated outp		put voltage	
	Lower limit measurement resistance value to be maintained reted output voltage	0.25 MΩ	0.5 ΜΩ	1 ΜΩ	
	Rated current	1mA (Tolerance: 1 to 1.2 times of the rating value)		f the rating value)	
	Overload protection	1200V AC (10 sec.)			
Resistance measurement	Ranges	$3\Omega$		30Ω	
	Center scale value	1.5Ω		15Ω	
	Accuracy	±0.09Ω		±0.9Ω	
	Open-circuit voltage	4.1 to 6.9 V			
	Measuring current 200mA DC or more		more	20mA DC or more	
	Overload protection	720V AC (10 sec., by Fuse)			
AC voltage measurement	Measuring range	0 to 600 V (50/60 Hz)			
	Accuracy	±5% of maximum scale value			
	Input resistance	100 kΩ or more (50/60Hz)			
	Overload protection	1200V AC (10 sec.)			

## ☐ IR 4016-20, IR 4017-20, IR 4018-20 specifications

Guaranteed for one year at 23°C±5°C (73°F±9°F) and 90% RH

Model		IR 4016-20	IR 4017-20	IR 4018-20
Insulation resistance measurement	Rated output voltage	500 V DC	500V	1000 V DC
	Effective maximum indicated value	100 MΩ	1000 MΩ	2000 MΩ
	Center scale value	2 MΩ	20 MΩ	50 MΩ
	1st effective	$0.1$ to $50~\mathrm{M}\Omega$	1 to 500 MΩ	2 to 1000 MΩ
	measuring range	±5% of indicated value		
	2nd effective	$0.01$ to $0.1~\mathrm{M}\Omega$ 50 to $100~\mathrm{M}\Omega$	$0.5$ to $1~\mathrm{M}\Omega$ 500 to $1000~\mathrm{M}\Omega$	1 to 2 MΩ 1000 to 2000 MΩ
	measuring range	±10% of indicated value		
	Open circuit voltage	1 to 1.2 times of rated output voltage		
	Lower limit measurement resistance value to be maintained reted output voltage	0.5 ΜΩ	0.5 ΜΩ	1 ΜΩ
	Rated current	1mA (Tolerance: 1 to 1.2 times of the rating value)		
	Overload protection	600V AC (10 sec.)		1200V AC (10 sec.)
AC voltage measurement	Measuring range	0 to 600 V (50/60 Hz)		
	Accuracy	±5% of maximum scale value		
	Input resistance	500 kΩ or more (50/60Hz)		
	Overload protection	600V AC (	10 sec.)	1200V AC (10 sec.)

 $Note: Company\ names\ and\ Product\ names\ appearing\ in\ this\ catalog\ are\ trademarks\ or\ registered\ trademarks\ of\ various\ companies.$ 



www.calcert.com

sales@calcert.com