

3-349-454-03 8/4.14

- Digital Hand-Held Multimeters with RMS Measurement amongst other features including:
   V<sub>AC TRMS</sub>, V<sub>AC+DC TRMS</sub>, V<sub>DC</sub>, Hz (V), Hz (A), Ω, V→+, °C/°F (TC)
- Resolution of 60,000 counts, can be changed to 6000 via the menu, display illumination can be activated for difficult lighting conditions

#### **METRAHIT EBASE**

 Current measurement via clamp current sensors:
 The transformation factor is adjustable from 1 mV:1 mA to 1 mV:1 A and the factor is calculated for the display.

#### METRA HIT ETECH

- Direct Current measurement with increased accuracy and Current measurement, via clamp current transformer and sensors
- Broad range capacitance measurement

### METRAHIT EXTRA/ETECH/ESPECIAL

- Special low-impedance alternating voltage measurement (1 M $\Omega$ )
- 1 kHz / -3 dB low-pass filter can be activated

### **METRAHIT EXTRA**

- Direct current measurement from 10 nA to 10 A, 16 A for short periods
- Temperature measurement with Pt100/Pt1000 resistance thermometer
- Broad range capacitance measurement
- TRMS AC and AC + DC bandwidth 100 kHz

### METRAHIT ESPECIAL

 Special instrument for the performance of measurements at current transformer circuits

### CAT IV









### **Applications**

The instruments of the E- and high resolution series are extremely rugged, reliable digital multimeters with housings made of impact resistant ABS.

With a resolution of 60,000 counts and up to 26 different measuring functions, they've been developed for professional use.

### **Features**

### Three Connector Jacks with Automatic Blocking Sockets (ABS) \*

All current ranges are implemented via a single connector jack which prevents any possibility of operator error. Auto-ranging is available in all current measuring ranges.

Also the automatic blocking sockets prevent incorrect connection of the measurement cables, as well as selection of the wrong measured values. Danger to the user, the instrument and the device under test resulting from operator error is eliminated.

\* Patented (patent no. DE 10 2005 062 624, US 7,439,725)

### **Overload Protection**

The instrument is safeguarded for up to 1000 V in all measuring functions by overload protection. Voltages of greater than 1000 V and current of greater than 10 or 16 A are indicated acoustically. Dangerous contact voltages are indicated when the 1 kHz low-pass filter is activated.

The FUSE display appears at METRAHIT EXTRA and METRAHIT ETECH

### **RMS Value with Distorted Waveshape**

The utilized measuring method allows a waveshape independent RMS measurement (TRMS AC and AC+DC) for voltage and current (METRAHIT EXTRA up to 100 kHz).

### Selectable Filter for V AC Measurement

A 1 kHz low-pass filter can be selected if required, for example to measure the motor voltage at electronic frequency converters. The input signal is checked by a voltage comparator for dangerous voltages as long as the low-pass filter is activated. A high-voltage symbol appears at the display if dangerous voltage is present.

### Measuring 5 V Square-Wave Signals with the METRAHIT EXTRA

This function allows to test circuits and transmission cables by measuring the frequency and the duty cycle of pulses with amplitudes of 2 to 5 V and frequencies of 100 Hz to 1 MHz.


### Analog Scale for Quick Trend Display - Bar Graph or Pointer

The analog scale (with additional negative range for zero-frequency quantities) allows for faster recognition of measured value fluctuation than is possible with a digital display. The instrument can be switched back and forth between bar graph and pointer display via the menu.

### **Automatic or Manual Measuring Range Selection**

Measurement functions are selected by a rotary dial and a function key. The measurement range selection is done automatically according to the input signal. Manual measurement range selection is possible via function key.

1.888.610.7664

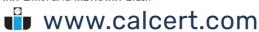

### Measurement with current clamps and sensors

Current clamps and sensors are used for current measurements without interrupting the circuit under test and for high currents above 16 Amps. All E series multimeters offer convenient measurement with current clamps.

The measured current value is automatically calculated for the user with the help of the adjustable clamp factor.

### **Fast Acoustic Continuity Test**

Testing for short circuit connection and circuit interruption is possible with the selector switch in the  $\mathbb{Q}$ ) position. The threshold value for acoustic response can be set to 1, 10, 20 ... 500  $\Omega$  in 10 Ohm steps.

### Automatic Storage of Measured Values \*

The DATA function automatically saves the digitally displayed measured value after stabilisation in. Acoustic signaling is also used to indicate whether the new measured value deviates from the initial reference value by less or more than 0.1% of the measuring range.

\* Patented

### Min-Max Data Storage

Comparable to the slave-pointer function of an analog instrument, the device saves the highest and lowest measured values after the MIN/MAX function has been activated or reset. These extreme values can be queried at the display.

### Battery Charging Status - Power Saving Circuit

The battery charging status is indicated by means of four symbols. The device is switched off automatically if the measured value remains unchanged for a period of between 10 and 59 minutes (adjustable), and if none of the controls are activated during this time. Automatic shutdown can be deactivated by switching the instrument to continuous operation.

The standby mode of the infrared interface can be switched off.

### **Protective Rubber Holster for Rugged Conditions**

The instrument is protected against damage in the event of impacts or dropping by means of a soft rubber holster with tilt stand and test probe holder. The rubber material also assures that the instrument does not slide if it is set up on a vibrating surface.

### Infrared Data Interface

The device can be remotely configured, and momentary and stored measurement data can be read out via the bidirectional infrared interface. The USB X-TRA interface adapter and **METRAwin10** software are required (see accessories). Interface protocol and device driver software for LabVIEW<sup>®</sup> (National Instruments<sup>TM</sup>) are available upon request.

### **DAkkS Calibration Certificate**

Each multimeter is individually adjusted, subjected to final inspection and calibrated. Adherence to the specification is confirmed by means of the included DAkkS calibration certificate, which is valid worldwide (recognized by EA and ILAC. If any type of DMM is due to recalibration (recommended intervals: 1 to 3 years) the multimeters can inexpensively recalibrated at the factory or at any calibration laboratory.

### **Applicable Regulations and Standards**

| IEC/DIN EN 61 010-1<br>VDE 0411-1 | Safety requirements for electrical equipment for measurement, control and laboratory use                            |  |
|-----------------------------------|---|--|
| DIN EN 61 326-1<br>VDE 0843-20-1  | Electrical equipment for measurement, control and laboratory use  – EMC requirements – Part 1: General requirements |  |
| DIN EN 60529<br>DIN VDE 0470-1    | Test instruments and test procedures  – degrees of protection provided by enclosures (IP code)                      |  |

### **Functional overview**

| Function  | Extra           | Етесн                                 | ESPECIAL        | EBASE                                |
|---|-----------------|---------------------------------------|-----------------|--------------------------------------|
| Voltage V <sub>DC</sub>   | /               | 1                                     | 1               | 1                                    |
| $(Ri \ge 9 M\Omega)$  | •               |                                       | •               |                                      |
| Voltage $V_{AC}$ TRMS (Ri $\geq$ 9 M $\Omega$ )                         | ✓               | ✓                                     | ✓               | ✓                                    |
| Voltage Lo <sup>1)</sup> $V_{AC}$ TRMS (Ri = 1 M $\Omega$ )             | 1               | 1                                     | ✓               | _                                    |
| Voltage $V_{AC+DC}$ TRMS (Ri $\geq$ 9 M $\Omega$ )                      | 1               | 1                                     | 1               | 1                                    |
| Frequency Hz @ V <sub>AC</sub> or<br>@ Lo <sup>1)</sup> V <sub>AC</sub> | 300 kHz         | 300 kHz                               | 300 kHz         | 300 kHz                              |
| Low-pass filter 1 kHz   | @               | V <sub>AC</sub> / @ LoV <sub>AC</sub> | 2               | _                                    |
| Bandwidth @ V <sub>AC+DC</sub> or V <sub>AC</sub>                       | 100 kHz         | 20 k                                  | Hz              | 1 kHz                                |
| Frequency MHz @ 5V TTL  | 0.1 Hz1 MHz     | _                                     | _               | _                                    |
| Duty cycle %  | 2.0 % 98 %      | _                                     | _               |                                      |
| Voltage level measurement dB  | /               | 1                                     | /               | /                                    |
| Resistance $\Omega$   | 1               | 1                                     | ✓               | ✓                                    |
| Continuity test<br>@ICONST = 1 mA                                       | 1               | 1                                     | 1               | 1                                    |
| Diode measurement<br>@I <sub>CONST</sub> = 1 mA                         | 1               | 1                                     | ✓               | 1                                    |
| Temperature measurement °C/°F @T <sub>C</sub>                           | Тур К           |                                       |                 |                                      |
| Temperature measurement °C/°F R <sub>TD</sub>                           | Pt100/          | Pt1000                                | _               | _                                    |
| Capacitance measurement F   | 1               | 1                                     | _               | _                                    |
| Current A <sub>DC</sub>   | 600 mA/6 mA     | 60 mA/600 mA                          |                 |                                      |
| Current A <sub>AC+DC</sub> TRMS   | 60 mA/600 mA    | 6 A/10 A (16 A)                       | 6 A/10 A (16 A) | A >C                                 |
| Current A <sub>AC</sub> TRMS  | 6 A/10 A (16 A) | 0741071(1079                          |                 |                                      |
| Bandwidth @ A <sub>AC+DC</sub> or A <sub>AC</sub>                       |                 | 10 kHz                                |                 | _                                    |
| Frequency Hz @ A <sub>AC</sub>  |                 | 60 kHz                                |                 | _                                    |
| Measurement with clamp ammeter with adjustable transfer factor          |                 | //A<br>//A                            | mV / A<br>A / A | mV / A<br>—                          |
| Data logger function <sup>2)</sup> (memory)                             | 16 Mbit         | _                                     | _               | _                                    |
| Relative value measurement ∆REL   | 1               | 1                                     | /               | /                                    |
| Zero point ZERO   | 1               | 1                                     | ✓               | ✓                                    |
| MIN/MAX/DATA Hold   | 1               | 1                                     | ✓               | ✓                                    |
| IR-interface (38.4 kBd)   | 1               | 1                                     | /               | ✓                                    |
| Power pack connector socket   | 1               | _                                     | _               | _                                    |
| Protective rubber holster   | /               | <b>√</b>                              | ✓               | ✓                                    |
| Fuse  | 10 A / 1000 V   | 10 A / 1000 V                         | _               | _                                    |
| Protection 3)   | IP52            | IP52                                  | IP52            | IP52                                 |
| Measuring category  |                 | / CAT III<br>CAT IV                   | 600 V CAT II    | 1000 V CAT<br>III<br>600 V CAT<br>IV |
| Calibration   | DAkkS           | DAkkS                                 | DAkkS           | DAkkS                                |

<sup>1)</sup> Alternating voltage measurement with specially reduced input impedance

### Included

- 1 multimeter in HC20 hard case
- 1 pair of safety measurement cables (1.5 m) with 4 mm test probes, 1000 V CAT III, 600 V CAT IV (KS17-2)
- 2 batteries, 1.5 V, type AA
- 1 condensed operating instructions, English/German
- 1 CD ROM, content: operating instructions in English and German
- 1 DAkkS calibration certificate
- 1 protective rubber holster

### Voluntary Manufacturer's Guarantee

1.888.610.7664



<sup>&</sup>lt;sup>2)</sup> 16 Mbit = 2048 kByte = 61,600 measured values, sampling rate adjustable from 0.1 seconds to 9 hours

<sup>3)</sup> IP 65 available with the METRAHIT OUTDOOR model

# METRAHIT EXTRA ETECH ESPECIAL EBASE

### **TRMS Digital Multimeters**

### **Specifications**

| Meas.        |                        |          | n at Upper             | Input Im                   | pedance   |                               | er Reference Conditions for               |                | Overload              | Capacity <sup>2)</sup> |          |
|--------------|------------------------|----------|------------------------|----------------------------|---|-------------------------------|---|----------------|-----------------------|------------------------|----------|
| Function     | Measuring Range        | 59 999   | <b>e Limit</b><br>5999 |                            | ~/≅   | ±( % rdg. + d)                | ±( % rdg. + d)                            | ±( % rdg. + d) | Value                 | Time                   |          |
|              | 0001/                  |          |                        |                            |   | 0.00 . 5                      |   |                |                       | Time                   |          |
|              | 600 mV                 | 10 μV    | 100 μV                 | ≥9 MΩ                      | ≥9 MΩ // < 50 pF  | 0.09 + 5 with ZERO *)         | 0.5 + 30                                  | 1 + 30         | 1000 V                |                        |          |
| V            | 6 V                    | 100 μV   | 1 mV                   | ≥9 MΩ                      | ≥9 MΩ // < 50 pF  | 0.05 + 5                      | 0.5 + 9                                   | 1 + 30         | DC                    |                        |          |
| V            | 60 V                   | 1 mV     | 10 mV                  | ≥9 MΩ                      | ≥9 MΩ // < 50 pF  | 0.05 + 5                      | 0.5 + 9                                   | 1 + 30         | AC c                  | continou               |          |
|              | 600 V                  | 10 mV    | 100 mV                 | ≥9 MΩ                      | ≥9 MΩ // < 50 pF  | 0.05 + 5                      | 0.5 + 9                                   | 1 + 30         | Sine                  |                        |          |
|              | 1000 V                 | 100 mV   | 1 V                    | ≥9 MΩ                      | ≥9 MΩ // < 50 pF  | 0.09 + 5                      | 0.5 + 9                                   | 1 + 30         | 00                    |                        |          |
|              |                        |          |                        |                            | reference voltage<br>0.775 V  |                               | Intrinsic Uncertainty                     |                |                       |                        |          |
|              | 600 mV~                |          |                        | -48 dB.                    |   |                               |   |                | 1000 1/               |                        |          |
|              | 6 V~                   |          |                        |                            | +18 dB  |                               |   |                | DC                    | 1000 V<br>DC           |          |
| dB           | 60 V~                  |          | 0.01 dB                |                            | +38 dB  | _                             | 0.1 dB (U > 10 % MB)                      |                |                       |                        | continou |
| uD           | 600 V~                 |          | 0.01 00                |                            | +58 dB  | _                             | 0.1 db (0 > 10 /0 Wb)                     |                | AC<br>RMS             | COTTUTO                |          |
|              | 1000 V~                |          |                        | +22 dB.                    |   | -                             |   |                | Sine                  |                        |          |
|              | 1000                   |          |                        |                            | . at upper range limit  |                               | <b>~</b> ¹)                               | ≂1)            |                       |                        |          |
|              | 600 μA                 | 10 nA    | 100 nA                 | 150 mV                     | 150 mV  | 0.5 + 5 with ZERO *)          | 1 + 10                                    | 2.5 + 30       |                       | +                      |          |
|              |                        |          |                        |                            |   |                               |   |                | -                     |                        |          |
|              | 6 mA                   | 100 nA   | 1 μΑ                   | 200 mV                     | 200 mV  | 0.5 + 5                       | 1 + 10                                    | 1.5 + 30       | 0.7 A                 | continou               |          |
| Α            | 60 mA<br>600 mA        | 1 μΑ     | 10 μΑ                  | 200 mV                     | 200 mV  | 0.1 + 5                       | 1 + 10                                    | 1.5 + 30       |                       |                        |          |
|              | 600 mA<br>6 A          | 10 μΑ    | 100 μΑ                 | 300 mV                     | 300 mV  | 0.2 + 5                       | 1 + 10                                    | 1.5 + 30       |                       | 10)                    |          |
|              |                        | 100 μΑ   | 1 mA                   | 300 mV                     | 300 mV  | 0.9 + 10                      | 1 + 10                                    | 1.5 + 30       | 10 A: ≤               | 5 min 10)              |          |
|              | 10 A                   | 1 mA     | 10 mA                  | 600 mV                     | 600 mV  | 0.9 + 10                      | 1.5 + 10                                  | 1.5 + 30       | 16 A: ≤               | ≤ 30 s <sup>10)</sup>  |          |
|              | Factor 1:1/10/100/1000 | Input    |                        |                            | pedance   |                               |   |                |                       |                        |          |
|              | 0.06/0.6/6/60 A        | 60       |                        |                            | ecial / Etech   | Specif                        | fication see current range                | ως Δ <b>~</b>  | Measuring input       |                        |          |
| A >C         | 0.6/6/60/600 A         | 600      | ) mA                   |                            | asuring input   | эресп                         | ilcation see current range                | 5 A -          | 0.7 A c               | continous              |          |
|              | 6/60/600/6 000 A       | 6        | 6 A                    | (A soc                     | ket (X)   | plus cla                      | mp current transform                      | ner error      | 10 A: 5 m             |                        |          |
|              |                        |          |                        | EXTRA / ESPECIAL / Voltag  | ge measurement input  | Consideration and valter      | e measuring ranges V~                     | 1)             | Manaur                | dag input              |          |
| A            | 0.6/6/60/600 A         | 600      | ) mV                   | ETECH: (V socket ) Ri =1 N | ΛΩ/9 ΜΩ   |                               |   | -,             | ivieasur              | ring input             |          |
| A >C         | 6/60/600/6000 A        | 6        | 6 V                    | 5 44 1 10 5                | $\pm (0.5\% \text{ rdg.} + 10 \text{ d}) \pm (1\% \text{ rdg.} + 30 \text{ d}) \pm (1.3\% \text{ rdg.} + 30 \text{ d}) \pm (1.3\% \text{ rdg.} + 30 \text{ d}) \pm (1.3\% \text{ rdg.} + 30 \text{ d})$ |                               | $\pm (1.5\% \text{ rdg.} + 30 \text{ d})$ | 1000           | V RMS                 |                        |          |
|              |                        |          |                        | EBASE: (V socket X) Ri     | ~1 MC2  | plus clamp current sensor err |   | error          |                       | . 10 s                 |          |
|              |                        |          |                        | Open-circuit voltage       | Meas. curr. @ range limit   | ±( % rc                       | lg. + d)                                  |                |                       |                        |          |
|              | 600 Ω                  | 10 mΩ    | 100 mΩ                 | < 1.4 V                    | approx. 250 µA  |                               | with active ZERO function*)               |                |                       | T                      |          |
|              | 6 kΩ                   | 100 mΩ   | 1 Ω                    | < 1.4 V                    | approx. 65 μA   | 0.1 + 5                       | with dolly 2Erio idiloton )               |                |                       |                        |          |
|              | 60 kΩ                  | 1 Ω      | 10 Ω                   | < 1.4 V                    | approx. 7.5 μA  | 0.1 + 5                       |   |                | 1000 V                |                        |          |
| Ω            | 600 kΩ                 | 10 Ω     | 100 Ω                  | < 1.4 V                    |   | 0.1 + 3                       |   |                | DC                    |                        |          |
|              |                        |          |                        |                            | approx. 0.75 μA   |                               |   |                | AC                    | max. 10                |          |
|              | 6 MΩ                   | 100 Ω    | 1 kΩ                   |                            | approx. 0.1 μA  | 0.5 + 5                       |   |                | RMS                   |                        |          |
|              | 60 MΩ                  | 1 kΩ     | 10 kΩ                  | < 1.4 V                    | approx. 30 nA   | 5 + 10                        |   |                | Sine                  |                        |          |
| <b>□</b> ()) | 600 Ω                  | _        | 0.1 Ω                  | approx. 9 V                | approx. 1 mA const.   | 3 + 5                         |   |                |                       |                        |          |
| ₩            | 6.0 V <sup>3)</sup>    | _        | 1 mV                   | approx. 9 V                | approx. 1 mA const.   | 0.5 + 3                       |   |                |                       |                        |          |
|              |                        |          |                        | Discharge resist.          | U <sub>0 max</sub>  |                               | lg. + d)                                  |                |                       |                        |          |
| -            | 60 nF                  | _        | 10 pF                  | 10 MΩ                      | 0.7 V   | $1 + 10^{4}$                  | with active ZERO function *)              |                | 1000 V                |                        |          |
| F            | 600 nF                 | _        | 100 pF                 | 1 MΩ                       | 0.7 V   | 1 + 6 4)                      |   |                | DC .                  |                        |          |
| EXTRA        | 6 μF                   | _        | 1 nF                   | 100 kΩ                     | 0.7 V   | 1 + 6 4)                      |   |                | DC<br>AC              | max. 10                |          |
| Етгон        | 60 μF                  | _        | 10 nF                  | 12 kΩ                      | 0.7 V   | 1 + 6 4)                      |   |                | RMS                   |                        |          |
| Етесн        | 600 μF                 | _        | 100 nF                 | 3 kΩ                       | 0.7 V   | 5 + 6 <sup>4)</sup>           |   |                | Sine                  |                        |          |
|              |                        |          |                        |                            | f <sub>min</sub> 5)   |                               | lg. + d)                                  |                |                       |                        |          |
| Hz (V)       | 600.00 Hz              | 0.01 Hz  | 0.1 Hz                 |                            | 111(11  |                               | -,  |                | Hz (V) 6):            | +                      |          |
|              | 6.0000 kHz             | 0.01 Hz  | 1 Hz                   | +                          |   |                               |   |                | Hz(A>C) <sup>6)</sup> | )                      |          |
| Hz (A)       |                        |          |                        |                            | 1 Hz  | 0.05 + 5                      | = 8)                                      |                | 1 :                   | max. 10                |          |
| z (A>C)      | 60.000 kHz             | 1 Hz     | 10 Hz                  |                            |   | 0.05 + 3                      | J ·                                       |                | 1000 V                | IIIax. 10              |          |
| Hz (V)       | 300.00 kHz             | 10 Hz    | 100 Hz                 |                            | 10 Hz   |                               |   |                | Hz (A): 7)            |                        |          |
|              |                        |          |                        |                            |   |                               |   |                | 112 (лу.              |                        |          |
| MHZ          | 600 Hz 1 MHz           | 0.01 100 |                        |                            | 1 100 Hz  | 0.05 + 5                      | > 2 V 5 V                                 |                |                       |                        |          |
| EXTRA        |                        | Hz       | 1 kHz                  |                            |   |                               |   |                | 1000 V ma             |                        |          |
|              | 2.0 98 %               | _        | 0.01 %                 | 15 Hz 1 kHz                | 1 Hz  | 0.1 R + 5 d                   | > 2 V 5 V                                 |                |                       | may 10                 |          |
| %            | 5.0 95 %               | _        | 0.01 %                 | 10 kHz                     | 1 Hz  | 0.2 R per kHz                 | > 2 V 5 V                                 |                | 1000 V                | max. 10                |          |
| EXTRA        | 0.0 00 //              |          | 0.01 /0                | 101012                     | 1 112   | + 5 d                         | / L V U V                                 |                |                       |                        |          |
| EATRA        | 10 90 %                | _        | 0.01 %                 | 50 kHz                     | 1 Hz  | 0.5 R per kHz                 | > 2 V 5 V                                 |                |                       |                        |          |
|              |                        |          | 3.31 /0                | 00 14 12                   | , 112   | + 5 d                         |   |                |                       |                        |          |
|              |                        |          |                        |                            |   | ±( % rc                       | lg. + d)                                  |                |                       |                        |          |
|              | 0000                   |          |                        |                            |   | 0.3 + 15                      | 5 9)                                      |                | 40                    |                        |          |
|              | Pt 100 - 200.0         |          |                        |                            |   | U.3 + 13 <sup>-7</sup>        |   |                |                       | 1                      |          |
|              | +850.0 °C              |          |                        |                            |   |                               |   |                | 1000 V                |                        |          |
| °C/°F        | +850.0 °C              | 0.1 °C   |                        |                            |   | 0.3 + 15                      | 5 <sup>9)</sup>                           |                | DC/AC                 | max. 10                |          |
| °C/°F        | +850.0 °C              | 0.1 °C   |                        |                            |   |                               |   |                |                       | max. 10                |          |

<sup>1)</sup> Specified accuracy is valid as of 3% of the measuring range. With short-circuited test probes: residual value of 1 to 30 d at zero point due to the TRMS converter (exception: mV AC range, 60 counts). See frequency influence on page 4.

V~~

1.888.610.7664



<sup>&</sup>lt;sup>2)</sup> At 0 ° ... + 40 °C

 $<sup>^{3)}</sup>$  Displays up to max. 6.0 V, "OL" in excess of 6.0 V.

<sup>4)</sup> Applies to measurements at film capacitors and battery operated

 $<sup>^{5)}</sup>$  Lowest measurable frequency for sinusoidal measuring signals symmetrical to the zero point

<sup>6)</sup> Overload capacity of the voltage measurement input:

Overload capacity of the current measurement input: See current measuring ranges for maximum current values.

 $<sup>^{8)}</sup>$  Input sensitivity, sinusoidal signal, 10% to 100% of the measuring range

<sup>9)</sup> Plus sensor deviation

 $<sup>^{10)}\</sup>mbox{Off-time} > 30$  min and  $T_{\mbox{\scriptsize A}} \le 40~^{\circ}\mbox{\scriptsize C}$ 

<sup>\*)</sup> without ZERO max. ± 15 digit

### **Internal Clock**

Time format DD.MM.YYYY hh:mm:ss

0.1 sResolution

Accuracy ±1 min. per month

Temperature Influence 50 ppm/K

### Influencing Quantities and Influence Error

| Influencing<br>Quantity | Sphere of<br>Influence          | Measured Quantity /<br>Measuring Range | Influence Error<br>(% rdg. + d) / 10 K |
|-------------------------|---------------------------------|--|--|
|                         |                                 | V <del></del>                          | 0.2 + 10                               |
|                         |                                 | V ~                                    | 0.4 + 10                               |
| Temperature             | -10 °C +21 °C und +25 °C +40 °C | 600 Ω 6 MΩ                             | 0.5 + 10                               |
|                         |                                 | > 6 MΩ                                 | 1 + 10                                 |
|                         |                                 | mA/A <del></del>                       | 0.5 + 10                               |
|                         |                                 | mA/A ≅                                 | 0.8 + 10                               |
|                         |                                 | 60 nF 600 μF                           | 1 + 5                                  |
|                         |                                 | Hz, dB                                 | 0.2 + 10                               |
|                         |                                 | °C/°F (Pt100/Pt1000)                   | 0.5 + 10                               |
|                         |                                 | °C/°F thermocouple K                   | 0.2 + 10                               |

<sup>1)</sup> With zero balancing

| Influenc- | Meas. Qty. /<br>Meas. Range |                        |                                | Intrinsic Uncertainty <sup>3)</sup><br>±( % rdg. + d) |                |  |
|-----------|-----------------------------|------------------------|--------------------------------|---|----------------|--|
| ing Qty.  |                             |                        | Sphere of Influence            | METRAHIT EXTRA<br>METRAHIT ETECH<br>METRAHIT ESPECIAL | METRAHIT EBASE |  |
|           |                             |                        | > 15 Hz 45 Hz                  | 3 + 30  | 3 + 30         |  |
|           | 600.00 mV                   |                        | > 65 Hz 1 kHz                  | 2 + 30  | 3 + 30         |  |
|           |                             |                        | > 1 kHz 20 kHz                 | 3 + 30  | _              |  |
|           |                             |                        | > 15 Hz 45 Hz                  | 2 + 9   | 3 + 9          |  |
|           | V <sub>AC</sub>             | 6.0000 V               | > 65 Hz 1 kHz                  | 1 + 9   | 3 + 9          |  |
|           |                             | 600.00 V <sup>2)</sup> | > 1 kHz 20 kHz <sup>4)</sup>   | 3 + 9   | _              |  |
|           |                             |                        | > 20 kHz 100 kHz <sup>4)</sup> | 3.5 + 30  | _              |  |
| Frequency |                             |                        | > 15 Hz 45 Hz                  | 2 + 9   | 3 + 9          |  |
| ' '       |                             | 1000.0 V <sup>2)</sup> | > 65 Hz 1 kHz                  | 2 + 9   | 3 + 9          |  |
|           |                             |                        | > 1 kHz 10 kHz                 | 3 + 30  | _              |  |
|           | _                           | 600.00 μΑ              | > 15 Hz 45 Hz                  |   |                |  |
|           | A <sub>AC</sub>             | <br>10.0000 A          | > 65 Hz 10 kHz                 | 3 + 10  | _              |  |
|           | A <sub>AC</sub>             | 600 mV /               |                                |   |                |  |
|           | >c                          | 6V /                   | >65 Hz 1 kHz                   | _   | 3 + 30         |  |
|           | EBASE                       |                        |                                |   |                |  |

Power limiting: frequency x voltage max.  $6 \times 10^6 \text{ V} \times \text{Hz}$  for U > 100 V

METRAHIT ETECH: frequency response up to 10 kHz, METRAHIT ESPECIAL: frequency response up to 10 kHz, METRAHIT EBASE: frequency response up to 1 kHz

| Influencing<br>Quantity | Sphere of<br>Influence | Measured Quantity/<br>Measuring Range | Influence Error <sup>5)</sup> |
|-------------------------|------------------------|---------------------------------------|-------------------------------|
| Crest factor CF         | 1 3                    | V ~. A ~                              | ± 1 % rdg.                    |
| Crest factor CF         | > 3 5                  | - V~, A~                              | ± 3 % rdg.                    |
|                         |                        |                                       |                               |

<sup>5)</sup> Except for sinusoidal waveshape

| Influencing<br>Quantity | Sphere of<br>Influence | Measured Quantity      | Influence Error           |
|-------------------------|------------------------|------------------------|---------------------------|
| Relative                | 75%                    |                        |                           |
| humidity                | 3 days                 | V, A, Ω, F, Hz, dB, °C | 1 x intrinsic uncertainty |
|                         | instrument off         |                        |                           |

| Influencing<br>Quantity  |  |                          | Damping  |
|--|--|--------------------------|----------|
|  | Interference quantity max. 1000 V $\sim$                 | V <del></del>            | > 120 dB |
| Common Mode<br>Interference<br>Voltage   |  | 6 V $\sim$ , 60 V $\sim$ | > 80 dB  |
|  | Interference quantity max. 1000 V ~<br>50 Hz 60 Hz, sine | 600 V $\sim$             | > 70 dB  |
|  | 00 112 111 00 112, 01110                                 | 1000 V ∼                 | > 60 dB  |
| Series Mode Interference quantity: $V \sim$ , respective nominal value of the measuring range, max. $1000 \ V \sim$ , $50 \ Hz \dots 60 \ Hz$ , sine |  | V <del></del>            | > 50 dB  |
| Voltage  | Interference quantity max. 1000 V —                      | V ~                      | > 110 dB |

### **Reference Conditions**

| Ambient temperature     | +23 °C ±2 K     |
|-------------------------|-----------------|
| Relative humidity       | 40 75%          |
| Measured qty. frequency | 45 65 Hz        |
| Measured qty. waveform  | Sine            |
| Battery voltage         | $3 V \pm 0.1 V$ |

### Response Time (after manual range selection)

| Measured Quantity /<br>Measuring Range          | Response Time<br>Digital Display | Measured Quantity<br>waveshape                |
|---|----------------------------------|---|
| V <del></del> , V ∼, dB<br>AV <del></del> , A ∼ | 1.5 s                            | From 0 auf 80 % of upper range limit value    |
| 600 Ω 6 MΩ                                      | 2 s                              |   |
| 60 MΩ   | 5 s                              |   |
| Continuity                                      | < 50 ms                          | From ∞ auf 50 %<br>of upper range limit value |
| °C (Pt 100)                                     | Max. 3 s                         | or apportange mine value                      |
| →   | 1.5 s                            |   |
| 60 nF 600 μF                                    | Max. 2 s                         | From 0 auf 50 %                               |
| >10 Hz  | 1.5 s                            | of upper range limit value                    |

### **Data Interface**

Optical via infrared light through the housing Type Serial, bidirectional (not IrDa compatible) Data transmission Protocol Device specific

Baud rate 38,400 baud

**Functions** - Select/query measuring functions and parameters

> - Query momentary measurement data - Read out stored measurement data

The USB X-TRA plug-in interface adapter (see accessories) is used for connection to the PC's USB port.

### **Internal Measured Value Storage** (METRAHIT EXTRA only)

Memory capacity 16 MBit (2 MByte) for approx. 61,000 measured values with date and time stamp

sales@calcert.com

1.888.610.7664



<sup>3)</sup> The accuracy specification for frequency response is valid within a display value range of 10% to 100% of the measuring range for both measuring modes with the TRMS converter in the AC and (AC+DC) ranges.

METRAHIT EXTRA: frequency response up to 100 kHz, > 50 kHz plus 2.5 %

## METRAHIT EXTRA ETECH ESPECIAL EBASE

### **TRMS Digital Multimeters**

### **Power Supply**

Battery 2 ea. 1.5 V mignon cell (2 ea. size AA),

alkaline manganese per IEC LR6 (2 ea. 1.2 V NiMH rechargeable battery

also possible)

Service life with alkaline manganese: approx. 200

hours

Battery test Battery capacity display with battery

symbol in 4 segments: ......

Querying of momentary battery voltage via

menu function.

Power OFF function Multimeter is switched off automatically:

If battery voltage drops to below prox. 1.8 V
 If none of the keys or the rotary switch are activated for an adjustable duration of 10 to 59 minutes, and the multimeter is not in the continuous operation mode

Power pack socket

(METRAHIT EXTRA) If the NA X-TRA power pack has been

plugged into the instrument, the batteries are disconnected automatically. Rechargeable batteries can only be

recharged externally.

### Display

LCD panel (65 mm x 36 mm) with analog and digital display including unit of measure, type of current and various special functions

### **Background illumination**

Background illumination is switched off approximately 1 minute after it has been activated.

Analog

Display LCD scale with bar graph or pointer, depend-

ing on the selected parameter setting

Scaling With 4 division lines each, 1 bar/pointer cor-

responds to 500 counts at the digital display

Polarity display With automatic switching

Overflow display With the > symbol

Measuring rate 40 measurements per second and display

refresh

Digital

Display / char. height 7-segment characters / 15 mm

Resolution 59,999 counts

Overflow display "OL" is displayed for ≥ 60,000 counts

Polarity display "-" (minus sign) is displayed

if plus pole is connected to "⊥"

Measuring rate 10 or 40 measurements per second with

the Min-Max function except for the capacitance, frequency and duty cycle

measuring functions

Refresh rate 2 times per sec., every 500 ms

### Fuse for METRAHIT EXTRA, METRAHIT ETECH

Fuse FF (UR) 10 A/1000 V AC/DC;

10 mm x 38 mm,

Switching capacity: 30 kA at 1000 V AC/DC, protects the current measurement input in the 600  $\mu$ A through 10 A ranges

### **Electrical Safety**

Per IEC 61010-1:2010/VDE 0411-1:2011

### METRAHIT EXTRA, METRAHIT ETECH, METRAHIT EBASE

Safety class II

Measuring category III IV
Operating voltage 1000 V 600 V

Pollution degree 2
Test voltage 6.7 kV~

METRAHIT ESPECIAL "for Current Transformers"

Special device for measurements at current transformers without fuse in the electrical circuit

Safety class II

Measuring category 600 V CAT II

Pollution degree 2 Test voltage 2.5 kV~

### **Electromagnetic Compatibility (EMC)**

Interference emission EN 61326-1: 2006, class B

Interference immunity EN 61326-1: 2006

EN 61326-2-1: 2006

### **Ambient Conditions**

Accuracy range 0 °C ... +40 °C Operating temp. range -10 °C ... +50 °C

Storage temp. range -25 °C ... +70 °C (without batteries)
Relative humidity Max.75%, no condensation allowed

Elevation To 2000 m

Deployment Indoors, except within specified ambient

conditions

### **Mechanical Design**

Weight

Housing Impact resistant plastic (ABS)

Dimensions 200 x 87 x 45 mm

(without protective rubber holster)
Approx. 0.35 kg with batteries

Protection Housing: IP 52 (pressure equalization by

means of the housing)

Table excerpt regarding significance of the

IP code

| IP XY | Protection against pene-| (1<sup>st</sup> digit X) | tration of solid particles | (2<sup>nd</sup> digit Y) | Protection against penetration by water | 5 | Dust protected | 2 | Dripping (15° inclination)

### **Acoustic Signals**

For voltage Intermittent signal at above 1000 V

1.888.610.7664



sales@calcert.com

GMC-I Messtechnik GmbH

### Accessories for Operation at a PC

### Interface Adapter for USB Connection

The following functions can be executed with the USB X-TRA bidirectional interface adapter:

- Configure the METRAHIT Multimeter from a PC.
- Transmit live measurement data to the PC.
- Read out data from memory at the METRAHIT EXTRA.

The adapter does not require a separate power supply. Its baud rate is 38,400 baud.

A CD ROM is included which contains current drivers for Windows operating systems.



### METRAwin®10/METRAHit® Software

METRAwin®10/METRAHit® PC software is a multilingual, measurement data logging program for recording, visualizing and documenting measured values of multimeters of the METRAHIT e-series.

Communication between the PC and the measuring instrument(s) is established via available interface adapters.

Depending upon device type, one or several of the following operating modes are possible:

### **Device Configuration**

Remote configuration and querying of device-specific functions and parameters, for example measuring function, measuring range and memory parameters. Frequently used device settings can be saved to configuration files for easy recall.

### **Online Recording of Measurement Data**

Read-in, display and recording of momentarily measured data from the interconnected device.


- Number of
- measuring channels up to 10
- Start recording
  - manual, triggered by measured value, time triggered
- Recording mode
- > time controlled with sampling interval of 0.05 s\* ... 1 s ... 60 min
- > manually controlled
- > measured value controlled in event of exceeded limit/delta value
- Recording duration max. 10 million intervals
- Depending upon device type, measuring function, number of measuring channels and communication (e.g. via modem), sample intervals of less than 1 s cannot be

### Reading Out and Visualizing Stored Data


If supported by the device: read-in and display of offline data recorded to device memory.

For purposes of analysis, data recorded online or read in from the device's memory can be displayed in various formats:

### Y(t)-recorder display for up to 6 channels

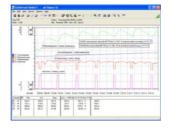

### XY-recorder display for up to 4 channels

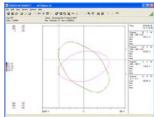

### Multimeter-display for up to 4 channels



### Tabular display for up to 10 channels



### **System Requirements**

METRAwin 10 (as from version 6.0) can be run on IBM compatible

1.888.610.7664



# METRAHIT EXTRA ETECH ESPECIAL EBASE

### **TRMS Digital Multimeters**

### **Order Information**

#### Designation Article Number Type METRAHIT EXTRA, METRAHIT ETECH, METRAHIT ESPECIAL and METRAHIT EBASE Multimeters 60,000 counts TRMS multimeter with direct, alternating and pulsating voltage measurement

(TRMS values), frequency measurement, resistance measurement, continuity test, diode measurement and temperature measurement with type K thermocouples LCD with 15 mm characters, analog bar graph and background illumination
Measuring categories: 600 V/CAT IV, 1000 V/CAT III
Current measurement via clamp sensors with voltage output and adjustable clamp factor

All multimeters include the KS17-2 measurement cable set, two mignon batteries. condensed operating instructions, CD ROM, DAkkS calibration certificate, hard case HC20

| Accessories for temp. measurement with resistance thermometer  |                   |                 |  |  |  |
|--|-------------------|-----------------|--|--|--|
| METRAwin 10 software   | METRAwin 10       | GTZ3240000R0001 |  |  |  |
| IR-USB bidirectional interface adapter   | USB X-TRA         | Z216C           |  |  |  |
| Accessories for operation at a PC  |                   |                 |  |  |  |
| Same as above but with current measurement via clamp current sensor with voltage output (see accessories) instead of direct current measurement, and adjustable transformation factors.  | METRAHIT EBASE    | M251A           |  |  |  |
| Same as above<br>Special device without integrated fuse for<br>use in current transformer circuits   | METRAHIT ESPECIAL | M252A           |  |  |  |
| Same as above but with direct, alternating and pulsating current measurement (TRMS values), additional broad range capacitance measurement, with additional current measurement via clamp current transformer with current output  | METRAHIT ETECH    | M253A           |  |  |  |
| Same as above but with direct, alternating and pulsating current measurement (TRMS values), additional broad range capacitance measurement, precision temperature measurement with Pt100 or Pt1000 platinum resistance thermometers, frequency and duty cycle measurement, clamp current transformer with current output, with power pack socket and IR interface, 2 MB data memory, protective rubber holster | METRAHIT EXTRA    | M250A           |  |  |  |

### (METRAHIT EXTRA only)

| (,,  |            |                 |
|--|------------|-----------------|
| Pt100 temperature sensor for surface and immersion measurement, -40 to +600 °C | Z3409      | GTZ3409000R0001 |
| Pt1000 temperature sensor for measurement in gases and liquids, -50 to +220 °C | TF220      | Z102A           |
| Pt100 oven sensor, -50 to +550 °C  | TF550      | GTZ3408000R0001 |
| Ten adhesive Pt100 temperature sensors, -50 to +550 °C                         | TS Chipset | GTZ3406000R0001 |

| Replacement fuse (METRAHIT Extra and METRAHIT ETECH only) |                                |       |  |  |  |  |  |
|---|--------------------------------|-------|--|--|--|--|--|
| Fuses (pack of 10)  | FF (UR) 10 A /<br>1000 V AC/DC | Z109L |  |  |  |  |  |
|   |                                |       |  |  |  |  |  |
| Power pack (for METRAHIT Extra only)                      | NA X-TRA                       | Z218G |  |  |  |  |  |
| Protective rubber holster and carrying strap              | GH X-TRA                       | Z104C |  |  |  |  |  |

### **Transport Accessories**

### HitBag Cordura Belt Pouch

For **METRA HIT** | multimeters (with/without protective rubber holster) and METRAport



#### **HC30 Hard Case**

For two multimeters (with/without protective rubber holster) and accessories



### F836 Ever-Ready Case

For multimeter (without protective rubber holster) and accessories



### F829 Carrying Pouch

For multimeters (with/without protective rubber holster) and accessories



| Designation   | Туре   | Article Number  |
|---|--------|-----------------|
| Imitation leather without protective rubber holster for <b>METRA HIT</b>   and METRAmax | F829   | GTZ3301000R0003 |
| Cordura belt pouch for <b>METRA HIT</b> multimeters and METRAport                       | HitBag | Z115A           |
| Imitation leather ever-ready case with cable compartment                                | F836   | GTZ3302000R0001 |
| Ever-ready case for 2 <b>METRA HIT</b> , 2 adapters and accessories                     | F840   | GTZ3302001R0001 |
| Hard case for one <b>METRA HIT</b> and accessories                                      | HC20   | Z113A           |
| Hard case for two METRA HIT and accessories   | HC30   | Z113A           |

1.888.610.7664



GMC-I Messtechnik GmbH

| Current Measuring Accessories  All current sensors and transformers are equipped with a terminal with 4 mm safety banana plugs |  |  |                                   |                   |                                     |                           |   | Suitable for<br>METRA HIT |       |                           |
|--|--|--|-----------------------------------|-------------------|-------------------------------------|---------------------------|---|---------------------------|-------|---------------------------|
| Туре   | Designation  | Measuring Range                                      | Meas. Category                    | Max.<br>Wire Dia. | Transformation<br>Factor            | Frequency<br>Range        | Intrinsic<br>Uncertainty<br>±(% rdg. +) | Article<br>Number         | EBASE | ETECH<br>EXTRA<br>ESPECIA |
| DC/AC Cur  | rent Sensors with Voltage Ou   | tput   |                                   |                   |                                     |                           |   |                           |       |                           |
| CP30   | DC/AC current clamp sensor, with battery mode (30 h)                                     | 5 mA to 30 A<br>(DC / AC pk)                         | 300 V / CAT III                   | 25 mm             | 100 mV/A                            | DC20 kHz<br>(-3 dB)       | 1 % +2 mA                               | Z201B                     | •     | •                         |
| CP330  | DC/AC current clamp sensor,<br>with 2 measuring ranges,<br>battery mode (50 h)           | Range: 0.5 30 A<br>Range: 5 300 A<br>(DC / AC rms)   | 300 V / CAT III                   | 25 mm             | 10 mV/A;<br>1 mV/A                  | DC20 kHz<br>(-3 dB)       | 1 % + 50 mA<br>1 % + 100 mA             | Z202B                     | •     | •                         |
| CP1100   | DC/AC current clamp sensor,<br>with 2 measuring ranges,<br>battery mode (50 h)           | Range: 0.5 100 A<br>Range: 5 1000 A<br>(DC / AC rms) | 300 V / CAT III                   | 32 mm             | 10 mV/A;<br>1 mV/A                  | DC20 kHz<br>(-1 dB)       | 1 % + 100 mA<br>1 % + 500 mA            | Z203B                     | •     | •                         |
| CP1800   | DC/AC current clamp sensor,<br>with 2 measuring ranges,<br>battery mode (50 h)           | Range: 0.5 125 A<br>Range: 5 1250 A<br>(DC / AC rms) | 300 V / CAT III                   | 32 mm             | 10 mV/A,<br>1 mV/A                  | DC 20 kHz<br>(-1 dB)      | 1% + 100 mA<br>1% + 500 mA              | Z204A                     | •     | •                         |
| AC Current   | Sensors with Voltage Output  |  |                                   |                   |                                     |                           |   |                           |       |                           |
| WZ12B  | AC clamp current sensor  | 10 mA~ 100 A~  | 300 V CAT III                     | 15 mm             | 100 mV/A                            | 45 65<br>500 Hz           | 1.5% +0.1 mA                            | Z219B                     | •     | •                         |
| WZ12C  | AC clamp current sensor, with 2 measuring ranges   | 1 mA~ 15 A~,<br>1 150 A~                             | 300 V CAT III                     | 15 mm             | 1 mV/mA,<br>1 mV/A                  | 45 65<br>400 Hz           | 3% + 0.15 mA,<br>2% + 0.1 A             | Z219C                     | •     | •                         |
| WZ11B  | AC clamp current sensor, with 2 measuring ranges   | 0.5 20 A~,<br>5 200 A~                               | 600 V CAT III                     | 20 mm             | 100 mV/A,<br>10 mV/A                | 30 <u>48 65</u><br>500 Hz | 1 3%                                    | Z208B                     | •     | •                         |
| Z3512A   | AC clamp current sensor, with 4 measuring ranges   | 1 mA 1/10/100/<br>1000 A~                            | 600 V CAT III                     | 52 mm             | 1 V/A, 100 mV/A,<br>10 mV/A, 1 mV/A | 10 <u>48 65</u><br>3 kHz  | 0.5 3%,<br>0.2 1%                       | Z225A                     | •     | •                         |
| METRA-<br>FLEX3000   | Flexible AC current sensor<br>with 3 measuring ranges,<br>battery mode (2000 h)          | 0,5 30 A,<br>0,5 300 A,<br>5 3000 A                  | 1000 V<br>CAT III<br>600 V CAT IV | 176 mm            | 100 mV/A,<br>10 mV/A,<br>1 mV/A     | 10 Hz 20 kHz              | 1% + 0.1 A<br>1% + 0.1 A<br>1% + 1 A    | Z207E                     | •     | •                         |
| METRA-<br>FLEX300M   | Flexible AC miniature current<br>sensor with 3 measuring<br>ranges, battery mode (150 h) | 1 3 A,<br>1 30 A,<br>5 300 A                         | 1000 V<br>CAT III<br>600 V CAT IV | 50 mm             | 1 V/A,<br>100 mV/A,<br>10 mV/A      | 20 Hz 100 kHz             | 1% + 0.2 A<br>1% + 0.2 A<br>1% + 1 A    | Z207M                     | •     | •                         |
| AC Current   | Transformer with Current Ou  | itput  |                                   |                   |                                     |                           |   |                           |       |                           |
| WZ12A  | AC clamp current transformer   | 15 180 A~  | 300 V CAT III                     | 15 mm             | 1 mA/A                              | 45 65<br>400 Hz           | 3%                                      | Z219A                     | _     | •                         |
| WZ12D  | AC clamp current transformer   | 30 mA 150 A~   | 300 V CAT III                     | 15 mm             | 1 mA/A                              | <u>45 65</u><br>500 Hz    | 2.5% +0.1 mA                            | Z219D                     | _     | •                         |
| WZ11A  | AC clamp current transformer   | 1 200 A~   | 600 V CAT III                     | 20 mm             | 1 mA/A                              | 48 65<br>400 Hz           | 1 3%                                    | Z208A                     | _     | •                         |
| Z3511  | AC clamp current transformer   | 4 500 A~   | 600 V CAT III                     | 30 x 63<br>mm     | 1 mA/A                              | 48 65<br>1 kHz            | 3% +0.4 A                               | GTZ351100<br>0R0001       |       | •                         |
| Z3512  | AC clamp current transformer   | 0.5 1000 A~  | 600 V CAT III                     | 52 mm             | 1 mA/A                              | 30 <u>48 65</u><br>5 kHz  | 0.5% 0.7%                               | GTZ351200<br>0R0001       |       | •                         |
| Z3514  | AC clamp current transformer   | 1 2000 A ~   | 600 V CAT III                     | 64 x 150<br>mm    | 1 mA/A                              | 30 <u>48 65</u><br>5 kHz  | 0.5% +0.1 A                             | GTZ351400<br>0R0001       |       | •                         |
|  | istors for Multimeters withou  | •  |                                   |                   |                                     |                           |   |                           |       |                           |
|  | Plug-in shunt resistor, encapsulated 1 $\Omega$  | 0 300 mA   | 300 V CAT III                     | _                 | 1 mV/mA                             | DC10 kHz                  | 0.5%                                    | Z205C                     | •     | •                         |
| NW3A   | Plug-in shunt resistor, encapsulated 0,1 $\Omega$  | 0 3 A  | 300 V CAT III                     | _                 | 100 mV/A                            | DC10 kHz                  | 0.5%                                    | Z205B                     | •     | •                         |

<sup>•</sup> with adjustable transformation factor 1: 1 / 10 / 100 / 1000

Prepared in Germany ullet Subject to change without notice ullet PDF version available on the Internet