

DIGITAL CLAMP METERS



CAT III 600V

2 m



KLEIN TOOLS



CLAMP METERS				
Cat. No.	UPC# 0-92644+	Description	Length	Width
CL120	63283-3	-400A AC Clamp Meter	8.4" (213 cm)	3.5" (89 cm)
CL120KIT	63284-0	Clamp Meter, Line Splitter, GFCI Tester	8.4" (213 cm)	3.5" (89 cm)
CL1220	63285-7	-400A AC TRMS Clamp Meter with Temperature	8.4" (213 cm)	3.5" (89 cm)
CL1220	63286-4	HYAC -400A AC TRMS Clamp Meter with Temperature and DC Micro Amp	8.4" (213 cm)	3.5" (89 cm)
CL350	63287-1	-400A AC/DC TRMS Clamp Meter with Temperature and DC Micro Amp	8.4" (213 cm)	3.5" (89 cm)



GFCI Receptacle Tester RT210
GFCI Outlet Tester with indicator lights, indicates common wiring problems



Magnetic Hanger with Strap 69417
Powerful rare-earth magnet, durable nylon weave strap, fits all newer clamp meters



Test Lead Set, Right Angle 69410
Standard banana-type inputs compatible with most multimeters and current clamping meters



Splitter 10x 69409
vs the measuring of current draw up to 15A out, splitting the load's ar cord



NEW! Magnetic Hanger no Strap 69445
Powerful rare-earth magnet, fits all newer clamp meters

ACCESSORIES AND REPLACEMENT PARTS				
Cat. No.	UPC# 0-92644+	Description	Length	Width
69409	69409-7	Line Splitter - 10x	4.7" (11.8 cm)	2.3" (5.8 cm)
69410	69410-3	Test Lead Set, Right Angle	41" (104.4 cm)	0.6" (1.5 cm)
69417	69417-2	Magnetic Hanger with Strap	5" (13 cm)	1" (2.4 cm)
NEW 69445	69286-8	Magnetic Hanger no Strap	1.3" (3.3 cm)	1.3" (3.3 cm)
RT210	69287-3	GFCI Receptacle Tester	2.9" (7.3 cm)	1.6" (4.1 cm)



KLEIN TOOLS



f y t

1.888.610.7664




www.calcert.com

sales@calcert.com

CL120

400A AC CLAMP METER

Digital clamp meter measures AC current via the clamp; NCV with the sensor; AC/DC voltage, resistance, and continuity via test leads.

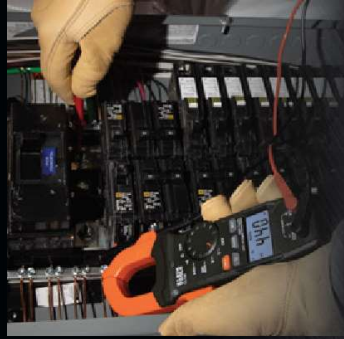

CL220

400A AC TRMS CLAMP METER WITH TEMPERATURE

Digital clamp meter with True Root-Mean Square (TRMS) measures AC current via the clamp; NCV with the sensor; AC/DC voltage, resistance, and continuity via test leads; and temperature via a thermocouple.



CL320

HVAC-400A AC TRMS CLAMP METER WITH TEMPERATURE AND DC MICRO AMP

Digital clamp meter with True Root-Mean Square (TRMS) measures AC current via the clamp; NCV with the sensor; AC/DC voltage, DC micro amps, resistance, capacitance, frequency, duty cycle, diode test, and continuity via test leads; and temperature via a thermocouple.



CL390

400A AC/DC TRMS CLAMP METER WITH TEMPERATURE AND DC MICRO AMP

Digital clamp meter with True Root-Mean Square (TRMS) measures AC/DC current via the clamp; NCV with the sensor; AC/DC voltage, DC micro amps, resistance, capacitance, frequency, duty cycle, diode test, and continuity via test leads; and temperature via a thermocouple.



Meter shown actual size.

Large Jaw Size
1.38" (3.51 cm)

NCV Sensing Antenna detects presence of AC voltage

Arrow Markings for optimal wire placement

Test Lead Holder for hands-free operation


NCVT Light for visual alarm of AC voltage

Data HOLD on/off button

Function Selection Switch; functions vary on models

NCV SEL Mode on/off button

High Visibility Display for optimal viewability

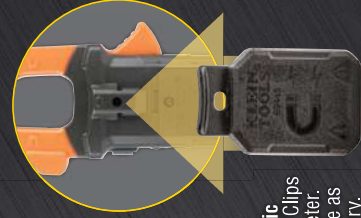

Magnetic Hanger Clips onto Meter. Available as accessory.

Test Lead Input Jacks: easy access on front

MEASUREMENTS	CL120	CL220	CL320	CL390
True RMS	—	•	•	•
AC Voltage	600V	600V	600V	600V
DC Voltage	600V	600V	600V	600V
AC Current	400A	400A	400A	400A
DC Current	—	—	—	400A
AC Millivolts	•	•	•	•
DC Millivolts	•	•	•	•
DC Microamps	—	—	—	•
Ohms (Resistance)	20MΩ	20MΩ	40MΩ	40MΩ
Audible Continuity	•	•	•	•
Non-Contact Voltage Testing	•	•	•	•
Capacitance	—	—	4000μF	4000μF
Frequency	—	—	1 MHz	1 MHz
Frequency / Duty Cycle	—	—	—	—
Diode Test	—	—	•	•
Temperature °F (°C)	—	—40~1832°F (-40~1000°C)	—40~1832°F (-40~1000°C)	—40~1832°F (-40~1000°C)
Display Counts	2000	2000	4000	4000
CONVENIENCE				
Display	LCD with Backlight	LCD with Backlight	LCD with Backlight	LCD Reverse Contrast
MAX/MIN	MAX	MAX	MAX & MIN	MAX & MIN
Data Hold	•	•	•	•
Low Battery	•	•	•	•
Auto Power Off	15 Min	15 Min	15 Min	15 Min
Magnetic Hanger	Available as an Accessory	Available as an Accessory	Available as an Accessory	Available as an Accessory
Lead Holder on Clamp	•	•	•	•
DURABILITY				
Drop Protection	6.6 ft. (2m)	6.6 ft. (2m)	6.6 ft. (2m)	6.6 ft. (2m)
Safety Rating	Cat III 600V	Cat III 600V	Cat III 600V	Cat III 600V

Accessories Subject to Change



Clamp Meters Include:

- Test leads with CAT III/CAT IV safety caps
- Thermocouple temperature measuring (models only)
- x AAA batteries
- User manual