VAISALA www.vaisala.com

Vaisala HUMICAP® Hand-Held Humidity and Temperature Meter Series HM40



The Vaisala HM40 Humidity and Temperature Meter is designed for spot-checking in a wide variety of environments and is available with four different probe options. Left to right: HM41, HM45, HM42, and HM46.

The easy-to-use HM40 is a compact and portable humidity meter that provides reliable measurements in a wide range of applications. It is the ideal spot-checking tool for everything from structural moisture measurement and air conditioning systems to humidity measurement in industrial production processes and life science applications. There are four different models available: HM41, HM42, HM45, and HM46.

Simple and Easy to Use


The HM40 has a large, user-friendly graphical display and easy-to-use push buttons. The user interface is simple and intuitive, and available in 10 languages. Also, many settings can be modified to meet users' individual needs. In addition to relative humidity and temperature, the HM40 provides five calculated humidity

parameters, all of which are available in metric and non-metric units.

The HM40 is powered by 2 AA batteries. An external NiMH charger with USB connection and rechargeable AA sized NiMH batteries are available as an option. Each model also comes with a handy belt clip and case.

Easy Recalibration

Calibrating the HM40 is easy. The meter or the probe can be sent to a Vaisala Service Center for recalibration. Alternatively, calibration can be completed on site by users with a humidity reference such as another hand-held meter or the Vaisala Humidity Calibrator HMK15. The indicator includes a calibration reminder function that can be activated by the user.

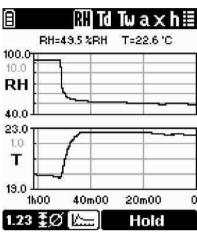

The graph clearly indicates when the readings have stabilized.

Benefits

- Compact, portable, and easy to use
- Versatile meter with wide measurement range and multiple calculated parameters
- Four different models available: HM41, HM42, HM45, and HM46
- Ideal for spot-checking in a wide variety of applications

Features

- Humidity measurement range 0 ... 100 %RH
- Temperature measurement ranges -40 ... +100 °C (-40 ... +212 °F), depending on probe model. The HM46 can measure up to +180 °C (+356 °F) for a short period of time.
- Incorporates proven Vaisala HUMICAP® sensor technology
- Calibration reminder function
- Probes can be user calibrated using an on-site reference
- Graphical display indicates when measurement has stabilized
- Hold-button to freeze the screen and save the reading
- Multilingual user interface available in 10 languages (EN, DE, FR, JA, ZH, PT, ES, RU, FI, SV)





Technical Data

HM41 Humidity and Temperature Meter

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH) ±2.5 %RH (90 ... 100 %RH) at -10 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +60 °C ±4.0 %RH (90 ... 100 %RH)

Temperature

-10 ... +60 °C measurement range interchangeable Measurement probe HMP113 probe

Probe material PC/ABS plastic blend (white) Housing classification

Technical Data

HM42 Humidity and Temperature Meter for Tight Spaces

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH) ±2.5 %RH (90 ... 100 %RH) at -40 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +80 °C ±4.0 %RH (90 ...100 %RH) at +80 ...+100 °C ±4.0 %RH*

Probe head temperature

-40 ... +100 °C measurement range Measurement probe HM42PROBE Stainless steel Probe head material Housing classification IP40 (probe), IP54 (indicator)

*) Not recommended for T_d > 85 °C

Technical Data

HM45 Humidity and Temperature Meter with Remote Probe

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH)

±2.5 %RH (90 ... 100 %RH)

at -40 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +60 °C ±4.0 %RH (90 ... 100 %RH)

Probe temperature

measurement range -40 ... +60 °C


Measurement probe interchangeable

HMP113 with HM40HANDLE


Probe material PC/ABS plastic blend (white) Housing classification

Dimensions

Dimensions in mm

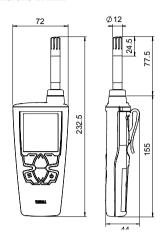


Dimensions

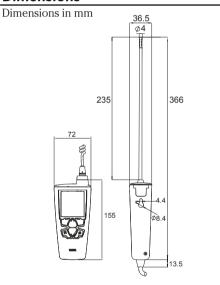

Dimensions

Dimensions in mm

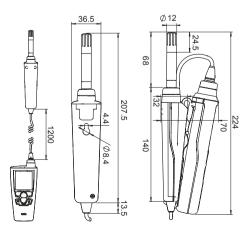








Technical Data

HM46 Humidity and Temperature Meter for Mechanical Durability and **Extra Reach**

Humidity measurement accuracy (including non-linearity, hysteresis, and repeatability):

at 0 ... +40 °C ±1.5 %RH (0 ... 90 %RH) ±2.5 %RH (90 ... 100 %RH) at -40 ... 0 °C and ±3.0 %RH (0 ... 90 %RH) +40 ... +80 °C ±4.0 %RH (90 ... 100 %RH) at +80 ...+100 °C ±4.0 %RH* Probe head temperature -40 ... +100 °C, shortmeasurement range term up to +180 °C Measurement probe HM46PROBE Probe head material Stainless steel, brass filter Housing classification IP40 (probe), IP54 (indicator)

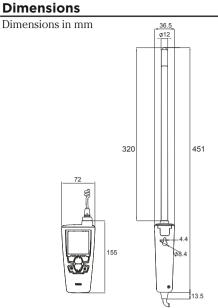

Technical Data

Performance

1 Ci ioiiiidiice		
RELATIVE HUMIDITY		
Measurement range	() 100 %RH
Accuracy (including non-linearity,		
hysteresis, and repeatability) for		
different models at 0 \dots +40 °C	±1.5 %RH (0) 90 %RH)
(+32 +104 °F)	±2.5 %RH (90	100 %RH)
Factory calibration uncertainty at +2	0 °C (+68 °F)	±1.5 %RH
Humidity measurement response time	ne	
(90 %) with plastic grid filter (HM4	1 and HM45)	17 s
(90 %) with membrane filter and steel grid (HM42) 26 s		26 s
(90 %) with brass sintered filter (HM46)		40 s
Stability	±2 %RH	over 2 years
Humidity sensor		
HM41, HM45, HM46	HUM	IICAP® 180R
HM42	HUMICAF	P® 100R-Mini
TEMPERATURE		
Measurement range		
HM41	-10 +60 °C (+1	4 +140 °F)
HM42	-40 +100 °C (-4	0 +212 °F)

HM46

HM45

-40 ... +100 °C (-40 ... +212 °F), short-term up to +180 °C (+356 °F) Accuracy over temperature range: at 0 ... +40 °C (+32 ... +104 °F) ±0.2 °C (0.36 °F) at -40 ... 0 °C and +40 ... +100 °C (-40 ... +32 °F and +104 ... +212 °F) ±0.4 °C (0.72 °F)

Temperature sensor

HM41, HM45, HM46 Pt1000 RTD Class F0.1 IEC 60751 HM42 Pt1000 RTD Class F0.3 IEC60751

Mechanics

Weight (with alkaline batteries	5)
HM41	230 g
HM42	370 g
HM45	330 g
HM46	490 g
Probe cable lengths	
HM42, HM46	1500 mm
HM45	1200 mm
Materials	
Meter body	PC/ABS blend, acrylic display lens
Probe holder	PC/ABS blend (gray)
Probe handle	PC/ABS blend (white),
	PC/ABS blend (gray, HM45)
	or PBT (gray, HM42/46)
HMP113 probe or	PC/ABS blend (white, HM41/45)
probe measurement head	or stainless steel (HM42/46)
Filter	
HM41, HM45	PC (glass-reinforced)
HM42	Stainless steel and PTFE membrane
HM46	Sintered brass
Housing classification	IP54
HM42 and HM46 probes	IP40



-40 ... +60 °C (-40 ... +140 °F)

^{*)} Not recommended for $T_d > 85$ °C

Technical Data

General

Power-up time <3s**Batteries** $2 \times AA$, 1.5 V Calculated parameters Dew point, wet bulb temperature, absolute humidity, mixing ratio, enthalpy Menu languages English, Chinese (simplified), Finnish, French, German, Japanese, Portuguese, Russian, Spanish, Swedish Display LCD (140 x 160 pixels) Operation time (typical) 100 hours (without backlight) Operation temperature range -10 ... +60 °C (+14 ... +140 °F) indicator probe handle -40 ... +60 °C (-40 ... +140 °F) probe head (see specifications for each probe type, ranges -40 ...+180 °C (-40 ... +356 °F) Storage temperature range -30 ... +70 °C (-22 ... +158 °F) Electromagnetic compatibility Complies with EMC standard EN61326-1, Portable Equipment

Accessories and Spare Parts

INDICATOR	
Spare HM40 indicator	HM40INDI
Belt clip (3 pcs)	227710SP
Battery cover (3 pcs)	225688SP
NiMH rechargeable batteries (4 pcs)	229247SP
External battery recharger with USB	
connection and 4 batteries	229249SP
Case for short HM40 probes	235849SP
Case for long HM40 probes	DRW242351SP

STANDARD PROBE (HM41) HMP113 probe for HM40 HMP113 (configural Plastic locking bushing (3 pcs) for attaching HMP113 probe to HM40 indicator Plastic grid filter for HMP113 probe Plastic grid with membrane filter for HMP113 pro	DRW238590SP DRW236214SP
r lastic grid with membrane interior riski 113 pro	De 25012151
HM42 PROBE (HM42)	
Thin 4 mm diameter probe for HM40	HM42PROBE
Steel grid filter for HM42PROBE	19867HM
Membrane tube set (5 pcs) for HM42PROBE	19858HM
Rubber sleeve set (10 pcs) for HM42PROBE	19809HM
Calibration adapter for HM42PROBE	HM37067
REMOTE PROBE (HM45)	
HMP113 probe for HM40 HMP113 (configura	ation: V00B2C1A0)
Plastic locking bushing (3 pcs) for attaching	
HMP113 probe to HM40 indicator	DRW238590SP
HM40 handle and cable	HM40HANDLE
Plastic grid filter for HMP113 probe	DRW236214SP
Plastic grid with membrane filter for HMP113 pro	be 230727SP

HM46 PROBE (HM46)

(up to +80 °C)

Probe holder

Sintered filter for HM46PROBE

Disposable sleeve, 50 pcs set

Stainless steel 12 mm diameter probe for HM40

Plastic grid filter for HM46PROBE (up to +80 °C)

Optional membrane filter for HM46PROBE

HM46PROBE

0195

6221

1558

10159HM

HM36915