



# RESISTANCE METER RM3545/RM3544

Component measuring instruments





#### **RESISTANCE METER RM3545**

# Featuring super-high accuracy and multi-channel capabilities

(20 channels with 4-terminal measurement)

Basic accuracy: 0.006% No. of display digits: Max. 6.5

Max.resolution : 0.01μΩ (LP) 0.01mΩ



#### **RESISTANCE METER RM3544**

# **High-accuracy bench-top meter ideal for production lines**

■ Basic accuracy: 0.02% No. of display digits: Max. 4.5

Max.resolution :  $1\mu\Omega$ 

# Choose from two models based on your application



# and multi-channel capabilities

for advanced development and production applications

Resistance measurement

Basic accuracy: 0.006%

Max. resolution :  $0.01\mu\Omega$ 

Max. measurable current: 1A

•Low power resistance measurement

Max. resolution :  $0.01m\Omega$ Basic accuracy: 0.2% Max. measurable current : 1mA Max. Open-circuit voltage: 20mV



## **High-precision bench-top meter**

for both manual operation and integration with automatic lines

Basic accuracy: 0.02% Max. resolution :  $1\mu\Omega$ 

Max. measurable current: 300mA

# Applications

■Small-signal contacts







■Compact fuses, airbag inflator, RM3545 compact magnetic components (EMC filters, ferrite beads)





■ Multi-contact resistance measurement (motor and transformer windings)









■Contacts, wire harnesses, relay contacts, switches RM3545 ■Fuses, resistors, heaters, RM3545 RM3544

■Motors, solenoids, choke coils, transformers,

wires, welds

wire harnesses







RM3545 TRM3544

■Conductive rubber, paint





RM3544

#### General specifications

RESISTANCE METER RM3545		RESISTANCE METER RM3544
$0.00\mu\Omega$ to $1200M\Omega$	Measurement types (4-terminal direct current)	0.000 m $\Omega$ to 3.5 M $\Omega$
/	Temperature measurement, Temperature correction (TC), comparator, judgment sound setting, auto hold	✓
✓	Low power resistance measurement (LP)	N/A
✓	Temperature rise (Temperature conversion (ΔT)	N/A
✓	Offset voltage compensation (OVC)	N/A

#### Multi-point measurement with the Multiplexer Unit Z3003 (20 locations with 4- terminal measurement) RM3545-02

Scanning measurement using the Multiplexer Unit Z3003 is convenient in applications that require multi-contact measurement, for example when testing network resistors, steering switches, or 3-phase motor windings. Simply insert a Z3003 unit into one of the slots on the back of the RM3545-02 to enable scanning measurement of up to  $20\,$ locations\* with 4-terminal measurement.

(\*When using two Z3003 units, up to 42 locations can be measured with 2-terminal measurement.)



Multiplexer unit Z3003 (Option)


slots on the back of the instrument.

Insert up to two Z3003 units into the

Pictured: Back of the RM3545-02 with two Z3003 units (optional feature) installed


# Application 1.


Measuring a 3-phase motor winding

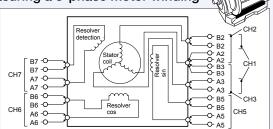

# Application 3.


Testing a relay






# Application 2.

Testing a connector or wiring harness

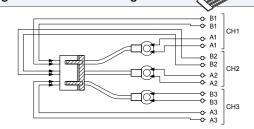


## Application 4.

Testing battery terminal welds

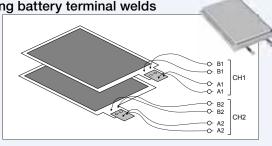

# Probes suited to manual measurement on production lines RM3545 PIN TYPE LEAD PIN TYPE LEAD 4 -TERMINAL LEAD **CLIP TYPE LEAD L2101** (Bundled accessory) L2102 L2103 L2104

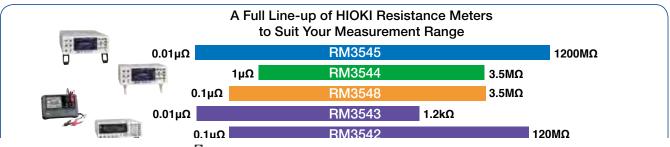

1.888.610.7664




sales@calcert.com

# Simplifying high-accuracy resistance measurement

#### ■ Standard features of the high-accuracy Resistance Meter RM3545 and RM3544

# Convenient wide range options RM3545 RM3544

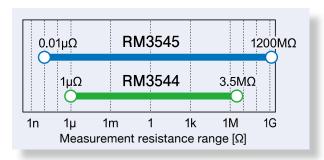





Integrate into automated inspection systems

Manual testing on production lines

#### Overview of the RM3545

RM3545

Measure from  $0.00\mu\Omega$  to  $1200.0M\Omega$ 0.01μΩ max. resolution, 0.006% basic accuracy Max.measurable current of 1A

The RM3545 can perform resistance measurement with a 6.5-digit, 1,200,000-count display at a maximum resolution of 0.01  $\mu\Omega$ . It delivers more than enough capabilities to be used in applications requiring highresolution resistance measurement, for example in testing inverter motor windings.

High-resistance materials such as conductive sheets and conductive rubber are often used in electronic components. The RM3545 can measure resistance values of up to 1,200 M $\Omega$ . It also delivers maximum accuracy of 0.006%, enabling researchers to test state-of-the-art current sensing resis-

#### Overview of the RM3544

RM3544

Measure from  $0.000m\Omega$  to  $3.5000M\Omega$ 1μΩ max. resolution, 0.02% basic accuracy Max.measurable current of 300mA

As inverter-equipped power supply equipment uses increasingly high currents and frequencies, increasingly low-resistance and low-loss inductors are being incorporated in their circuitry, prompting a need for the ability to measure lower resistance levels with a high level of stability. With a resolution of 1  $\mu\Omega$ , the RM3544/RM3544-01 satisfy these needs.

Electronic components make extensive use of high-resistance substrates such as conductive sheets and rubber, and the RM3544/RM3544-01 deliver the ability to measure up to 3.5 M $\Omega$ .

Moreover, the instruments' maximum accuracy of 0.02% allows them to be used in testing current detectors with a precision of 0.1%.

#### • Guaranteed accuracy with no warm up or zero-adjustment RM3545 RM3544

For the RM3545/RM3544, accuracy is guaranteed\* immediately after startup, without any warm up or zero-adjustment.

\*When performing measurement with the RM3545 in a temperature and humidity environment that satisfies the guaranteed accuracy conditions, an even higher level of accuracy (full accuracy) is guaranteed.

# High-durability probes

RM3545

HIOKI offers a line of probes designed to accommodate the full range of measurement targets. Flex resistance has been dramatically improved (based on HIOKI comparisons).



# Example lead tip profiles

# Offset Voltage Compensation (OVC) RM3545

Thermal EMF occurs at connections between different metals. This force can affect measurement and, if large enough, introduce a measurement error. The RM3545's offset voltage correction (OVC) function reduces the effects of thermal EMF to enable more precise measurement.


# Temperature correction

RM3545

Generally, the resistance of copper wiring changes with temperature by 0.4% per degree Celsius. The RM3544/RM3545 provide a temperature correction function to convert the observed resistance value Rt at the current temperature t to the resistance value  $Rt_0$  at the reference temperature  $t_0$ .

\*Requires the Temperature Sensor Z2001 or a thermometer capable of generating analog voltage output (an infrared thermometer or similar instrument).

Types of temperature input	RM3544: Temperature Sensor (Z2001) RM3545: Temperature Sensor (Z2001), Analog voltage input (from an infrared thermometer, etc.)
Reference temperature	-10.0 to 99.9 °C

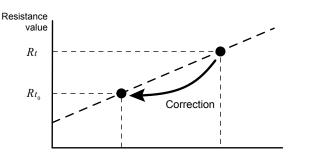



# Super-high-accuracy, multi-channel resistance meter for use in advanced development and production applications

## ■ Key Features of the RM3545

RM3545



# High/low current selection by range

Select the optimal measurement current by switching between high and low settings according to the characteristics of the sample.

#### Extensive contact check functionality

The RM3545 can detect erroneous measurements caused by improper contact, reducing the risk that improperly judged or unchecked parts will be shipped by mistake. Contact check functionality is also provided for 4-terminal measurement.




# Low-power (LP) resistance measurement

The RM3545 can perform measurement at a resolution of 10  $\mu\Omega$  at 1 mA (using the 1,000 m $\Omega$  range). With an open-terminal voltage of 20 mV or less, the instrument is ideally suited for measuring the contact resistance of chip inductors and signal contacts.

#### D/A output

The RM3545 converts resistance measured values into DC voltage for output. This capability is convenient when continuously recording changes in resistance, for example as detected by a sensor, with a logger or other piece of equipment.

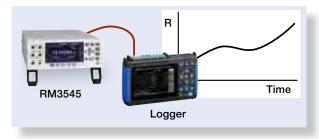

#### Temperature input (temperature sensor terminal)

Input temperature data for use in temperature correction using either the Temperature Sensor Z2001 or a DC voltage (0 to 2 V). Connect a thermometer that can generate DC voltage output, for example an infrared thermometer, to perform temperature correction.

#### Temperature conversion function: Useful in temperature-rise testing

Temperature increase (Δt) is obtained and displayed by converting resistance measurements and ambient temperature.

# ■ Multiplexer function (RM3545-02 only)

RM3545-02

# Auto-scanning and step scanning

When using the Multiplexer Unit Z3003 to perform scanning measurement, you can select either step scanning or auto scanning depending on the test conditions.

Auto scanning is convenient when you require only an overall judgment result at the completion of scanning, while step scanning is convenient when you wish to generate judgments in real time using the instrument's EXT I/O interface...

#### Comparator judgments based on measurement results


Measurement targets that are susceptible to the effects of temperature, for example thermistors and temperature transducers, can be compared with a reference element to generate a judgment.

#### Flexible pin assignments

The ability to freely combine A terminal pin(s) with B terminal pin(s) for each channel makes it possible to perform measurement using wiring that has been optimized for a variety of measurement targets.

#### Acquiring Total judgment results from EXT I/O

The multiplexer's total judgment result (T\_PASS, T\_FAIL, T\_ERR) can

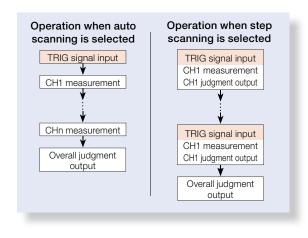

#### Configuration using a computer

Multiplexer settings can be configured using the keys on the instrument, communications commands, or a computer application (sample PC application). The sample application can be downloaded from Hioki's website (http://www.hioki.com).

# Easy-to-use RESISTANCE METER

# suits both manual operation and integration with automatic lines

# **High-intuitive advanced functionality**

RM3545 RM3544



#### **Guard terminals**

Minimize the effects of external noise on measurements.

\*GUARD terminal is the shield potential. This terminal is not for guarding network resistance measurements.

# Simple control over basic settings

Range and measurement speed can be controlled directly.



# **LED COMPARATOR ATTACHMENT (Option)**

The LED Comparator Attachment indicates judgment results with green and red LEDs, eliminating the need to look at the instrument's screen and increasing work efficiency. Since the lamps do not light up when the measurement leads are open, the attachment can also be Green light used to verify the connection status. IN state





Red light HI/LO state

# High-volume, user-selectable judgment tones

The RM3544 indicates results with a high-volume judgment tone of 85 dB or greater to ensure it is audible near noisy machinery.

Both the RM3545 and RM3544 feature user-selectable judgment tones so workers don't confuse judgment results on lines where multiple resistance meters are being used.

# Functionality for saving and loading panels

The RM3545 (RM3544) can save and load up to 30\* (10) sets of range, comparator, and other settings. Naming each set of panel data lets you make setup changes among production lots and lines smoothly and ef-

\*When using the multiplexer terminals, up to 8.


# Material- and temperature-independent temperature correction function

The temperature correction function can be used to convert resistance values that vary with the ambient temperature to a reference value at a reference temperature using the Temperature Sensor Z2001 and a userspecified resistance temperature coefficient.



The scaling function can be used to convert resistance values into physical properties such as length.

> Conversion formula :  $Rs = A \times R + B$ A, B: Constants, R: Measurement value Rs: Resistance value

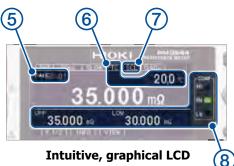

# Comparator Function

The comparator function compares measured values to a previously set reference value or range and then displays and outputs the judgment result. The RM3545 and RM3544-01 can also output this information using EXT I/O.

# High-precision specs in a compact package

RM3544



# Footprint of just 215 × 166 mm

Compared to the previous model (HIOKI 3540), the RM3544/RM3544-01 take up approximately 25% less installation space.

This space-saving design frees up space in front of the instrument and lets you build compact production lines.



# Easy integration into automatic testing equipment (RM3545/-01/-02, RM3544-01)

RM3545 RM3544

#### Ability to extend measurement cable length

The new instruments feature better wiring resistance tolerances than previous models (the 3541 and 3540). Wiring resistance can now be as high as 1.5  $\Omega$  for the RM3545 and 2  $\Omega$  for the RM3544.

#### High-speed, comprehensive productivity support

- The RM3545 and RM3544-01 deliver the speed demanded by automatic testing equipment at a sophisticated level. The entire process from the start of measurement to outputting of the judgment result takes as little as 2.2 ms\*1 (RM3545) and 18 ms (RM3544-01). One cycle of operation, lasting from measurement to judgment output, completes within this \*1 When the measurement current is set to "High".
- The instrument's USB interface can also be used.

- The RM3545 and RM3544-01 support RS-232C data communications at up to 115.2 kbps\*2.
- The EXT I/O output mode can be switched between judgment mode and BCD mode.
- \*2 With some computers, large error components may prevent fast transfer speeds (baud rates) from being used. In this case, change the speed to a lower setting

EXT I/O interface, be sure to read

## Handler (EXT I/O) interface


The handler interface (EXT I/O) is isolated from measurement circuitry, control circuitry, and the protective ground (chassis ground), providing a high level of noise resistance.


#### ■ EXT I/O Input and Output Circuits

A switch on the rear panel is used to toggle the input signal polarity between NPN (sink output support) and PNP (source output support) settings depending on the PLC common polarity.



EXT I/O polarity (Select NPN/PNP)

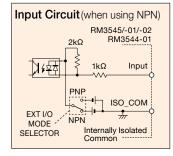

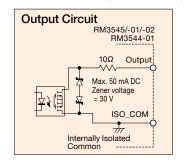

the instruction manual and check the necessary technical information.

When designing a control system using the

#### EXT I/O Electrical Specifications

#### Inputs:

Photocoupler isolation: Non-voltage contact inputs (support for current sink output) Input ON: Residual voltage: Max. 1 V @4 mA Input OFF: Open Max. 100 µA

#### Outputs:

Photocoupler-isolated open drain output (no-polarity) DC30Vmax, DC50mAmax/ch Residual voltage: Max. 1 V @50 mA, or 0.5 V @10 mA

#### External power output:

Output voltage: Sink output support: 5.0V±10%, Source output support: -5.0V±10% Max. output current: 100mA

#### ■ EXT I/O Signal List

LOAD0 to LOAD5, BCD\_LOW

#### RM3545 Input Signals:

## RM3545

#### Input Signals:

TRIG(IN0), KEY\_LOCK, 0ADJ, PRINT(IN1), LOAD0 to LOAD3, BCD\_LOW

#### Output Signals:

■ RM3544-01

[Judgment mode] EOM, ERR, INDEX, HI, IN, LO, OUT0 to OUT2 [BCD mode] EOM, ERR, IN, HILO, BCDm\_n\*, RNG\_OUT0 to RNG\_OUT3 \* Indicates the nth bit of the mth digit.

[Judgment mode] EOM, ERR, INDEX, HI, IN, LO, T\_ERR, T\_PASS, T\_FAIL, BIN0 to BIN9, OB, OUT0 to OUT2 [BCD mode] EOM, ERR, IN, HILO, BCDm\_n\*, RNG\_OUT0 to Indicates the nth bit of the mth digit. RNG OUT3

TRIG(IN0), CAL, KEY\_LOCK, 0ADJ, PRINT(IN1), MUX, SCN\_STEP,

# Communications Monitor Function for smooth systems development

The Communications Monitor Function displays communications data (received commands and sent data) on the screen, providing valuable support for programming of programmable logic controllers (PLCs).


## Functionality for verifying the EXT I/O connection status and testing EXT I/O

In addition to allowing you to check EXT I/O signal input on the instrument's



Communications Monitor screen

RM3544





## Connecting the instrument to a computer via RS-232C or USB

- Use a PC to control RM3545 and RM3544-01 functions as well as acquire measurement results.


  (This combility does not include turning the instrument on and off on
  - (This capability does not include turning the instrument on and off or configuring certain interface settings.)
- Connect the instrument to a commercially available RS-232C printer to print measured values, including judgment results.
- Measured values can be automatically output. By using the instrument's USB keyboard mode, measured values can be entered into applications such as spreadsheets and text editors without the need to install a special USB driver in the computer.
- The sample PC application provides functionality for capturing data based on trigger signals, performing interval measurement, conducting communication tests, and loading captured data into Microsoft® Excel or outputting it as a CSV file. The application can be downloaded from Hioki's website (http://www.hioki.com).



Applications screen

#### ● RM3545-02 rear panel


#### RM3545

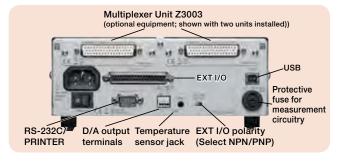

\*Multiplexer Units cannot be installed in the RM3545 or RM3545-01. The RM3545-01 has a GP-IB connector.

## ● RM3544-01 rear panel

RM3544

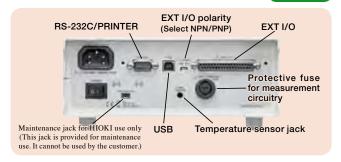

\*The RM3544 does not include EXT I/O or communication interfaces (RS-232C or USB). Select the RM3544-01 for these functions.

#### RM3545

RM3544

RM3545-02

#### Interface and EXT I/O selection

Select the interfaces and EXT I/O capability needed for your application.

RM3545 serie	es comparison chart	(Base model)	-01	-02
External I/O (comparator, B	CD, BIN function)	1	1	/
Communication	RS-232C/Printer/USB	✓	1	/
interfaces GP-IB		N/A	1	N/A
Multiplexer* (so	anner function)	N/A	N/A	✓ (Max. 20 channels)

 $<sup>*</sup>When using 4-terminal \ measurement \ with \ two \ MULTIPLEXER \ UNIT \ Z3003 \ (option) \ cards.$ 

RM3544 series comparison chart	(Base model)	-01
External I/O (comparator, BCD)	N/A	1
Communication interfaces RS-232C/Printer/USB	N/A	✓

#### ■ MULTIPLEXER UNIT Z3003 Specifications

Measurement targets	4-wire: 10 locations (when using 2 units, 20 locations) 2-wire: 21 locations (when using 2 units, 42 locations)
Measurable range	[Measurement current] Internal instrument: IA DC or less External instrument: 1A DC or less, 100 mA AC or less [Measurement frequency] External instrument DC, 10 Hz to 1 kHz
Contact specifications	Contact type: Mechanical relay Maximum allowable voltage: 33 V RMS and 46.7 V peak or 70 V DC *1 Maximum allowable power: 30 W (DC), (Resistance load) Contact service life: 4-wire: 50 million cycles*2 (reference value)
Dimensions	Approx. 92W × 24.5H × 182D mm (3.62"W × 0.96"H ×

#### Product warranty: 1 year

\*Example scanning times
The Z3003 switching time is 30 ms/ch.

Range	Number of channels	Measurement speed	Delay	Time to output judgment results after TRIG input (When the measurement current is set to "High".)
$1000 \text{m}\Omega$	10	FAST	0 ms	Approx. 300ms
1000mΩ	10	FAST	Preset	Approx. 800ms

<sup>\*1</sup> Cannot be used in combination with a withstand voltage tester. When used with a withstand voltage tester, the Z3003's internal relay will cause an insulation breakdown, resulting in electric shock or equipment damage.

<sup>\*2</sup> Assuming 24-hour operation, the guideline of 50 million cycles corresponds to approximately 1.5 years on a line operating at 1 sec. per workpiece or approximately 15 years on a line operating at 10 sec. per workpiece.



# ■ RM3545/RM3544 Specifications

#### Product warranty: 1 year

	RM3545	RM3544
	Resistance measurement: 0.000 00mΩ (10mΩ range) to	
	1200.0MΩ (1000MΩ range), 12 ranges Low power resistance measurement: $0.00$ mΩ ( $1000$ mΩ range) to	esistance measurement: $0.000 \mathrm{m}\Omega$ ( $30 \mathrm{m}\Omega$ range) to
Measurement typ	1200,000 (10000	$3.500  0 \text{M}\Omega  (3 \text{M}\Omega  \text{range}), 9  \text{range}$
	Temperature measurement (thermistor): -10.0 to 99.9°C	emperature measurement (thermistor): -10.0 to 99.9°C
	Temperature measurement (analog input): -99.9 to 999.9°C	
Measurement meth	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	
Range switching	Auto or Manua	
emperature correct		eference temperature setting range: -10°C to 99.9°C, emperature coefficient setting range: -9,999 ppm/°C to 9,999 ppm/°C
	By range, by step (RM3545-02 only)	imperature coefficient secting range. 7,777 ppins & to 7,577 ppins
Zero-adjustment		fithin -3% to 50% f.s. of each range. (f.s.= 30,000 dgt.)
	for 100 MΩ or greater ranges.)	
rigger		M3544: Internal trigger, RM3544-01: Internal or externa
Measurement spee		AST / MED / SLOW
Delay	Internal fixed value: / 0 to 9999 ms (1ms step)  Temperature correction, Temperature conversion, Self-calibra-	N/A
	tion offset voltage compensation (OVC) comparator (ARS/ IEI	emperature correction, comparator (ABS/REF%), key
	DEE%) DIN key look (OFF many look all look) display digit 100	ck (OFF, menu lock, all lock), display digit count selec
unctions	count selection function (/ digits/6 digits/5 digits), automatic   fra	on function (5 digits/4 digits), automatic power supplequency settings (AUTO/50Hz/60Hz), scaling, judgmer
	power supply frequency settings (AUTO/30HZ/60HZ), scaling,	ound setting, auto hold, L2105 LED Comparater Attach
	judgment sound setting, auto hold, statistical calculations, clock,	ent output
Measurement fau	self-test, L2105 LED Comparater Attachment output	
พeasurement faเ detection functio	(Contact check, over detection, current tault detection (Ov	ver detection, current fault detection
Averaging	OFF, 2 to 100 averaging iterations (var	riable in 1-iteration steps)
- V	30 (Front terminals), 8 (MUX (multiplexer)) 10	• •
Panel store,	Panel save parameters: save time and date, resistance measure-	anel save parameters: resistance measurement ranges
oanel load	ment ranges, measurement speed, comparator, BIN setting, mul-	easurement speed, comparator, etc.
	tiplexer setting, etc.	1 / 1 /
	RM3545-02: Number of installed units: Max. 2	
	Measurement terminal settings: Front terminals / MUX	
	(multiplexer)	
Multiplexer	When using the MUX setting, the measurement leads cannot	N/A
	be connected to the front measurement terminals	
	Support unit: Z3003	
	Number of channels that can be set: 42, switching time 30 ms (reference value)	
	Output: resistance measured value	
2/4	Output voltage: 0V DC to 1.5V DC	NIA
D/A output	Output impedance: 1kΩ	N/A
	Number of bits: 12bit	
XT I/O		M3544-01: TRIG and other, BCD
Communication nterfaces		M3544-01: Soloat from DS 222C DRINTED(DS 222C) or USB
Communicat	*RM3545-01 only  On Remote function, communications monitor function, data output Re	Select from RS-232C, PRINTER(RS-232C), or USB emote function, communications monitor function, data
interfaces		itput function
RS-232C	Bit rates: 115,200 / 38,400 / 19,200 / 9,600 bps	tput runotton
USB	Class: CDC (COM mode), HID (USB keyboard mo	lode)
	Printed data: Resistance measurement values, temperature mea-	rinted data: Resistance measurement values, temperatur
Printer	surement values, judgment results, measurement conditions, sta-	easurement values, judgment results, measurement cor
(RS-232 por	<b>)</b>	tions
(110-232 por	Operation: Prints at PRINT signal or PRINT key input.	
)noroting to	Interval: ON/OFF, Interval times: 1 to 3,600 s (variable in	1 s steps), Number of print columns per row: 1 or 3
perating temperat nd humidity	0 to 40°C, 80% rh or less (nor	n-condensating)
Storage temperat	re	
nd humidity	-10 to 50°C, 80% rh or less (no	on-condensating)
perating environm	Indoors, Pollution Degree 2, up	p to 2,000 m ASL
Power supply Rated supply voltage: 100 to 240 VAC		
ated power consump		VA
sulation withsta	· · · · · · · · · · · · · · · · · · ·	
otential	between all mains supply terminals and protective g	
Dimensions		pprox. $215W \times 80H \times 166D \text{ mm} (8.46\text{"W} \times 3.15\text{"H} 54\text{"D}) \text{ (without projections)}$
		M3544: Approx. 0.9 kg (31.7 oz)
		M3544-01:Approx. 0.9 kg (31.7 oz)
Mass		ower cord ×1, CLIP TYPE LEAD L2101 ×1, male EX
Mass	Po I I CLID TEXTS YOUR I	
Accessories	Power cord x1, CLIP TYPE LEAD L2101 x1, temperature	O connector* ×1, instruction manual ×1, application dis

## ■ Measurement accuracy

#### RM3544

#### Conditions of guaranteed accuracy

- Temperature & humidity: 23 °C ±5 °C, 80% rh or less (non-condensating)
- From 0°C to 18°C and from 28°C to 40°C, add (temperature coefficient ±[1/10 measurement accuracy] / °C).
- Guaranteed Accuracy Period: 1 year
- RM3545 only: Warmup time of 60 min. or greater (If less than 60 min., double figures in the accuracy table to obtain the measurement accuracy.)
- RM3545 only: self-calibration AUTO

\* During temperature correction, the value calculated below is added to the rdg. error for resistance measurement accuracy:

to: Reference temperature. [°C]

Ambient temperature. [°C]

 $\Delta t$ : Temperature, measurement accuracy

 $\alpha_{t0}$ :Temperature. coefficient at  $t_0$  is [1/°C]

RM3545

\*When using manual self-calibration, temperature fluctuations after performing calibration must be within ±2°C, and the calibration interval must be within 30 min.

 $-\alpha_{t0}\Delta t$ 

 $1 + \alpha_{t0} \times (t + \Delta t - t_0)$ 

#### ■ Resistance measurement accuracy

#### RM3545

(Example) 0.006 + 0.001 ...... 0.006% rdg. + 0.001% f.s.

×100 [%]

Accuracy =  $\pm$ (% rdg. + % f.s.)

#### LP OFF

- f.s. = calculated 1,000,000 dgt., where 0.001% f.s. = 10 dgt.
- For 100 M $\Omega$  and greater ranges with 100 M $\Omega$  range high-precision mode off, calculate as f.s. = 10,000 dgt. and 0.01% f.s. = 1 dgt.

Damas	100MΩ range high-	Max.	Reso-		Accuracy %rdg. + %f.s. *2			Measur curre		Additional accuracy without	Max open- terminal
Range	precision mode	measurement display *1	lution	FAST	MED	SLOW1	SLOW2	Switching		0ADJ %f.s. *2	voltage
10mΩ		12.000 00 mΩ	10 nΩ	0.060+0.050	0.060-		0.060+0.020	_	1A	0.020	
	-			(0.060+0.015)	(0.060-		(0.060+0.001)			(-)	
				0.060+0.010	0.060-		0.060+0.010	High	1A	0.002	
100mΩ		120.000 0 mΩ	100 nΩ	(0.060+0.003)	· · · · · · · · · · · · · · · · · · ·	+0.001)	(0.060+0.001)	_		(-)	
				0.014+0.050	0.014		0.014+0.020	Low	100mA	0.020	
	-			(0.014+0.015) 0.012+0.010	(0.014	0.012+0.008	(0.014+0.001)			0.002	
				(0.012+0.010		(0.012+0.008)		High	100mA	(-)	
1000mΩ		1200.000 mΩ	1 μΩ	0.008+0.050		0.008+0.020				0.020	
				(0.008+0.015)		(0.008+0.002)		Low	10mA	(-)	
	1			0.008+0.010 0.008+0.008				0.002	5.5V *4		
400		12 000 00	10.0	(0.008+0.003)		(0.008+0.001)		High	10mA	(-)	
10Ω	-	12.000 00 Ω	10 μΩ	0.008+0.050		0.008+0.020		_		0.020	
				(0.008+0.015)		(0.008+0.002)		Low 1mA	(-)		
				0.007+0.005	0.007+0.002	0.007-	+0.001	High	10mA	_	
100Ω		120.000 0 Ω	100 μΩ	(0.007+0.005)	(0.007+0.001)		+0.001)	Iligii	IOIIIA	(-)	
10022		120.000 0 32	100 μ32	0.008+0.010				Low	1mA	0.002	
				, ,		(0.008+0.001)	)			(-)	
1000Ω		1200.000 Ω	1 mΩ	0.007+0.005	0.006+0.002 0.006+0.001			1mA			
401.0	-		40.0	(0.007+0.005)	(0.006+0.001)	,	+0.001)			(-)	
10kΩ	-	12.000 00 kΩ	10 mΩ	0.008+0.005	0.007+0.002	0.007-			1mA		
100kΩ	-	120.000 0 kΩ	100 mΩ	0.008+0.005	0.007+0.002	0.007-			100μΑ		
1000kΩ		1200.000 kΩ	1 Ω	0.015+0.005	0.008+0.002			10μΑ			
10ΜΩ		12.000 00 MΩ	10 Ω	0.030+0.005	0.030+0.002		_	lμA		2017	
	ON	120.000 0 MΩ	100 Ω	0.200+0.005	0.200+0.002 0.200+0.001			100nA	_	20V	
100ΜΩ	OFF	120.00 MΩ	10 kΩ	10.00MΩ or less : 0.50+0.02							
				10.01MΩ or more : $1.00+0.02$				Max.			
1000ΜΩ	OFF	1200.0 MΩ	100 kΩ			ess: 1.00+0.02 ore: 10.00+0.02			lμA		

<sup>\*1</sup> For negative values, to -10% f.s. The maximum display range is 9,999,999 dgt. or 9 GQ. (An over-range error will be indicated when the maximum measurement range is exceeded, even if the maximum display range is not exceeded.)

**LP ON** • f.s. = calculated 100,000 dgt., where 0.001% f.s. = 1 dgt.

Danas	100MΩ range high-	Max.	Reso-		Accuracy %	rdg. + %f.s. *2	f.s. *2 Measure currer				Max open- terminal
Range	precision mode	measurement display *1	lution	FAST	MED	SLOW1	SLOW2	Switching		0ADJ %f.s. *2	voltage
1000mΩ		$1200.00 \ m\Omega$	10 μΩ	0.200+0.010	0.200+0.010	0.200+0.005	0.200+0.003		1mA		
10Ω		$12.000~0$ $\Omega$	100 μΩ	0.200+0.005	0.200+0.005	0.200+0.003	0.200+0.002		500μΑ		20mV *5
100Ω	_	120.000 Ω	1 mΩ	0.200+0.005	0.200+0.005	0.200+0.003	0.200+0.002	] -	50μΑ	_	20111
1000Ω		1200.00 Ω	10 mΩ	0.200+0.005	0.200+0.005	0.200+0.003	0.200+0.002		5μΑ		

<sup>\*1</sup> For negative values, to -10% f.s. The maximum display range is 9,999,999 dgt. or 9 GQ. (An over-range error will be indicated when the maximum measurement range is exceeded, even



<sup>\*2</sup> Measurement accuracy figures reflect accuracy after zero-adjustment. If not performing zero-adjustment, add the figures shown in the "Additional accuracy without 0ADJ" column. Figures shown in parentheses on the second line indicate the additional accuracy with OVC on.

<sup>\*3</sup> Measurement current accuracy is ±5%.

<sup>\*4</sup> When using an external trigger source or performing measurement with continuous measurement set to off (other than free-run), the open-circuit voltage from 1 ms after the completion of measurement (INDEX = ON) to the start of the next measurement (TRIG = ON) is limited to 20 mV or less.

#### Additional accuracy when using the Z3003

When performing measurements using the Z3003, the following uncertainties are added to the RM3545 specifications (accuracy):

Effects of leak current	Add a reading error shown on right depending on the measurement current (when using guarding) (With humidity of less than $70\%$ RH. If the humidity is greater than or equal to $70\%$ RH, add the following rdg. error $\times$ 5.):		I <sub>MEAS</sub> : Measurement current
Effect of measurement speed	Add the f.s. error component shown on right when the integration time is not a whole-number multiple of the power supply cycle:	$A_{\rm fs} \times 0.5$ [%rdg.]	A <sub>fs</sub> : f.s. error component for RM3545-02 with
Effect of offset voltage	Add the resistance shown on right to the error when OVC is OFF:	$\frac{10\times10^{-6}[\mathrm{V}]}{I_{\mathrm{MEAS}}[\mathrm{A}]} [\Omega]$	Z3003
Effect of offset resistance fluctuations	When using a 2-wire setup, add the wiring resistance shown on right to the error component.	0.1 Ω	
Temperature coefficient	From 0°C to 18°C and 28°C to 40°C, add a temperature coefficient of ±(1/	10 of additional accuracy) / °C.	

PRM3544

RM3544

Accuracy =  $\pm$ (% rdg. + % f.s.)

• f.s. = calculated 30,000 dgt., where 0.010% f.s. = 3 dgt.

(Example) 0.020 + 0.007 ...... 0.020% rdg. + 0.007% f.s.

Range	Max. measurement display* <sup>6,*7</sup>	FAST	MED/SLOW	Measurement Current*8	Open-Circuit Voltage
$30 \mathrm{m}\Omega$	$35.000~\mathrm{m}\Omega$	0.030+0.080	0.030+0.070	300mA	
$300 \mathrm{m}\Omega$	350.00 mΩ	0.025+0.017	0.025+0.014	300mA	
3Ω	3.500 0 Ω	0.025+0.017	0.025+0.014	30mA	
30Ω	35.000 Ω	0.020+0.010	0.020+0.007	10mA	
300Ω	350.00 Ω	0.020+0.010	0.020+0.007	1mA	5.5Vmax.
3kΩ	3.500 0 kΩ	0.020+0.010	0.020+0.007	1mA	
30kΩ	35.000 kΩ	0.020+0.010	0.020+0.007	100μΑ	
300kΩ	350.00 kΩ	0.040+0.010	0.040+0.007	5μΑ	
$3M\Omega$	$3.500~0~\mathrm{M}\Omega$	0.200+0.010	0.200+0.007	500nA	

<sup>\*6</sup> For negative values, to -10% f.s.

## ■ Temperature measurement accuracy (RM3544/RM3545)

• Temperature Sensor Z2001 (for RM3544/RM3544-01)

RM3545 TRM3544

Analog Input

RM3545

Range of guaranteed accuracy	-10.0 to 99.9 °C
Display refresh rate	Approx. 2 s
Guaranteed accuracy period	1 year

• Temperature Sensor Z2001 and RM3545/RM3544/RM3544-01 combined accuracy

t: Temperature measurement values [°C]

Temperature	Accuracy
-10.0 °C to 9.9 °C	$\pm (0.55 + 0.009 \times  \text{t-}10 ) ^{\circ}\text{C}$
10.0 °C to 30.0 °C	± 0.50 °C
30.1 °C to 59.9 °C	$\pm (0.55 + 0.012 \times  t-30 )$ °C
60.0 °C to 99.9 °C	$\pm (0.92 + 0.021 \times  t-60 )$ °C

Standalone instrument accuracy: ± 0.2 °C

(for RM3545)

Guaranteed accuracy range	0 to 2 V		
Maximum allowable voltage	2.5V		
Resolution	1mV		
Display range	-99.9 to 999.9 °C		
Measurement period (speed)	Approx. 50 ms,		
wicasurement period (speed)	no moving average		
Period of guaranteed accuracy	1 year		
Accuracy	+1%rdg +3 mV		

#### Resistance D/A output accuracy (RM3545)

RM3545

Output accuracy	Resistance measurement accuracy ±0.2%f.s., (temperature coefficient ±0.02%f.s./°C)
Response time	Measurement time + Max. 1 ms

#### Measurement speed typical values (RM3545) RM3545

## ■ Measurement time (RM3544) Measurement speed (ms)

MED

101

RM3544

	Measurement current	Measurement speed (ms)				
Range		FAST	MED		CI OWA	CI OWO
			50Hz	60Hz	SLOW1	SLOW2
10 mΩ	N/A	41	61	58	141	241
$100~\mathrm{m}\Omega$	High	41	61	58	141	241
$1000~\mathrm{m}\Omega$	High	2.2	22	19	102	202
10 Ω	High	2.2	22	19	102	202
100 Ω	High	2.8	23	20	103	203

\* With TC set to ON and the comparator set to ON

60Hz

18

**FAST** 

50Hz

21

<sup>\*</sup> Shortest time when using an external trigger source or with continuous mea-



SLOW

401

Tolerance: ±10% ±2 ms

<sup>\*7</sup> The maximum display range is 99,999dgt.

<sup>\*8</sup> Measurement current accuracy is ±5%.

Tolerance: ±10% ±0.2 ms

#### ■ Model Configurations and Options



#### **RESISTANCE METER RM3545 RESISTANCE METER RM3545-01** (with GP-IB)

#### **RESISTANCE METER RM3545-02**

(supports use of the MULTIPLEXER UNIT Z3003)

(Accessories: Power Cord ×1, CLIP TYPE LEAD L2101 ×1, TEMPERATURE SENSOR Z2001 ×1, male EXT I/O connector ×1, instruction manual ×1, applications disc ×1, USB cable (A-to-B type) ×1, extra fuse ×1)

#### Caution when considering the use of probes without guard terminals

Proper operation of the RM3545 and RM3544 is not guaranteed when using test leads (test probes) that lack guard terminals, for example test leads used with models such as the Resistance HiTester 3541 or m $\Omega$  HiTester 3540. Please use the test leads indicated in the RM3545 and RM3544 accessory and option documentation.



#### RESISTANCE METER RM3544

(Accessories: Power cord ×1, CLIP TYPE LEAD L2101 ×1, instruction manual ×1, extra fuse ×1)


#### **RESISTANCE METER RM3544-01**

(EXT I/O, with communication interface)

(Accessories: Power Cord ×1, CLIP TYPE LEAD L2101 ×1, male EXT I/O connector ×1, instruction manual ×1, applications disc ×1, USB cable  $(A-to-B type) \times 1$ , extra fuse  $\times 1$ )

#### Options













B: 83 mm (3.27 in), L: 1.5 m (4.92 ft)

(Bundled accessory)



B: 118 mm (4.65 in), L: 1.5 m (4.92 ft)

B: 140 mm (5.51 in), L: 1.5 m (4.92 ft)

PIN TYPE LEAD L2103 B: 138 mm (5.43 in), L: 1.5 m (4.92 ft)

#### Related products

Large motors, large transformers





Vehicle grounding lines, conductivity of aircraft fuselages





Temperature rise tests (Motors, choke coils, transformers)





#### **High-precision portable** resistance meter measures from $\mu\Omega$ to $M\Omega$

#### RESISTANCE METER RM3548

Basic accuracy: 0.02% Max. resolution :  $0.1 \mu \Omega$ 

Max. measurable current: 1A

- Measure from 0.0 μΩ (@ 1 A) to 3.5 MΩ
- Easily record up to 1,000 data points in memory simply by applying the instrument's probes.
- Smoothly capture temperature-rise test data using interval measurement.
- Portable design is ideal for maintenance and testing of large equipment.

For more information, please visit http://www.hioki.com.